

Remington Arms Co., Inc.  
Product Service  
Legal Case #:5221

## Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
211786	11/29/2010	11/29/2010	12/12/2010				

## Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Dans Gun Service and Repair		Dans Gun Servic	221 S Emory Ave	Peshtigo	WI	54157		W 715-938-0836

## Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI thumb				
PD shot shed	Cause:4038 Could Not Duplicate Concern		U	ok now
S	Concern:1025 Unexplained Discharge - No Mention of Safety Position			
C				

Adjustments have been altered, the trigger is loose within the housing. I still could not get it to fire unless the safety was off and the trigger was pulled fls.

## Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/7mm Rem Ma	n/a	A6299496	KI	5/20/1976
Date Purchased	Where Purchased	Accessories	Original Owner			
	GAMBLE SKOGMO MINNEAPOLIS MN		N			

loose trigger

Ammunition Information - None Defined

Other Products Information - None Defined

## Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace trig assm no charge as goodwill						

Repair/Replacement Cost	Repair/Replacement Date
120.07	12/12/2010

12/12/10 Per Ilion, very clean. Replace rig assm at no charge as a gesture of goodwill.cm

## Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		supry
	Exam Date		11/29/2010
	Product Type		RF
	Action Type		A
	Assigned To		Supry
Cause	4038	Could Not Duplicate Concern	I could not duplicate the customer's concern however, I noted that the adjustment screws had been adjusted outside of the factory.
Barrel	Description		24 inch Model 700 7mm Rem Mag caliber
	Date Code		KI
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while		

	Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	True	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Magazine	Condition	---Select---	
	Box Condition	Slightly Worn; Functioning	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		Model 700 Bolt Lock
	Function	Abused; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	not measured
	Notch	Slightly Worn; Functioning	
	Condition	Abused; Functioning	
Pull	---Select---	4.75 lbs	
Altered	Trigger	True	Two screws have been adjusted outside the factory. The trigger is loose because the spring has
Sub-Assembly		M/700 Bolt Lock	



Serial  
Number

A6299496

Model: 700



RE00211786

DANS GUN SERVICE AND REPAIR  
221 S EMORY AVE  
PESHTIGO WI 54157

10 LBS

1 OF 1


RS

SHIP TO:

R E M I N G T O N

14 HOEFLER AVE

ILION NY 13357

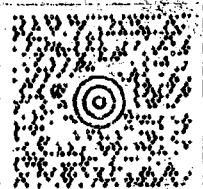

NY 135 0-01



UPS GROUND

TRACKING #: 1Z 4XX 596 90 6594 1105



BILLING: 3RD PARTY  
DESC: FIREARMS  
RETURN SERVICE

REF 1: DANS GUNS SERV/CD/EDH  
REF 2: 700/A6299496

HS: 12.0.17

LP2442 09 08 10/2010



International Shipping Notice: Carriers and Forwarders may be subject to the rules relating to liability and other terms and conditions established by the Convention for the Unification of Certain Rules Relating to International Carriage by Air (the "Warsaw Convention") or the Convention on the Contract for the International Carriage of Goods by Road (the "CMR Convention"). These rules may be subject to the jurisdiction of the courts of the U.S. in case of disputes with the U.S. carrier. For shipping please call 1-800-752-7862.

4.75 lbs TP

Install new X-MARK PRO adjustable  
trigger N/C as gesture of goodwill.

FRED 11/29/16

5221

# Remington

## Factory Repair Instructions

(NOTE: Please print and complete this form, and then include it with your firearm.)

Model Number: <u>Remington 700</u>		Serial Number: <u>A6299496</u>	
Are you the original owner?: <input checked="" type="checkbox"/> YES <input checked="" type="checkbox"/> NO			
Name: <u>DANIEL SWIATNICKI</u>		Date of Purchase: <u>around 1976</u>	
Address (no PO Boxes): <u>221 So. EMERY AVE.</u>			
<u>Des Moines</u>			
City: <u>Des Moines</u>		State: <u>WI</u>	Zip: <u>54157</u>
Phone (Daytime): <u>715-938-0836</u>		Fax: <u>715-582-1150</u>	
E-mail Address: <input type="checkbox"/> I would like to receive future e-mail updates from Remington.			
Please describe your problem: <u>he had issues with the safety</u> <u>the gun went off when not ready &amp; tore a</u> <u>hole in his thumb. The next time he closed</u> <u>the bolt &amp; the gun went off and shot</u> <u>a hole thru his hand. He will not use</u> <u>it until the trigger &amp; safety assembly is</u> <u>changed. He is afraid of it. I told him</u> <u>when yours are done he would not have any problem.</u>			
Ammunition Information: <u>Thanks</u>			
Manufacturer: <u>Remington</u>		Type: <u>Core Lok</u>	
Other (i.e. bullet weight/type, shot size, powder):		<u>160 grain</u>	
Handload Information:			
Powder Used:		Powder Weight:	
Case/Hull Used:		Primer Used:	
Bullet Type/Shot Size:		Reloader Used:	
Firearms Care (Cleaning and Lubrication):			
Brand of cleaning solution used:		<u>HOPPE'S &amp; OIL</u>	
How often do you clean the bore? (Months or Number of rounds)		<u>EVERY SEASON</u>	
How often do you clean the action? (Months or Number of rounds)		<u>" "</u>	
How often do you clean the trigger assembly? (Months or Number of rounds)		<u>CLEAN &amp; Blow out</u> <u>dust &amp; dirt if ANY</u>	
Brand of lubricant used:		<u>Inhibitor VC/OIL Blend</u>	

211786