Remington Arms Co., Inc. **Product Service** Legal Case #:5013

Case Information

RE# **Date Opened**  Date Opened(PS)

**Date Closed Incident Date** 

City

State Zip Age

Pre Lit Lit Obsolete

210813

11/18/2010

11/8/2010

11/19/2010

Street

Contact

Incident

Keith

Type Business First Name Last Name

Faseler

2807 Irvington Dr Pearland TX 77584

H 713-917-9728

E kfaseler@mhinc.com

Incident Information

Customer Information

Claims

Codes

Repair Est. Medical Treatment Medical Status

PΓ

PD

Cause:4038 Could Not Duplicate Concern

Concern:1007 Fired on Safe Release

Unknown

Fired on safety S release

11/8/10 Per call from Faseler, he bought his 700 BDL 2nd hand 10 years ago and had if fire on safety release this weekend. He was able to do it three times afterward but it does not now.cm

Firearm Information

Mfg.

Type

Model/Ga.

SKU

Serial Bbl. DOM

Remington

CF/BA

700/270 WIN

n/a

C6433014 WJ 8/31/1989

Date Purchased

Where Purchased

Accessories

Original Owner

ARKANSAS IMPORT & DISTRIB.

SCOPE, RINGS, BASE

N

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement

Release of Claims

Release Date

Reimbursement

Cash Settlement Reim. Date

APV

Cash Date APV

Per Ilion, replace TPA, clean at 1/2 normal charges

> Repair/Replacement Cost

Repair/Replacement Date

11/8/10 Emailing letter and ARS.cm 11/22/10 Per Ilion, could not duplicate concern. Trig assm very dirty and rusty. Parts working sluggish. Can offer to replace TPA, clean and test fire at 1/2 normal charges. Emailed quote to Faseler.cm 11/23/10 Spoke with Faseler by phone, explained condition. I agreed to remove the shipping as goodwill and he will pay the remaining. He said he had not adjusted trigger but he bought it 2nd hand. Emailed picture of trigger and info on how to clean and oil as well as link to online owner's manual.cm

Examination[Remington/CF/BA]

| Part | Sub-Part | Code | Comment  |
|------|----------|------|----------|
|      | Examiner |      | B.TRAVIS |

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=5013&Type=Case

11/23/2010


| 'n | riı | ntI | )is | nl  | av |
|----|-----|-----|-----|-----|----|
| T  | TII | ıw  | /13 | ıμı | u  |

| • '          | Exam Date                 | 1                             | 11/19/2010            |
|--------------|---------------------------|-------------------------------|-----------------------|
| Examination  | Product Type              | <u> </u><br>                  | RF                    |
|              | Action Type               | ]                             | A                     |
|              | Assigned To               | ] ,<br>]                      | T.NAGLE               |
|              | Assigned 10               | Could Not Duplicate           | 1.NAGLE               |
| Cause        | 4038                      | Concern Concern               |                       |
|              | Description               |                               | 22" 270 WIN           |
|              | Date Code                 |                               | WJ                    |
|              | Bore Plugged              | False                         | ·                     |
| Barrel       | Bulged                    | False                         |                       |
| Barto        | Fired                     | False                         |                       |
|              | Fired while Obstructed    |                               |                       |
|              | Muzzle/Crown<br>Condition | Slightly Worn;<br>Functioning |                       |
|              | Firing Pin                | Slightly Worn;<br>Functioning |                       |
|              | Shroud                    | Slightly Worn;<br>Functioning |                       |
| Bolt         | Face                      | Slightly Worn;<br>Functioning |                       |
|              | Handle                    | Slightly Worn;<br>Functioning |                       |
|              | Stop                      | Slightly Worn;<br>Functioning |                       |
|              | Condition                 | Slightly Worn;<br>Functioning |                       |
| Extractor    | Cut Condition             | Slightly Worn;<br>Functioning |                       |
|              | Ext/Eject Test            | False                         |                       |
|              | Block Condition           | Select                        |                       |
| Locking      | Lug Condition             | Slightly Worn;<br>Functioning |                       |
|              | Notch Condition           | Select                        |                       |
|              | Exterior Condition        | Slightly Worn;<br>Functioning | ACTION VERY DIRTY     |
| Overall      | Stock Condition           | Slightly Worn;<br>Functioning |                       |
|              | Fore End Condition        | Select                        |                       |
| Receiver     | Condition                 | Slightly Worn;<br>Functioning |                       |
|              | Bulged                    | False                         |                       |
| Safety       | Description               |                               | STANDARD M/700 SAFETY |
|              | Function                  | Like new; Functioning         |                       |
|              | Sub-Assembly              | Non-ISS                       |                       |
|              | Lift                      | Select                        | N/A (SCOPED)          |
| Sear         | Notch                     | Slightly Worn;<br>Functioning |                       |
|              | T                         | Test Fired                    | False                 |
| Feeding Test | Tests                     | False                         |                       |

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=5013&Type=Case

11/23/2010

| Trigger                     | Condition    | Slightly Worn;<br>Functioning | VERY DIRTY,RUSTY                      |  |
|-----------------------------|--------------|-------------------------------|---------------------------------------|--|
|                             | Pull         | Select                        | 5#                                    |  |
|                             | Altered      | III THE                       | SEALANT REMOVED,PULL SCREW<br>ALTERED |  |
|                             | Sub-Assembly | M/700 Non-Bolt Lock           |                                       |  |
| Non-Remington<br>Components | Description  |                               | SCOPE,RINGS,BASE                      |  |

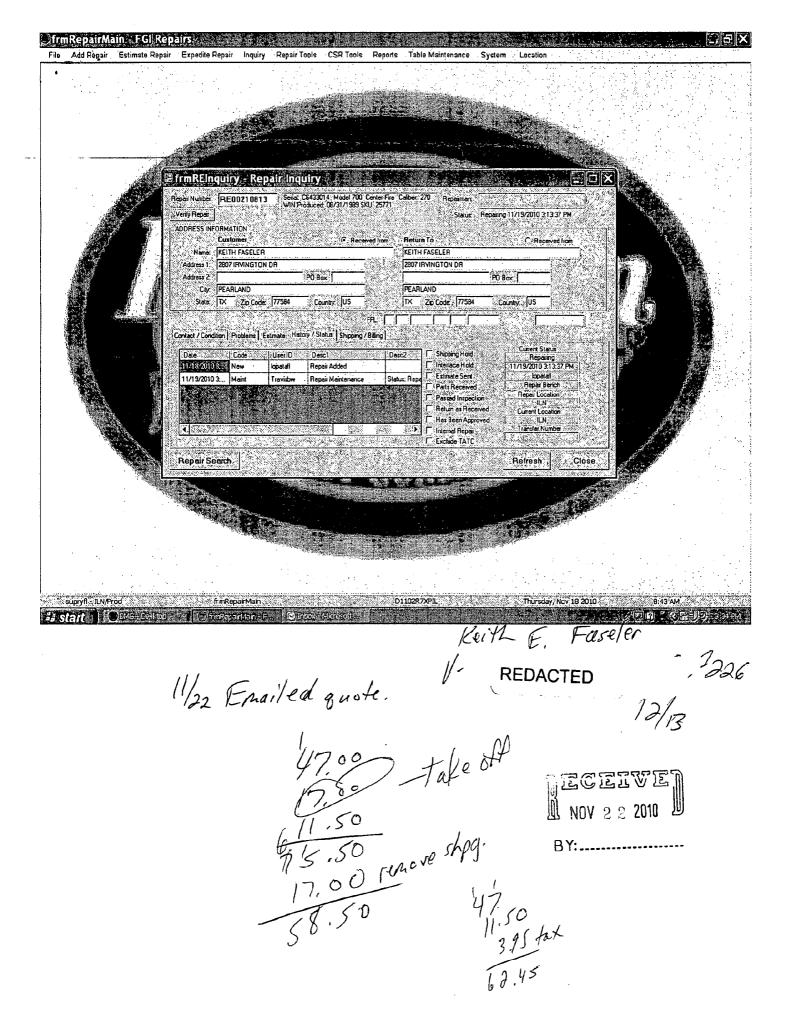

72" VS 8/89 5#

5013

November 8, 2010

Keith Faseler 2807 Irvington Dr Pearland, TX 77584

Subject: #5013, Model 700

Dear Mr. Faseler,

Per our phone conversation, you should receive an email with your prepaid UPS ground shipping label for shipment of the firearm to our factory within the next 24-48 business hours. Please include a copy of this letter with the firearm. The letter inside is important as sometimes the outside label gets damaged in transit and we want to be sure the firearm is logged in correctly. Please mark the ends of the box with "Product Service".

I apologize for the inconvenience that this incident has caused and I hope that these actions will keep you as a loyal Remington customer.

Sincerely,

Christy Mitchell Consumer Affairs Administrator Phone: 800-243-9700, ext 8684 christy.mitchell@remington.com

C6433014 Model: 700 RF00210813 could not suplicate concern.

Titio. ASSON very dirty+ musty.

parts working sluggish, can

often to replace TPA, clean +

restfice at 1/2 vormal

changes

Quste

Remington Arms Company, Inc. • 870 Remington Drive • P.O. Box 700 • Madison, NC 27025 Phone 800-243-9700 • www.remington.com



Remington Arms Company, Inc. 870 Remington Drive P. O. Box 700 Madison, NC 27025-0700

## ARS LABEL REQUEST FORM

| DATE:            |                    |        | STED BY:     | christy |
|------------------|--------------------|--------|--------------|---------|
| QUANTITY:        | 11                 | WEIGHT | DED DVCKVCE  |         |
| PLEASE OHEOK ONE |                    |        |              |         |
| MEDIA            | Email to him at:   | ļ      |              |         |
| COORDINATOR      | kfaseler@mhinc.com |        |              |         |
| TO MAIL          |                    | I WILL |              |         |
| DESCRIPTION:     |                    |        | 1            | Λ       |
| }                | 700                |        | 1            |         |
|                  |                    |        | /            | (N/     |
| }                |                    |        | √            | · /     |
|                  |                    |        | kfaseler@mhi | nc.com  |
|                  |                    |        |              |         |

## LABEL INFO

| MAIL LABEL TO:  | Keith Faseler<br>2807 Irvington Dr<br>Pearland, TX 77584      | <br>4XX595 NOV 9, 2010 ALL CURR USD 1 OF 1<br>SYC GNOCOM ACT UT 10.0 LBS<br>TRACKINGH 1Z4XX5009068169976<br>REF 1:KEITH FASELER/CD/CM<br>REF 2:700                                     |
|-----------------|---|--|
| RETURN ITEM TO: | Email to him at:<br>kfaseler@mhinc.com<br>Rem Product Service | HANDLING CHARGE 0 00 SYC T/P USD SINGLE-PIECE PUB RATE CHRES: SYC T/P USD DY 0.00 RS 1.00 RS 1.00 PR 0.00 SD 0.00 SD 0.00 SP 0.00 PR 0.00 SP 0.00 TOT PUB CHG 11 04 PUB-HANDLING 11.04 |
|                 |   |  |

PLEASE COMPLETE ALL PARTISTOF THIS FORM AND SEND TO THE MEDIA COORDINATION



