PrintDisplay

Remington Arms Co., Inc.
Product Service
Legal Case #:5049

Case Information

 RE#
 Date Opened
 Date Opened(PS)
 Date Closed
 Incident Date
 Pre Lit
 Lit
 Obsolete

 214109
 12/10/2010
 11/10/2010
 12/14/2010
 11/7/2010

Customer Information

Street Zip **Business** First Name Last Name City State Contact Type Age 224 Maple Ct Jeff **Phillips** Rockwall 75032 W 903-873-4087 Incident TX

Incident Information

Claims Codes Repair Est. Medical Treatment Medical Status

PΙ

C

PD Cause:4038 Could Not Duplicate Concern

Unknown

S bolt

Concern:1020 Fired on Bolt Opening

11/10/10 Per call from Phillips, he squeezed the trigger on the 700 twice and it did not fire, he went to open the bolt and it fired. He thinks some parts are sticking. He bought it second hand from his stepfather who was the original owner in the '80's.cm

Firearm Information

Mfg. Remington Type CF/BA **Model/Ga.** 700/270 WIN SKU

Serial Bbl.

DOM

Date Purchased

Where Purchased

Accessories

n/a Original Owner C6462658 RJ 11/7/1989

Date I di chased

THE GUN & TACKLE STORE

_

N

CONCERN:FIRED OPENING BOLT

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Settlement

Release of Claims

Release Date

Reimbursement

Cash Settlement Reim. Date APV Cash Date APV

Per Ilion, replace TPA, clean, test fire at 1/2 normal cost

> Repair/Replacement Cost

Repair/Replacement Date

11/10/10 Mailing ARS.cm 12/22/10 Per Ilion, could not duplicate concern. Trig assm dirty and sticky causing parts to work sluggish. Replace TPA, clean, test fire at 1/2 normal cost. Emailing inspect/quote to Phillips.cm 12/30/10 Phillips approved by email sent 12/29 and I called him for credit card info.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		12/14/2010
	Product Type		RF

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=5049&Type=Case

12/30/2010

}	Action Type		A	
	Assigned To		T.NAGLE	
Cause	4038	Could Not Duplicate Concern		
 	Description		22" 270 WIN	
	Date Code		RJ	
	Bore Plugged	False		
Barrel	Bulged	False		
	Fired	False		
	Fired while Obstructed			
	Muzzle/Crown Condition	Slightly Worn; Functioning		
	Firing Pin	Slightly Worn; Functioning		
	Shroud	Slightly Worn; Functioning		
Bolt	Face	Slightly Worn; Functioning		
	Handle	Slightly Worn; Functioning		
	Stop	Slightly Worn; Functioning	BINDS	
	Condition	Slightly Worn; Functioning		
Extractor	Cut Condition	Slightly Worn; Functioning		
	Ext/Eject Test	False		
	Block Condition	Select		
Locking	Lug Condition	Slightly Worn; Functioning		
	Notch Condition	Select		
	Exterior Condition	Slightly Worn; Functioning		
Overall	Stock Condition	Slightly Worn; Functioning		
	Fore End Condition	Select		
D	Condition	Slightly Worn; Functioning		
Receiver	Bulged	False		
	Description		STANDARD M/700 SAFETY	
Safety	Function	Like new; Functioning		
	Sub-Assembly	Non-ISS		
Sear	Lift	Select	.013	
	Notch	Slightly Worn; Functioning		
	T4-	Test Fired	False	
Feeding Test	Tests	False		
	Condition	Slightly Worn; Functioning	DIRTY,STICKY SLUGGISH	
Tricant	Pull	Select	4.5#	
Trigger	Altered	True	SET SCREWS ALTERED	
	Sub-Assembly	M/700 Non-Bolt Lock		

November 10, 2010

Jeff Phillips 224 Maple Ct Rockwall, TX 75032

Subject: #5049, Model 700

Dear Mr. Phillips,

Per our phone conversation, enclosed is the prepaid UPS ground shipping label for shipment of the firearm to our factory for inspection. Please include a copy of this letter with the firearm. The letter inside is important as sometimes the outside label gets damaged in transit and we want to be sure the firearm is logged in correctly. Please mark the ends of the box with "Product Service".


I apologize for the inconvenience that this incident has caused and I hope that these actions will keep you as a loyal Remington customer.

Sincerely,

Christy Mitchell Consumer Affairs Administrator Phone: 800-243-9700, ext 8684 christy.mitchell@remington.com

enclosure

量C6462658 E00214109 could not deplicate concern, T.A. DIRTY +STICKY cousing PARTS toward sluggish. replace TPA, Elenn + Tret Rine AT 1/2 wormal cost. Quote

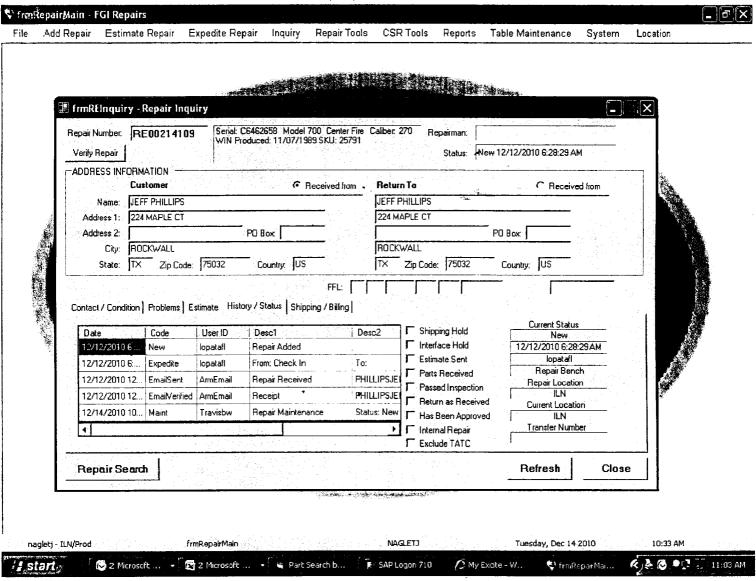

DEC 172010 D

Model Number: 700	Serial Number: C646 2 658			
Are you the original owner?: YES X NO				
Name: Jeff Phillips >	Date of Purchase: 1993			
Address (no PO Boxes): 224 Maple ct				
City: Rock wall	State: 7X Zip: 75°C32			
Phone (Daytime): 214 448 6809	Fax: 903 873 40.92			
E-mail Address: (if e-mail address is provided, notification of receipt and shipment will be sent) Phillips je FF & Sbeglobal, net				
E-mail Address:				
I would like to receive future e-mail updates from Ren				
Please describe your problem and date of occurrence: On 11-7-2010 while hunting, I attempted to fire the enclosed lifle. I squeezed the trigger twice and the anclosed rifle failed to fire. I attempted to exposed the breech by turning the bolt and the rifle fired unexpectedly without touching the trigger in anyway. I thought I had a bad round of ammunition and was attempting to reload by opening the bolt.				
Ammunition Information:				
Manufacturer: Reming ton	Type: Express core-			
Other (i.e. bullet weight/type, shot size, powder): Z70 Win, 150 gr. Core-10kt Sp.				
Handload Information:				
Powder Used:	Powder Weight:			
Case/Hull Used:				
Bullet Type/Shot Size: Reloader Used:				

Firearms Care (Cleaning and Lubrication):
Brand of cleaning solution used: Hoppes & Brand of cleaning solution used:
How often do you clean the bore? (Months or Number of rounds) Three months
How often do you clean the action? (Months or Number of rounds)
How often do you clean the trigger assembly? (Months or Number of rounds) /2 months
Brand of lubricant used: Remington
How often do you lubricate the bore? (Months or Number of rounds) Three months
How often do you lubricate the action? (Months or Number of rounds)
How often do you lubricate the trigger assembly? (Months or Number of rounds)
Have you reviewed the cleaning and maintenance recommendations on our web site or in our owners manual?
YES NO
When was the last time that your firearm was serviced by a Remington authorized
repairman/gunsmith?)
What were the services performed?)
Remington Arms Co., Inc.
Attn: Arms Service Division
14 Hoefler Avenue
llion, NY 13357 • • •
⚠WARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND SERIAL NUMBER OF YOUR FIREARM.
:: Record the serial number of your firearm before sending it. :: Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.)
:: Remove all accessories from your firearm to prevent loss or damage. :: Provide a return address on both the outside and inside the box. Shipments without a proper return address will be refused.
www.

. ~	.•					Car			
_	Case #	5049	Date of Call	11/10	Date of lincident	1/2	PreLit Lit	Obs	
-}	Reporter name address				Incident Name/Age address	Jet 224	A Phillips Maple Co wall, TX	- K	
	contact #'s				contact #'s	Rock 903	wall, TX 2-873-40	75032 87	
	email				email				
	Injury	no							
	Medical Treatment								
	Alleged cause	Thinks s	one pa	ets a	re s	ticki,	na		
	Firearm	Ser#	Cal JOWS'	DOM	Orig owner?	When/W	here purchased	ghtnew &	ترز
) !	Ammunition	Factory/Reload	Manuf	Caliber	Bullet type/wgt	Lot#	Additional info		
	Other Product								
		Squeeze Went to	d tra	gger bolt	twice , it	+ i fire	t wouldn	it fine	~
	Notes:								
	Customer's Request				<u>-</u>				
. '	My actions/ offers								



Remington Arms Company, Inc. 870 Remington Drive P. O. Box 700 Madison, NC 27025-0700

ARS LABEL REQUEST FORM

DATE:	11/10/2010 REQUESTED BY:	christy
QUANTITY:	1 WEIGHT PER PACKAGE:	10
PLEASE GHECK ONE		
MEDIA COORDINATOR		XXXXXXXXXXXXX
TO MAIL	I WILL MAIL	
DESCRIPTION:		
	700	

LABEL INFORMATION

MAIL LABEL TO:	Jeff Phillips 224 Maple Ct Rockwall, TX 75032	
RETURN ITEM TO	= - Rem Prod Serv	
THE TOTAL TEMPO	Ilion, NY	

PLEASE COMPLETIE ALL PARTIS OF THIS FORM: AND SEND TO THE MEDIA COORDINATOR:

```
4XX596 NOV 10, 2010 ALL CURR USD 1 OF 1 SVC GNDCOM ACT UT 10.0 LBS
TRACKING# 124XY5969067595476
REF 1:JEFF PHILL IPS/CD/CM
REF 2:700

HANDLING CHARGE 0.00
SINGLE-PIECE PUB RATE CHRGS: SVC T/P USD DV 0.00 CO 0.00 RS 0.50
DC 0.00 DGD 0.00 SD 0.00
DC 0.00 PR 0.00 SP 0.00
TOT PUB CHG 9.45 PUB+HANDLING 3.45
```

