

Remington Arms Co., Inc.
Product Service
Legal Case #:5650

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
218723	1/13/2011	1/14/2011	1/14/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		John	Northwood	19 Bailey St	Plains	PA	18705		W 610-256-0128

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4038 Could Not Duplicate Concern		Unknown	
S	Fired when closing bolt Concern:J008 Fired on Bolt Closing			
C				

1/27/11 Per note with rifle, the rifle discharged when he was loading it, as he closed the bolt. It has a bolt lock.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/308 WIN	n/a	6301971	BT	1/1/1970
Date Purchased	Where Purchased	Accessories	Original Owner			
	COLOSIMO PHIL PA	SCOPE,RINGS,TWO PIECE BASE	U			

CONCERN:FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean, test fire under BLSM program price						
	Repair/Replacement Cost	Repair/Replacement Date				
	43.18	1/27/2011				

1/27/11 Per Ilion, could not duplicate concern. Trigger assm dirty. Replace TPA, clean, test fire under BLSM program price of \$20 + S&H. Owner called Consumer Dept 1/21 and approved repair.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B. TRAVIS
	Exam Date		1/14/2011
	Product Type		RF
	Action Type		A
	Assigned To		T. NAGLE
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		22" 308 WIN
	Date Code		BT
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	SLUGGISH
	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	---Select---	AFT MKT BROKEN
	Fore End Condition	---Select---	
	Condition	Slightly Worn; Functioning	
	Bulged	False	
	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
	Lift	---Select---	N/A
	Notch	Slightly Worn; Functioning	
	Test Fired	False	
	Tests	False	
	Condition	Slightly Worn; Functioning	DIRTY
	Pull	---Select---	3.5#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	
	Description		SCOPE RINGS, TWO PIECE BASE

5650

22"
BT 1/70
3.54

I am sending this rifle to you because it discharged when I was loading it, as I closed the bolt. It is also necessary to take the gun out of safe mode to unload it.

Please contact me after your evaluation.

Thank you,

John Northwood

610-256-0128

Return shipping address.

Midvale Paper Box Co.

19 Bailey St

Plains, PA.

~~+9008~~

18705

20.40

27. -

35. -

82.40


29.22

43.18


Serial Number:

6301971

Model: 700

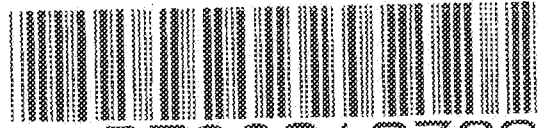

RE00218723

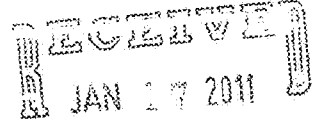

BY:

could not duplicate concern
F.A. DIRTY. Replace TPA, clean
+ TEST Rifle UNDER BCP for
\$10.00 + ship.

Quote

STR. Damaged in transit.
Will replace w/used scope in
good cond. at N/C

