

Remington Arms Co., Inc.
Product Service
Legal Case #5831

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
221986	2/4/2011	2/7/2011	2/7/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Richard	Gilworth	25751 Cherry Ln	Jemseyville	IL	62052		H 618-498-3133 C 618-535-7240

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4054 As received Follows Down			
S	Will fire if you work the bolt fast and hard Concern:1025 Unexplained Discharge - No Mention of Safety Position		Unknown	
C				

2/25/11 Per note with rifle, will fire without pulling the trigger if you work the bolt fast and hard. If you work it slow and easy it will hold and not fire until the trigger is pulled.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/222 REM MA	n/a	59039	AK	3/1/1963
Date Purchased	Where Purchased	Accessories	Original Owner			
		TWO PIECE BASE	U			

CONCERN:FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean and test fire under BLSM program						
	Repair/Replacement Cost	Repair/Replacement Date				
	77.90	2/25/2011				

2/25/11 Per Ilion, will follow down. Trigg asrm dirty and set screws altered. Replace TPA, clean and test fire under BLSM program price of \$20 + shipping.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		2/7/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4006	Altered Adjustments or Components	
	Description		20" 222 REM MAG
	Date Code		AK
	Bore Plugged	False	
	Bulged	False	

Barrel	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	ACTION ONLY
	Stock Condition	---Select---	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.004
	Notch	Slightly Worn; Functioning	O/S DOUBLE
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY, VERY LITTLE SEAR ENGAGEMENT
	Pull	---Select---	1.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE BASE

Gentlemen,

5831

20"
AK3/b2
1.5"
.004

This rifle will fire without the trigger being pulled if you work the bolt fast and hard. If you work it slower and easy it will hold and not fire, until trigger is pulled.

I have three other 700 B.L.G.'s, so far I have not had a problem with them.


I thank you

Sincerely,

Richard Gilworth

25751 Cherry Ln.

Jerseyville, Il. 62053

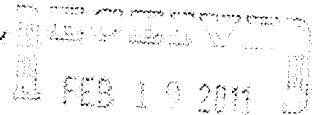

618-498-3133 (home)

BY.....

618-535-7240 (cell)

will follow down. T.A. dirty +
set screws altered. Replace
TPA, clean + test fire under
BLP for \$20.00 + ship

Quote

114.90


37 -

77.90

Serial Number

59039

Model: 700

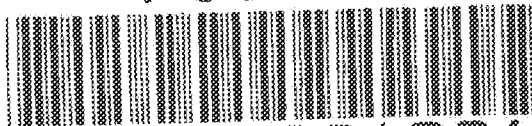

RE00221986

