

Remington Arms Co., Inc.
Product Service
Legal Case #:5790

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
221114	1/28/2011	1/31/2011	1/31/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Robert	Hering	484 Rainbow Beach Rd	Necnah	WI	54956		
Reporter	Appleton Scheels		Appleton School	4301 W Wisconsin Ave	Appleton	WI	54913		W 920-830-2977

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PJ				
PD	Cause:4038 Could Not Duplicate Concern			Unknown
S	Fired when safety was on Concern:1005 Unexplained Discharge Safe ON			
C				

2/17/11 Per note with rifle, fired when safety was on.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CP/BA	700/7MM08 REM	26285	S6418132	WV	8/27/2001 5:51:03 AM
Date Purchased	Where Purchased	Accessories	Original Owner			
	BILL HICKS & CO LTD	TWO PIECE BASE,RINGS	U			

CONCERN:FIRED WITH SAFETY ON

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean and test fire at 1/2 normal cost						
	Repair/Replacement Cost	Repair/Replacement Date				

2/17/11 Per Ilion, could not duplicate concern. Trigger and pin rusty, rust on safety ring clip retainer. Replace TPA, clean and test fire at 1/2 normal cost. Customer approved by letter on 2/15.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/31/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		22" 7MM08 REM SS
	Date Code		WV
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	--Select--	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	--Select--	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	--Select--	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	ISS	
Sear	Lift	--Select--	.015
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	TRIG & PIN RUSTY SAFETY RING CLIP RUSTY
	Pull	--Select--	S#
	Altered	False	
	Sub-Assembly	M/700 Non-Bolt Lock	
Non-Remington Components	Description		TWO PIECE BASE,RINGS

5990

22"
WV 8/01
5#
1015

F 014823


REPAIR
TAG

7mm-08rem
APPLETON SCHEELS
Fox River Mall
4301 West Wisconsin Ave
Appleton, WI 54913
920.830.2977

CUSTOMER <u>Robert Henning</u>		INVOICE NO. F 014823	
ADDRESS <u>484 Rockwood Dr. N. Appleton, WI 54911</u>		DATE RECEIVED <u>1-21</u>	
MODEL OR SERIAL NO. <u>700 SE 418132</u>	PHONE <u>920-992-0</u>	PROMISED DELIVERED	
TROUBLE REPORTED <u>Fixed when SAFETY WAS ON</u>			
<u>Please Check</u>			
DESCRIPTION OF MATERIAL USED		AMOUNT	
<u>Insurance \$700</u>			
<u>7mm 08</u>			
<u>#133</u>			
		TOTAL MATERIALS	
		LABOR	
		TAX	
RECEIVED BY <u>KJ</u>	ON COMPLETION OF WORK <u>→</u>	TOTAL	

Thank You! CASH


Serial Number: **S6418132**
Model: **700**

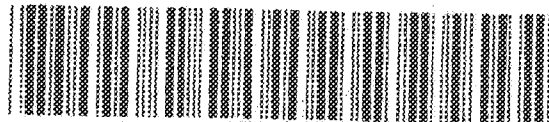

RE00221114

could not duplicate concern.
Trigger pin rusty, Rust on safety
ring, clip returned. Replace TPA,
clean & Test Rifle at 1/2 normal
cost.

Quote



BY:

7 01

