

Remington Arms Co., Inc.
Product Service
Legal Case #:5720

Case Information

RES#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
219619	1/18/2011	1/20/2011	1/20/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Jerrold T	Jones	912 S. Macomber St	Greenville	MI	48838		H 616-302-5981 W 616-754-3443 C 616-302-5981

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4054 As received Follows Down		Unknown	
S	Fired when opening bolt	Concern:1020 Fired on Bolt Opening		
C				

2/14/11 Per letter with rifle, Jerrold purchased this 700 new in 1968 and it has served him well for 40 yrs. During the 2010 deer season, he and his son were hunting together and he decided to unload his rifle before tagging the deer. He turned away from his son and pointed it toward the ground, he pushed the safety forward to fired position and as he lifted the bolt the gun fired.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl	DOM
Remington	CF/BA	700/270 WIN	n/a	316081	RP	11/1/1967
Date Purchased	Where Purchased	Accessories	Original Owner			
		TWO PIECE BASE	Y			

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Hion, offer to replace TPA, clean, test fire under BLSM program price						
	Repair/Replacement Cost	Repair/Replacement Date				
	45.40	2/14/2011				

2/14/11 Per Hion, will follow down. Trigger assm very dirty and sticky, set screws altered. Can offer to replace TPA, clean, test fire under BLSM program price of \$20 + shipping.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/12/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4054	As received Follows Down	POOR MAINTENENCE
Barrel	Description		22" 270 WIN
	Date Code		RF
	Bore Plugged	False	
	Bulged	False	

	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	ACTION ONLY
	Stock Condition	---Select---	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Slightly Worn; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.008
	Notch	Slightly Worn; Functioning	SLUGGISH
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY, STICKY, PARTS WORK SLUGGISH
	Pull	---Select---	2.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE BASE

January 6, 2011

5720

22"
RP 11/6
2.5#
100Y

Remington Arms Co, Inc.
Ilion Firearms Plant
Attention: BL Safety Program
14 Hoefler Ave.
Ilion, NY 13357

Dear Remington Arm Representative,

I am shipping my Remington 700, .270 caliber SN 316081 to you for safety repairs or parts replacement. This gun was purchased new in the summer of 1968. I am the original owner of the firearm. It has served me well and has been a hunting companion for more than 40 years of deer hunting.

During Michigan's 2010 firearms deer season, my son and I were hunting together. Our hunt had ended successfully and I decided to unload my rifle before tagging the deer. I turned 180 degrees away from my son and pointed the muzzle toward the ground. I pushed the safety forward into fire position and as I lifted the bolt, the gun fired. Thankfully, it was pointed harmlessly toward the ground and no injury occurred.

After your inspection of this rifle, please advise me regarding your recommendation for remedy and the cost of such repairs that will make it a safe and dependable firearm.

I can be reached at any of the following:

(616) 302-5981 (Cell)
(616) 225-9448 (Home)
(616) 754-3445 (Work)

I am thanking you in advance.


Sincerely,


Jerrold T. Jones
912 S. Macomber St.
Greenville, MI 48838

Serial Number

316081

Model: 700

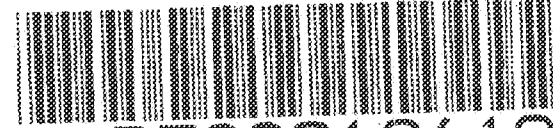

RE00219619

RECEIVED
JAN 24 2011
BY: _____

will follow down. T.A. very
dirty + sticky, set screws
altered. Can offer to replace
+ PA, clean + test fire under
BLP R.R. \$ 20.00 + ship


Quote

January 10, 2011

To Whom it May Concern;

The contents of the package I am shipping via Unites States Postal Service to Remington Arms in Ilion, New York, for repairs are firearm parts. Namely, the barrel, bolt, and trigger mechanism of a Model 700 Remington center fire rifle. There is no ammunition included nor is there a magazine, trigger guard, or stock. The parts would not be considered adequate components for firing condition.

Sincerely,

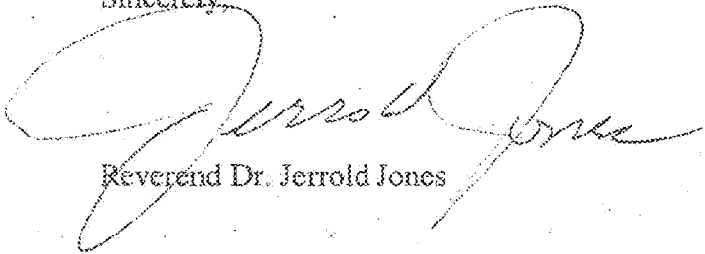

Reverend Dr. Jerrold Jones

20.40
27.-
35.-

22.40
37.-

45.40

