

Remington Arms Co., Inc.
Product Service
Legal Case #:5990

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
225478	3/10/2011	3/11/2011	3/11/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Blair	Soles	5767 Wareneck Rd	Schley	VA	23154		H 804-693-3458

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4006 Altered Adjustments or Components			Unknown
S	Fired when chambering a round Concern:1008 Fired on Bolt Closing			
C				

3/23/11 Per letter with rifle, this rifle has gone off at least one time when a round was chambered in the gun.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	BOM
Remington	CP/BA	760/22-250 REM	n/a	6227455	CS	4/1/1969
Date Purchased	Where Purchased	Accessories	Original Owner			
	SCHLATTER HDWE FT WAYNE IND		U			

CONCERN.FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Hion, replace TPA, clean, test fire at BLSM program price						
	Repair/Replacement Cost	Repair/Replacement Date				
	30.40	3/23/2011				

3/23/11 Per Hion, trigger assm set screws altered. Trigger not returning properly. Replace TPA, clean, test fire at BLSM program price of \$20 + S&H. Owner approved charges 3/15.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		3/11/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4006	Altered Adjustments or Components	
Barrel	Description		24" 22-250 REM HB
	Date Code		CS
	Bore Plugged	False	
	Buiged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn, Functioning	

Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	007
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	TRIG NOT RETURNING PROPERLY
	Pull	---Select---	2.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	

5990

3-3-11

24"
CS 4/69
2.50
.007

Dear Remington, S.M.P.

This Model 700, 22-250, serial #
6227455 has gone off at least one
time when a round was chambered in
the gun. It is a nice gun, but needs
to be fixied.

Blair Soles

Phone # 804-693-3458

Box 37

5767 Wareneck Rd.

Schley VA. 23154

Ship To: Smith's Florist & Gift Shoppe

6626 MAIN St.

Box 782


Gloucester VA. 23061

RECEIVED
MAR 5 2011

BY:

6227455

Model: 700

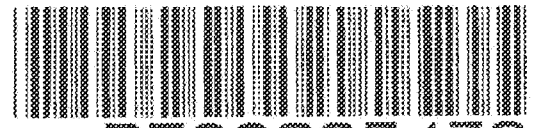

RE00225478

T.A. set screws A/tened
Trio. NOT RETURNING
properly. Rept me TPA,
clean + TUST fine
under DLP Rea \$20.00 +
ship

Quote

20.40
27. -
20. -
67.40
37. -
30.40



