

Remington Arms Co., Inc.

Product Service

Legal Case #:5731

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
219751	1/20/2011	1/21/2011	1/21/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Thomas	Seifert	325 Buttermilk Rd	Easton	PA	18042		H 610-253-2385

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4054 As received Follows Down		Unknown	
S	Fired on safe release Concern:1007 Fired on Safe Release			
C				

2/10/11 Per note with rifle, fired when he took safety off.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPR	n/a	A6722049	BV	1/26/1979
Date Purchased	Where Purchased	Accessories	Original Owner			
	JERRYS SPT CTR MONTDALE PA	SEE THRU SCOPE RINGS	U			

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Lion, replace TPA, clean, test fire under BLSM program price						
	Repair/Replacement Cost	Repair/Replacement Date				
	23.18	2/10/2011				

2/10/11 Per Lion, will follow down. Trigger asm is dirty and sticky. Trigger binds back. Replace TPA, clean, test fire under BLSM program price of \$20 + shipping and tax. Owner approved 2/8.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B,TRAVIS
	Exam Date		1/21/2011
	Product Type		RF
	Action Type		A
	Assigned To		T,NAGLE
Cause	4054	As received Follows Down	POOR MAINTENENCE
Barrel	Description		22" 3006 SPR
	Date Code		BV
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	SCRATCHED,DENTED MOSTLY ON THE LEFT SIDE
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.007
	Notch	Slightly Worn; Functioning	SLUGGISH
	Tests	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY,STICKY TRIG BINDS BACK
	Pull	---Select---	10+#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		SEE THRU SCOPE RINGS

DEAR SIR:

I HAD A CONVERSATION
WITH RON. IN DEC. &
TOLD HIM MY PROBLEM
WITH THIS RIFLE. I WAS
TOLD TO SEND IT BACK &
EXPLAIN THE PROBLEM.


① THE RIFLE WENT OFF WHEN
I TOOK SAFETY OFF.

② THE RIFLE WAS OK THE NEXT
COUPLE OF TIMES I TRIED IT.

③ SOME TIME LATER I TRIED
IT AGAIN WITHOUT SHELLS.

& THE FIRST 2 TIMES IT
FIRED AGAIN & THEN IT
WAS OK.

PLEASE FIX THIS IT
IS MY FAVORITE HUNTING
RIFLE.

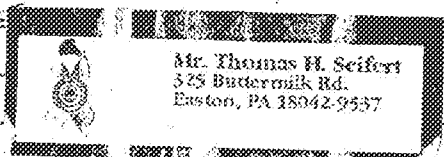

610 253 2385

5731

22"
BV 1/79
10+
007

20.40


27.-

15.-

62.46

39.82


23.18

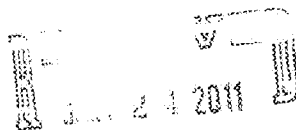

BY:

A6722049

Model: 700



RE00219751

will follow down. T.A. IS DIRTY &
STICKY. TRIG BINDS BACK.

Replace TPA, clean & test fire
under BLP. Ron's 20.00 ship

Quote

