

Remington Arms Co., Inc.  
Product Service  
Legal Case #:6017

## Case Information

RE #	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
225958	3/16/2011	3/22/2011	3/22/2011				X

## Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Cody	Sanders	9495 Patricksburg Rd.	Spencer	IN	47460		H 812-585-1353

## Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4006 Altered Adjustments or Components		Unknown	
S	Concern:1007 Fired on Safe Release			
C	FSR			

Customer sent gun in with a note. He stated the rifle has a recall & he wants it fixed. He had a FSR while hunting. No damage, No injury. df

## Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	660/243 WIN	n/a	6201132	PS	6/1/1969
Date Purchased	Where Purchased	Accessories	Original Owner			
	VAN CAMP HDWE INDIANAPOLIS IND		U			

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/660/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion - Repair @ n/c under recall						

Repair/Replacement Cost	Repair/Replacement Date
\$97.51	3/30/2011

Per Ilion - TA set screws altered. Trigger will not return properly. Replace TA, clean & test fire under recall @ n/c. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B. TRAVIS
	Exam Date		3/22/2011
	Product Type		RF
	Action Type		A
	Assigned To		T. NAGLE
Cause	4006	Altered Adjustments or Components	HAS NOT BEEN UPDATED W/NEW TPA
	Description		20" 243 WIN
	Date Code		PS
	Bore Plugged	False	

Barrel	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/660 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.004
	Notch	Slightly Worn; Functioning	
Feeding Test	Tests	Test Fired	False
		False	
Trigger	Condition	Slightly Worn; Not Functioning	TRIG NOT RETURNING PROPERLY
	Pull	---Select---	2#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	Other Remington	

Return shipping address

Cody Sanders  
9495 Patricksburg rd  
Spencer, IN 47460

Telephone 812-585-1353

The gun is a Remington model 660 .243 caliber with a serial number of 6201132. It has a recall on it so I would like that to be fixed. It may be for the problem I found which is listed below.

Problem I have found.


1. If you safety the weapon after it is ready to fire and don't touch the trigger all is fine (you can move safety back and forth without firing). However if you ever so slightly touch the trigger or bump it while the safety is engaged and then take the safety off afterwards it will fire as the safety is released. Very dangerous gun and fortunately know one was hurt while this happened. I always practice safe handling of a firearm and this reassured me of why you must do this. The coyote does however thank you for the miss that happened when I found out the problem. He sends his deepest thank you. This is the first time this had happened to me since I have owned the firearm for approximately 20 years. Although it may have been there all along.

Thanks and if you have any questions please feel free to call.

Cody Sanders

6201132

Model: 660

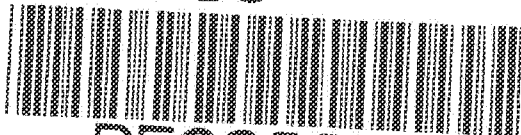

RE00225958

RECEIVED  
MAR 23 2011

BY: .....

T.A. set screws A/tered. Trig. will  
not return properly. Replace TPA,  
clean + test fire under recall  
at N/C

# 230145

20"  
PS 6/6  
Z#  
1004