

Remington Arms Co., Inc.
Product Service
Legal Case #:5003

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
211865/215592/216414	11/30/2010	11/8/2010	12/2/2010	11/7/2010			

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter		Randy	Vondal	608 Mountain Ae	Walhalla	ND	58282		H 701-549-3609
Incident		Tyler	Vondale						

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD				
S	Fired when safety released	Cause:4038 Could Not Duplicate Concern Concern:1007 Fired on Safe Release		Unknown
C				

11/8/10 Per call from Randy, his daughter had her Model 7 out yesterday and when she went to take the safety off it fired without her touching the trigger. Mr. Vondale bought another Model 7 for his other daughter and has 3 700's that have the Walker trigger. He wants to send them all for inspection. He may not send all at one time.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	7/260 REM	24781	7758598		1/10/2000
Date Purchased	Where Purchased	Accessories	Original Owner			
	BILL HICKS & CO LTD		Y			

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	7/	20000	7758503		
Date Purchased	Where Purchased	Accessories	Original Owner			
			Y			

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/243 WIN	20000	6308060	AT	3/1/1970
Date Purchased	Where Purchased	Accessories	Original Owner			
	GAMBLE SKOGMO MINN MINN TWO PIECE SCOPE BASE		U			

CONCERN:FSR

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	7/260 REM	24781	7758083	BU	1/10/2000
Date Purchased	Where Purchased	Accessories	Original Owner			
	BILL HICKS & CO LTD		U			

CONCERN:FSR

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/7MM REM MA	25933	S6319870	CR	4/18/1997
Date Purchased	Where Purchased	Accessories	Original Owner			
	CRAIG * WALTER INC.	STK AMMO BOOT	U			

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/7/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, install new TPA no charge as goodwill	Repair/Replacement Cost 130.58	Repair/Replacement Date 12/2/2010				

11/8/10 Mailing 5 ARS labels.cm 12/2/10 Per Ilion, could not duplicate concern. Excessive oil in trigger assm. Install new trig assm no charge as gesture of goodwill. Spoke with Randy's son-in-law about the inspection and repair and to let him know it has shipped.cm 1/5/11 Vondal approved repair charges for repair 215592 on 1/4/11.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		supry
	Exam Date		11/30/2010
	Product Type		RF
	Action Type		A
	Assigned To		Supry
Cause	4038	Could Not Duplicate Concern	Could not duplicate concern, the trigger pull seemed a little heavy and the initial movement of the safe arm was hard.
Barrel	Description		20 inch Model 7 260 caliber
	Date Code		
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	

Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	True	
Magazine	Condition	---Select---	
	Box Condition	Slightly Worn; Functioning	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		Model 7
	Function	Slightly Worn; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	not measured
	Notch	Slightly Worn; Functioning	
		Condition	Slightly Worn; Functioning
			Excess oil noted under receiver and on trigger housing.
Pull	Trigger	---Select---	5.75 lbs
Altered		False	
Sub-Assembly		M/700 Non-Bolt Lock	

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
------	----------	------	---------

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B. TRAVIS
	Exam Date		12/28/2010
	Product Type		RF
	Action Type		A
	Assigned To		T. NAGLE
Cause	4038	Could Not Duplicate Concern	I HAVE THE PHOTOS IN A SEPERATE FOLDER
Barrel	Description		22" 243 WIN
	Date Code		AT
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
	Condition	Slightly Worn; Functioning	
	Bulged	False	
	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
	Lift	---Select---	.006
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
	Feeding Test	False	
	Condition	Slightly Worn; Functioning	DIRTY, STICKY
	Pull	---Select---	4.5#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	
	Description		TWO PIECE SCOPE BASE

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		1/3/2011

Examination	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4054	As received Follows Down	HAVE PHOTOS FOR R#216414 IN SEPARATE FOLDER
Barrel	Description		20" 260 REM
	Date Code		BU
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/7 SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Tests	Test Fired	False	
	Feeding Test	False	
Trigger	Condition	Like new; Not Functioning	TRIG AND PIN RUSTY
	Pull	---Select---	6#
	Altered	False	

	Sub-Assembly	Other Remington
--	--------------	-----------------

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/4/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	PHOTOS IN SEPARATE FOLDER
Barrel	Description		24" 7MM REM MAG SS
	Date Code		CR
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.013
	Notch	Like new; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	
	Pull	---Select---	3.5#
	Altered	True	PULL SCREW ALTERED
	Sub-Assembly	M/700 Non-Bolt Lock	

Non-Remington Components	Description	STK AMMO BOOT
-----------------------------	-------------	---------------

5003

22"
AT3/20
4.5#
1006

[Handwritten signature]

November 8, 2010

Randy Vondal
608 Mountain Ave
Walhalla, ND 58282

Subject: #5003, Model 7's and 700's

Dear Mr. Vondal,

Per our conversation, enclosed are the prepaid UPS ground shipping labels for shipment of the firearms to our factory for inspection. Please include a copy of this letter with each firearm. The letter inside is important as sometimes the outside label gets damaged in transit and we want to be sure the firearm is logged in correctly. Please mark the ends of the box with "Product Service".

I apologize for the inconvenience that this incident has caused and I hope that these actions will keep you as a loyal Remington customer.

Sincerely,

Christy Mitchell
Consumer Affairs Administrator
Phone: 800-243-9700, ext 8684
christy.mitchell@remington.com


enclosure

could not duplicate concern
T.A. VERY DIRTY + STICKY.
Replace TPA, CLEAN + TEST FIRE
under BLP for \$20.00 + ship

Referral Number


6308060

Model: 700

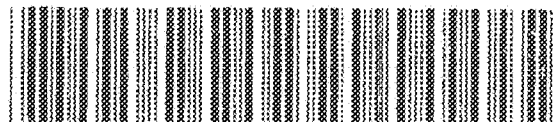

RE00215592

Quote



Remington Arms Company, Inc. • 870 Remington Drive • P.O. Box 700 • Madison, NC 27025
Phone 800-243-9700 • www.remington.com

BY:.....

PS 20336

NOTE: Please complete and print this form, and then include it with your firearm.

90
Randy
Vondal

Model Number:	243 model 700	Serial Number:	6308060
Are you the original owner? ☒ YES ☐ NO			
Name: MRS. ELLEN K. VONDAL		Date of Purchase: 1972	
Address (no PO Boxes): 608 Mountain Ave			
City:	Waltham	State:	North Dakota Zip: 58282
Phone (Daytime):	701-549-3607	Fax:	
E-mail Address: (if e-mail address is provided, notification of receipt and shipment will be sent)			
E-mail Address:			
☐ I would like to receive future e-mail updates from Remington.			
Please describe your problem and date of occurrence:			
Gun will fire when taking Safety off to shoot or Unload ALSO Please check the firing end of the bolt looks like wearing or cut wrong. Thanks			
Ammunition Information:			
Manufacturer: Remington		Type: 95grain AccuTip	
Other (i.e. bullet weight/type, shot size, powder): NONE			
Handload Information:			
Powder Used:		Powder Weight:	
Case/Hull Used: None		Primer Used:	
Bullet Type/Shot Size:		Reloader Used:	

Firearms Care (Cleaning and Lubrication):	USE ONCE A YEAR FOR DEAR SEASON THEN CLEANED 2 OT FOR STAGE TILL NEXT SEASON
Brand of cleaning solution used:	Remington
How often do you clean the bore? (Months or Number of rounds)	1 time a year After use
How often do you clean the action? (Months or Number of rounds)	Same
How often do you clean the trigger assembly? (Months or Number of rounds)	Same
Brand of lubricant used:	Remington oil with Teflon
How often do you lubricate the bore? (Months or Number of rounds)	Same
How often do you lubricate the action? (Months or Number of rounds)	Same
How often do you lubricate the trigger assembly? (Months or Number of rounds)	Same
Have you reviewed the cleaning and maintenance recommendations on our web site or in our owners manual?	☒ YES ☐ NO
When was the last time that your firearm was serviced by a Remington authorized repairman/gunsmith?	NEVER
What were the services performed?	
Remington Arms Co., Inc. Attn: Arms Service Division 14 Hoefler Avenue Illion, NY 13357	
⚠WARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND SERIAL NUMBER OF YOUR FIREARM. • Record the serial number of your firearm before sending it. • Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.) • Remove all accessories from your firearm to prevent loss or damage. • Provide a return address on both the outside and inside the box. Shipments without a proper return address will be refused.	

27.
20.40
15.
25.
97.40



RECEIVED
DEC - 1 2010


BY: _____

TP - 5.75105

Serial
Number:

7758598

Model: 7

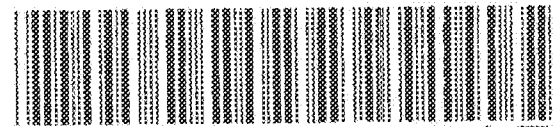

RE00211865

November 8, 2010

Randy Vondale
608 Mountain Ave
Walhalla, ND 58282

Subject: #5003, Model 7's and 700's

Dear Mr. Vondale,

Per our conversation, enclosed are the prepaid UPS ground shipping labels for shipment of the firearms to our factory for inspection. Please include a copy of this letter with each firearm. **The letter inside is important as sometimes the outside label gets damaged in transit and we want to be sure the firearm is logged in correctly.** Please mark the ends of the box with "Product Service".

I apologize for the inconvenience that this incident has caused and I hope that these actions will keep you as a loyal Remington customer.

Sincerely,

Christy Mitchell
Consumer Affairs Administrator
Phone: 800-243-9700, ext 8684
christy.mitchell@remington.com

27.
15.
28.18

70.18

enclosure

Could not duplicate concern.

Excessive oil in Trigger assembly
Install new TA n/c as gesture
of good will.

TREO 11/30/10

5003

24"
C 124A
3.54
1012

November 8, 2010

Randy Vondale
608 Mountain Ave
Wallhalla, ND 58282

Subject: #5003, Model 7's and 700's

Dear Mr. Vondale,

Per our conversation, enclosed are the prepaid UPS ground shipping labels for shipment of the firearms to our factory for inspection. Please include a copy of this letter with each firearm. **The letter inside is important as sometimes the outside label gets damaged in transit and we want to be sure the firearm is logged in correctly.** Please mark the ends of the box with "Product Service".

I apologize for the inconvenience that this incident has caused and I hope that these actions will keep you as a loyal Remington customer.


Sincerely,

Christy Mitchell
Consumer Affairs Administrator
Phone: 800-243-9700, ext 8684
christy.mitchell@remington.com

enclosure

S6319870

Model: 700

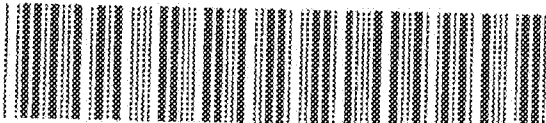

RE00215685

27
15
25.75
67.75
40.
EGE 27.75
JAN 25 2011

1/14/11 unhappy w/ chg.
take off trig. chg.
full chg. ship + test. He approved. CM
could not duplicate concern
T.A. 3rd screw altered. CAN
offer to replace TPA, clean
& test fire at 1/2 normal
cost.

Quote

NOTE: Please complete and print this form, and then include it with your firearm.

Model Number: 7mm Model 700	Serial Number: 56319870 Stalw 455
Are you the original owner? ☒ YES ☐ NO	
Name: TIERNEY J. Vondal	Date of Purchase: Not sure possible 2004
Address (no PO Boxes): 608 Mountain Ave	
City: WAKHALLA	State: North Dakota Zip: 58282
Phone (Daytime): 701-549-3609	Fax:
E-mail Address: (if e-mail address is provided, notification of receipt and shipment will be sent)	
E-mail Address:	
☐ I would like to receive future e-mail updates from Remington.	
Please describe your problem and date of occurrence:	
Firing when going from safety to off to UN LOAD	
500 characters left	
Ammunition Information:	
Manufacturer: Remington	Type: Express coat lock 150grain
Other (i.e. bullet weight/type, shot size, powder): only use Remington products	
Handload Information:	
Powder Used:	Powder Weight:
Case/Hull Used:	Primer Used:
Bullet Type/Shot Size:	Reloader Used:

Firearms Care (Cleaning and Lubrication):

Brand of cleaning solution used:

Remington oils / Hoppes cleaning kit

How often do you clean the bore? (Months or Number of rounds)

Only use for deer season 1 a year After use

How often do you clean the action? (Months or Number of rounds)

Same

How often do you clean the trigger assembly? (Months or Number of rounds)

Same

Brand of lubricant used:

Remington with teflon

How often do you lubricate the bore? (Months or Number of rounds)

Same

How often do you lubricate the action? (Months or Number of rounds)

Same

How often do you lubricate the trigger assembly? (Months or Number of rounds)

Same

Have you reviewed the cleaning and maintenance recommendations on our web site or in our owners manual?

☒ YES ☐ NO

When was the last time that your firearm was serviced by a Remington authorized repairman/gunsmith?

Never

What were the services performed?

Remington Arms Co., Inc.
Attn: Arms Service Division
14 Hoefer Avenue
Ilion, NY 13357

ⓈWARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND SERIAL NUMBER OF YOUR FIREARM.

- Ⓢ Record the serial number of your firearm before sending it.
- Ⓢ Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.)
- Ⓢ Remove all accessories from your firearm to prevent loss or damage.
- Ⓢ Provide a return address on both the outside and inside the box. Shipments without a proper return address will be refused.

NOTE: Please complete and print this form, and then include it with your firearm.

Model Number: 7 youth 260	Serial Number: 7-775898
Are you the original owner? ☒ YES ☐ NO	
Name: Miss TALLIE VONDALE	Date of Purchase: 2nd year of production
Address (no PO Boxes): 608 Mountain Ave	
City: WALKALLA	State: NORTH DAKOTA Zip: 58282
Phone (Daytime): 701 549-3609	Fax:
E-mail Address: (if e-mail address is provided, notification of receipt and shipment will be sent)	
E-mail Address:	
☐ I would like to receive future e-mail updates from Remington.	
Please describe your problem and date of occurrence:	
The DAY BEFORE I CALLED IN I THINK NOV. 7th my DAUGHTER WAS HUNTING she WAS going to take HER GUN off SAFETY and LINE up for a shot and when she pushed the SAFETY off the GUN FIRED HER HAND WASNT ON THE TRIGGER.	
500 characters left we didn't know the GUN LET AS IS & sent it in	
Ammunition Information:	
Manufacturer: Remington	Type: 120 gr Acutip Factory load
Other (i.e. bullet weight/type, shot size, powder):	
Handload Information:	
Powder Used:	Powder Weight:
Case/Hull Used:	Primer Used:
Bullet Type/Shot Size:	Reloader Used:

Firearms Care (Cleaning and Lubrication):

Brand of cleaning solution used: Hoppies cleaning kit Remington oil

How often do you clean the bore? (Months or Number of rounds) USE FOR DEER SEASON ONLY
cleaned 3 times After each season

How often do you clean the action? (Months or Number of rounds) SAME

How often do you clean the trigger assembly? (Months or Number of rounds) NEVER TAKE IT APART

Brand of lubricant used: Remington

How often do you lubricate the bore? (Months or Number of rounds) AFTER CLEANING FOR STORAGE

How often do you lubricate the action? (Months or Number of rounds) SAME

How often do you lubricate the trigger assembly? (Months or Number of rounds)

Have you reviewed the cleaning and maintenance recommendations on our web site or in our owners manual?

☒ YES ☐ NO

When was the last time that your firearm was serviced by a Remington authorized

repairman/gunsmith? NEVER at don't shoot it enough to
get a lot of service required

What were the services performed?

Remington Arms Co., Inc.
Attn: Arms Service Division
14 Hoefler Avenue
Illion, NY 13357

ⓈWARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND SERIAL NUMBER OF YOUR FIREARM.

- Ⓢ Record the serial number of your firearm before sending it.
- Ⓢ Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.)
- Ⓢ Remove all accessories from your firearm to prevent loss or damage.
- Ⓢ Provide a return address on both the outside and inside the box. Shipments without a proper return address will be refused.

260 model 7-7758598

THIS 260 CAL SHOULD BE
ON FILE & REGISTERED TO
MISS TAILYR VONDALE
608 MOUNTAIN AVE
WATHALLA, NORTH DAKOTA
58282
C/O RANDY D. VONDALE
701-549-3609

ALSO ONCE THIS GUN WAS SIGHTED
IN, WE ONLY CHECK IT FOR ACCURACY
EACH DEER SEASON & THEN CLEAN
UP & PUT AWAY FOR NEXT
SEASON

I ALWAYS MADE THE
GIRLS SHOOT A 22 SINGLE SHOT
50 ROUNDS AT SPIN TARGETS
EACH YEAR PRIOR GOING OUT
WITH DEER RIFLE.

ALL SIX OF MY DAUGHTERS
DID THIS - IMPROVED SHOOTING
& CALMNESS 100%

Randy



www.remington.com

Remington Arms Company, Inc.
870 Remington Drive
P. O. Box 700
Madison, NC 27025-0700

ARS LABEL REQUEST FORM

DATE:	11/8/2010	REQUESTED BY:	christy
QUANTITY:	5	WEIGHT PER PACKAGE:	10
PLEASE CHECK ONE: MEDIA COORDINATOR TO MAIL		XXXXXX I WILL MAIL	
DESCRIPTION: 2x7 3x700			

LABEL INFORMATION

MAIL LABEL TO: Randy Vondale
608 Mountain Ave
Walhalla, ND 58282

4XX556 NOV 8, 2010 ALL CURR USD 2 OF 5
SVC ONDCON ACT WT 10.0 LBS
TRACKING# 124X55698670001040
REF 1 RANDY VONDALE/CO/CH
REF 2 MODEL 7

HANDLING CHARGE 0.00
SINGLE-PIECE PUB RATE CHRG: SVC T/P USD
DV 0.00 COD 0.00 RS 0.50
DC 0.00 DCD 0.00 SD 0.00
AH 0.00 PR 0.00 SP 0.00
TOT PUB CHG 0.45 PUB-HANDLING 0.45

RETURN ITEM TO: Rem Product Service

4XX556 NOV 8, 2010 ALL CURR USD 1 OF 5
SVC ONDCON ACT WT 10.0 LBS
TRACKING# 124X55698670001040
REF 1 RANDY VONDALE/CO/CH
REF 2 MODEL 7

HANDLING CHARGE 0.00
SINGLE-PIECE PUB RATE CHRG: SVC T/P USD
DV 0.00 COD 0.00 RS 0.50
DC 0.00 DCD 0.00 SD 0.00
AH 0.00 PR 0.00 SP 0.00
TOT PUB CHG 0.45 PUB-HANDLING 0.45

4XX556 NOV 8, 2010 ALL CURR USD 2 OF 5
SVC ONDCON ACT WT 10.0 LBS
TRACKING# 124X55698670001040
REF 1 RANDY VONDALE/CO/CH
REF 2 MODEL 700

HANDLING CHARGE 0.00
SINGLE-PIECE PUB RATE CHRG: SVC T/P USD
DV 0.00 COD 0.00 RS 0.50
DC 0.00 DCD 0.00 SD 0.00
AH 0.00 PR 0.00 SP 0.00
TOT PUB CHG 0.45 PUB-HANDLING 0.45

4XX556 NOV 8, 2010 ALL CURR USD 4 OF 5
SVC ONDCON ACT WT 10.0 LBS
TRACKING# 124X55698670001040
REF 1 RANDY VONDALE/CO/CH
REF 2 MODEL 700

HANDLING CHARGE 0.00
SINGLE-PIECE PUB RATE CHRG: SVC T/P USD
DV 0.00 COD 0.00 RS 0.50
DC 0.00 DCD 0.00 SD 0.00
AH 0.00 PR 0.00 SP 0.00
TOT PUB CHG 0.45 PUB-HANDLING 0.45

4XX556 NOV 8, 2010 ALL CURR USD 5 OF 5
SVC ONDCON ACT WT 10.0 LBS
TRACKING# 124X55698670001040
REF 1 RANDY VONDALE/CO/CH
REF 2 MODEL 700

HANDLING CHARGE 0.00
SINGLE-PIECE PUB RATE CHRG: SVC T/P USD
DV 0.00 COD 0.00 RS 0.50
DC 0.00 DCD 0.00 SD 0.00
AH 0.00 PR 0.00 SP 0.00
TOT PUB CHG 0.45 PUB-HANDLING 0.45

PS 20347