

Remington Arms Co., Inc.
Product Service
Legal Case #:3635

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
171847	7/23/2009	7/24/2009	7/24/2009				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Briley		Briley	1230 Lumpkin	Houston	TX	77043		W 713-932-6995

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4038 Could Not Duplicate Concern			Unknown
S	Fired on bolt closing Concern:1008 Fired on Bolt Closing			
C				
Dealer reported that gun fired when bolt closed. dmf				

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial Bbl	DOM
Remington	CF/BA	700/3006 SPR	*	375888 BR	1/1/1968
Date Purchased	Where Purchased	Accessories	Original Owner		
	FIREARMS UNLIMITED PITTS PA	SCOPE,RINGS,BASE,HARD CASE	U		

CONCERN:FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Repair under BLSM program for special price						
	Repair/Replacement Cost	Repair/Replacement Date				
	\$60.38	8/4/2009				

8/4/09: Per Fred S. - Could not duplicate concern. Trigger assembly dirty & sticky. Replace trigger assembly under BLSM program for special price. dmf

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		7/24/2009
	Product Type		RF
	Action Type		A

	Assigned To		F.SUPRY
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		22" 3006 SPR
	Date Code		BR
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Not Functioning	STICKING,SLUGGISH
Extractor	Condition	Slightly Worn; Functioning	
	Out Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.008
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	DIRTY,STICKY
	Pull	---Select---	4.5#
	Altered	False	

	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		SCOPE,RINGS,BASE,HARD CASE

Repair Inquiry

Repair Number: **RE80171847** Serial: 125088 Model: 700 Center Fire Caliber: 30 Repairman: Bruce Travis
 Verify Repair: 06 Produced: 05/06/1969 Status: Repairing 7/27/2009 4:44:36 PM

Address Information

Customer: Received From: Return To: Received From:
 Name: **BAILEY**
 Address 1: **1236 LUMPKIN** Address 2:
 City: **HOUSTON** State: **TX** Zip Code: **77043** Country: **US**
 PO Box: PO Box:
 FFL:

Contact / Condition		Problems		Estimate		History / Status		Shipping / Billing	
Date	Code	User ID	Desc1	Desc2				Current Status	
7/23/2009 2:31:4	New	schultsm	Repair Added			☐ Shipping Hold		Repairing	
7/23/2009 2:34:4	Expedite	schultsm	From: Check In	To:		☐ Interface Hold		7/27/2009 4:44:36 PM	
7/24/2009 9:43:5	Expedite	Travisbw	From: Product Services	To: Repair Bench		☒ Estimate Sent		System	
7/24/2009 11:42:	Estimate	Travisbw	Estimate Update	Status: ApprovaHol		☒ Parts Received		Repair Bench	
7/24/2009 11:44:	ApprovalH	System	Immediate SAP Allocation			☐ Passed Inspection		Repair Location	
7/24/2009 12:44:	Expedite	peroced	From: Repair Bench	To: ApproveRack		☐ ReturnAs Received		Current Location	
7/24/2009 3:32:	ApprovalH	BatchJob	Quotation Control			☒ Has been Approved		ILN	
7/27/2009 4:42:4	Approved	allfive	Phone call			☐ Internal Repair		Transfer Number	

Repair Search

Refresh

Close

supvll 7/28/2009 9:57 AM CAPS NUM IN: SERL

start

Inbox - Microsoft Out...

Arms Services Repair ...

9:57 AM

PURCHASE ORDER

Page: 1

OUR PURCHASE ORDER NUMBER MUST BE ON YOUR PACKING LIST AND INVOICE TO INSURE PAYMENT

is Briley Manufacturing Company
30 Lumpkin
Houston, Texas 77043
13) 932-6995

3635

MVG

P.O. NUMBER : 0002507

ORDER DATE : 07/15/09

22"
BR 1/8
4.5"
0.08

VENDOR NUMBER : REM357

ENDOR :
EMINGTON COUNTRY STORE
HOEFLER AVE.
ION, NY 13357

SHIP TO :
Jess Briley Manufacturing Comp
1230 Lumpkin
HOUSTON, TX 77043

ONFIRM TO :

REQUIRED DATE	SHIP VIA	F.O.B.	TERMS			
15/09	GROUND		Net 30 Days			
M NUMBER	UNIT	ORDERED	RECEIVED	BCK ORDER	UNIT COST	AMOUNT
OTE	EACH	1.00	0.00	0.00	0.000	0.00


ATT: BL SAFETY PROGRAM

REMINGTON SERIAL # 375888, JOB # G6554

GUN FIRED WHEN THE BOLT CLOSED

375888

Model: 700

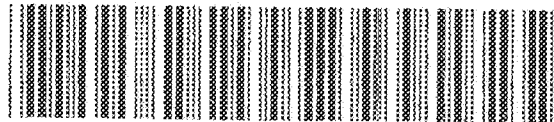

RE00171847

could not duplicate concern.
TRIG. ASSM. DIRTY + STICKY.
Replce TPA under Bolt Lock
Program for B 20.00, 5.11

Quote

Net Order: 0.00
Sales Tax: 0.00
Freight: 0.00
Order Total: 0.00