Remington Arms Co., Inc. Product Service Legal Case #:5958

Case Information

Date Closed RE# **Date Opened** Date Opened(PS) **Incident Date** Pre Lit Lit Obsolete 4/25/2011 3/3/2011 225834 3/15/2011

Customer Information

Business First Name Last Name Street City State Zip Age Contact Type 4632 Yadkin Rd. NC W 910-864-2270 Fayetteville 28303 Reporter Jim's Gun Jobbery Attn: Andy P. Jim's Gun Jobbe

Incident Information

Repair Est. **Medical Treatment** Medical Status Claims Codes

PΙ

PD Cause:4038 Could Not Duplicate Concern S

Unknown Concern: 1007 Fired on Safe Release

C FSR

3/3/11: Dealer called. He stated the customer brought gun in & stated he experienced a FSR with it. Dealer did not have date of incident. Dealer stated he has tried repeatedly & cannot duplicate concern. He stated he felt the consumer may have been watching too much tv. df

Firearm Information

Mfg. Model/Ga. SKU Serial Bbl. DOM Type CF/BA 700/243 WIN 27475 G6896382 DD 9/4/2009 8:56:51 PM Remington

Date Purchased Where Purchased Accessories **Original Owner**

ELLETT BROTHERS, LLC U

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Reim. Date Cash Date Cash Release of Claims Release Date Settlement Reimbursement Settlement APV

Per Ilion - Replace TA to restore confidence - warranty

> Repair/Replacement Repair/Replacement Cost Date 4/28/2011 \$62.40

3/3/11: Sending ARS, letter, form. df 4/28/11: Per Ilion - Could not duplicate concern. Will replace TA, clean & test fire to restore confidence in rifle - warranty. df


Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		4/25/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		20" 243 WIN
	Date Code		DD
	Bore Plugged	False	
	Bulged		
	Fired	False	
	Fired while Obstructed		

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=5958&Type=Case

4/28/2011

L	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	
	Description		XMP SAFETY
Safety	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	Select	.012
	Notch	Like new; Functioning	
	Tota	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Like new; Functioning	
	Pull	Select	3.5#
	Altered	False	
	Sub-Assembly	X-Mark Pro	

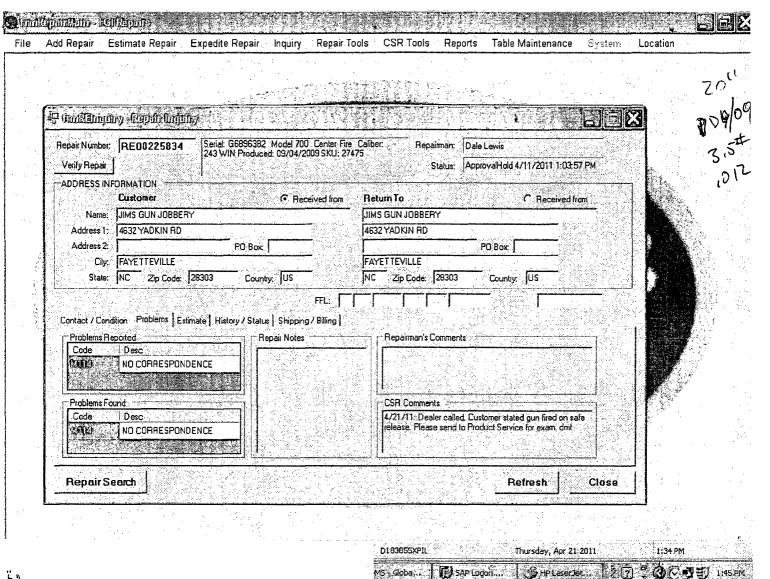

£G6896382

could not dup licrate concern, will replace TPA, ele AN + TOGT Cire To restore confidence in rife

LAMPANLY

WEGETTOTION

77711 APR 2 7 2011

BY:____



Remington Arms Company, Inc. 870 Remington Drive P. O. Box 700 Madison, NC 27025-0700

ARS LABEL REQUEST FORM

DATE:		-	3/3/2011	REQUESTED BY:	Dell	
QUANTITY:		1		WEIGHT PER PKG:		10 lbs
PLEASE CHECK ONE MEDIA COORDINATOR TO MAIL				I WILL MAIL	xxxxxx	
DESCRIPTION:	Ref# 5958 rifle					

LABEL INFORMATION

MAIL LABEL TO: Jim's Gun Jobbery
Attn: Andy P.
4632 Yadkin Rd.
Fayetteville, NC 28303
Ph: 910-864-2270

RETURN ITEM TC Remington Arms
Attn: Product Service
Ilion, NY

PLEASE COMPLETE ALL PARTS OF THIS FORM AND SEND TO THE MEDIA COORDINATOR

MAR 3, 2011 ALL CURR USD ACT UT 10.0 LBS 1 OF 1 4XX596 SVC GNDCOM TRACKING# 124XX5969066894432 REF 1:JIMS GUN JOBBERY/ANDY P/CD/DMF REF 2:5958/RIFLE HANDLING CHARGE 0.00 SVC T/P USD SINGLE-PIECE PUB RATE CHRGS: RS 0.50 COD 0.00 DV 0.00 DC 0.00 SD 0.00 0.00 DGD SP 0.00 0.00 PR AH 0.00 PUB+HANDLING TOT PUB CHG 8.84



