

Remington Arms Co., Inc.
Product Service
Legal Case #:7102

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
250904	12/16/2011	12/19/2011	12/19/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Wesley	Prue	38540 W 319th St	Paola	KS	66071		H 913-687-8635 E w8c1p6@aol.com

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015 Improper Maintenance		Unknown	
S	Fired on bolt closing Concern:1008 Fired on Bolt Closing			
C				

1/16/12 Per note with rifle, it has misfired multiple times. Twice when chambering a round and also once while his father took the safety off.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPRG	n/a	A6666216	DQ	9/22/1978
Date Purchased	Where Purchased	Accessories	Original Owner			
	RS ELLIOT ARMS KANSAS CTY MO		U			

CONCERN: FBC,FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Replace TPA, clean and test fire at BLSM program price						

Repair/Replacement Cost	Repair/Replacement Date
30.40	1/16/2012

1/16/12 Per Ilion, scar frozen to side plates from a dried lube residue. Replace TPA, clean and test fire at BLSM program price.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		12/19/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4015	Improper Maintenance	
Barrel	Description		22" 3006 SPRG
	Date Code		DQ
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown		

	Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Not Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	N/A
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	DRIED LUBE RESIDUE PARTS BINDING SEAR FROZEN TO SIDE PLATES
	Pull	---Select---	N/A
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	

7102

-22"
page

Model Number: model 700		Serial Number: a6666216	
Name: Wesley Prue		Date of Purchase: mid 1970's	
Address (no PO Boxes): 38540 W 319TH ST			
City: PAOLA		State: KS	Zip: 66071
Phone (Daytime): 913-687-8635		Fax:	
E-mail Address: W8C1P6@AOL.COM			
Please describe your problem: The rifle has miss fired multable times. Twice when chambering a round, and also once while my father took the safety off takeing the safety off.			

Send frozen to side plates
from a dried lube residue.
replace TPB, clean test fire
under BLP for \$20. + ship

Quote

characters left


n, contact the Repair Center for services
estimated repair time.

LIVE OR SPENT SHELLS IN YOUR
BOX WITH THE FIREARM. THIS IS A
YOU FEEL YOU MUST SEND SPENT
A SEPARATE PACKAGE AND INCLUDE
(DE), TELEPHONE AND MODEL AND

Serial Number:

A6666216

Model: 700

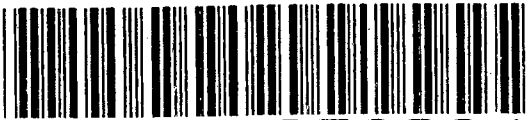

RE00250904

WESLEY C PRUE
38540 W 319TH ST
PAOLA KS 66071

ECL

DEC 20 2011

BY:

REMINGTON 700 A6666216 30-06 SPR6

PLEASE DO THE SAFETY MODIFICATION
ON THIS GUN AS PER REMINGTON INCLOSURE
IS THE \$20.00 CHECK. ALSO CRIS
SAID THE TRIGGER MAY NEED CLEANING
IF SO DO THAT PLEASE. My NUMBER IS
1-913-557-6910

THANKS WES PRUE



