

Remington Arms Co., Inc.
Product Service
Legal Case #:6705

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
243880	10/19/2011	10/20/2011	10/20/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Scheels Gunsmithing		Scheels Gunsmit	2101 W 41st St	Sioux Fallsn	SD	57105		W 605-334-7767

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4006 Altered Adjustments or Components		Unknown	
S	Fired on safety release Concern:1007 Fired on Safe Release			
C				

11/1/11 Per letter with rifle, the owner state that the gun goes off when safety is released. Upon a quick inspection at Scheels, it looks like the trigger has been tampered with. The owner wanted them to forward the gun to Remington for inspect and repair.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/7MM REM MA	26263	T6242455	LS	2/26/1998
Date Purchased	Where Purchased	Accessories	Original Owner			
	JERRYS SPORT CENTER INC		U			

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean, test fire at 1/2 normal cost						
Repair/Replacement Cost	Repair/Replacement Date					

11/1/11 Per Ilion, trigger assm dirty, rusty and set screws altered. Trigger binds, will not return. Replace TPA, clean, test fire at 1/2 normal cost.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		10/20/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4006	Altered Adjustments or Components	IMPROPER MAINTENENCE
Barrel	Description		24" 7MM REM MAG SS
	Date Code		LS
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Magazine	Condition	---Select---	
	Box Condition	Slightly Worn; Functioning	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.013
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY,RUSTY,TRIG NOT RETURNING WILL FOLLOW DOWN
	Pull	---Select---	8#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Non-Bolt Lock	



2101 W 41st St Sioux Falls, SD 57105
Phone (605) 334-7767 Fax (605) 334-8936

October 12, 2011

Remington Arms Co
14 Hoefler Ave
Ilion, NY 13357

Manufacturer: Remington
Model: 700
Serial Number: T6242455
Caliber/Gauge: 7mm
SO#: 37267

Enclosed is a Remington 700. The owner states that the gun goes off when safety is released. Upon a quick inspection, it looks like the trigger has been tampered with. The owner wanted us to forward the gun to you for inspection and repair. Please notify us of any charges to the owner before completing the repair.

Sincerely,

Eileen Fritz

Eileen Fritz
Gunsmith Office Manager

RECEIVED
OCT 26 2011

BY:

T.A. Dirty, rusty & set screws
Altered. Trig. Binds, will not
return up to TPA, clean &
test fire at 1/2 normal cost.


Quote

T6242455

Model: 700



RE00243880

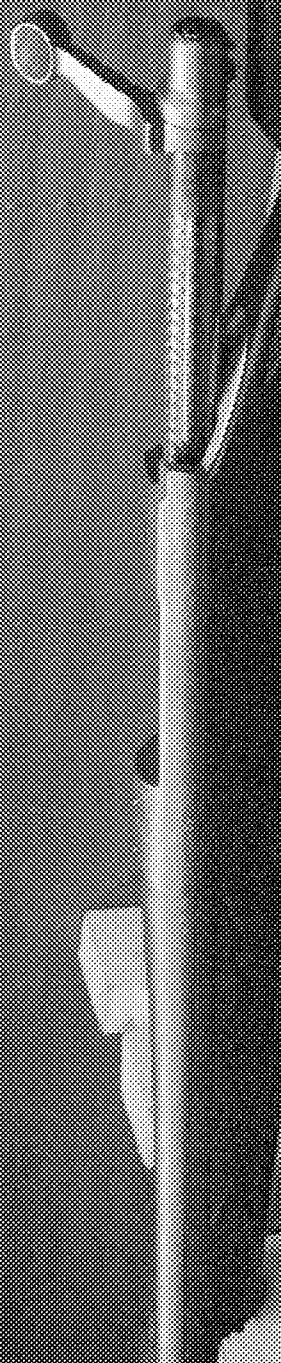

UT6242455
Mfg. 700
R500243880

