

Remington Arms Co., Inc.
Product Service
Legal Case #:8369

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
292924	12/14/2012	12/17/2012	12/17/2012				X

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Tim	Barwick	127 Little Mountain Rd	Sunbury	PA	17801		

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD				
S	Gun goes off when taking off safety	Cause:4006 Altered Adjustments or Components Concern:1007 Fired on Safe Release	Unknown	
C				

12/28/12 Per note on SR, gun goes off when taking off safety.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	600/243 WIN	n/a	6744086	WY	8/1/1974
Date Purchased	Where Purchased	Accessories	Original Owner			
	JERRYS SPORT OLYPHANT PA		U			

CONCERN: FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/600/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean and test under recall at no charge						

Repair/Replacement Cost	Repair/Replacement Date
43.81	12/28/2012

12/28/12 Per Ilion, trigger assm set screws altered. Overtravel excessive. Replace TPA, clean and test under recall at no charge.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		12/17/2012
	Product Type		RF
	Action Type		A

	Assigned To		J.BALIO
Cause	4006	Altered Adjustments or Components	
Barrel	Description		18.5" 243 WIN
	Date Code		WY
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.002
	Notch	Slightly Worn; Functioning	
		Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	EXCESSIVE OVER TRAVEL WILL FOLLOW DOWN ON NULL TEST
	Pull	---Select---	4#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	Other Remington	

Service Request

Remington Service
PO Box 700

Madison, NC 27025-0700



ATTN: smp

Parts and Repairs: P:800-243-9700/F:336-548-7801

www.Remington.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. **ENCLOSE THIS DOCUMENT WITH YOUR RETURN.**

18.50
648/7
4#
1002

Service Request Number: SR00036950
Serial Number / Description: 6744086

8369

Date of Request: 11/30/2012

Date Printed: 11/30/2012

Customer:
TIM BARWICK
127 LITTLE MOUNTAIN RD
SUNBURY, PA 17801 US

Destination:
Arms Services
14 Hoefler Ave
Ilion, NY 13357 US

Email:

Email:

Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.

Reason For Return

M240 - BOLT LOCK SAFETY MODIFICATION


Service Request Section

smp
gun goes off when taking off safety

Serial Number:

6744086

Model: 600 MOHAWK

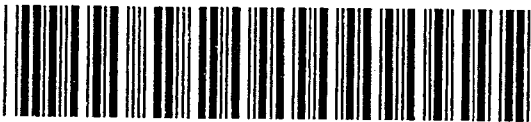

RE00292924

Qty Needed	Warranty	Price	Disc	Amount
------------	----------	-------	------	--------

T.A. set screws altered, over travel
Excessive. Rep. TPA, clean + test
and recall at N/C

#230145

RECEIVED
DEC 19 2012

BY:

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the item(s) being sent based on the conversation with our representative.

Sub Total: .00

Est Sales Tax: .00

Grand Total: \$.00