

Remington Arms Co., Inc.
Product Service
Legal Case #:7220

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
252009	12/30/2011	1/7/2012	1/9/2012				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Allison and Carey Gunworks		Allison and Car	17311 S.E. Stark	Portland	OR	97233		
Incident		Todd	Tibbitts	190 Hwy 28	Salmon	ID	83467		H 208-756-1050

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4006	Altered Adjustments or Components		
S	Fired without finger on the trigger	Concern:1025	Unexplained Discharge - No Mention of Safety Position	Unknown
C				

1/26/12 Per note with rifle; Tibbitts purchased this rifle used in 2006 and has used this gun since then with no issues. Last week (ltr dated Nov 30) he was sighting it in for his son to hunt with and on the 2nd round the gun fired without his finger on the trigger.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/223 REM	27514	E6778397	DV	9/11/2001 2:41:21 PM
Date Purchased	Where Purchased	Accessories	Original Owner			
	ACUSPORT (MT) CORPORATION	TWO PIECE BASE	U			

CONCERN:FIRED WITHOUT TOUCHING TRIG

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean and test fire at 1/2 normal cost						
	Repair/Replacement Cost	Repair/Replacement Date				

1/26/12 Per Ilion, trigger assm dirty and set screws altered. Trigger not returning properly. Replace TPA, clean and test fire at 1/2 normal cost.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/9/2012
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4006	Altered Adjustments or Components	
	Description		24" 223 REM
	Date Code		DV
	Bore Plugged	False	
	Bulged	False	

Barrel	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	ISS	
Sear	Lift	---Select---	.014
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY, TRIG NOT RETURNING PROPERLY, WILL FOLLOW DOWN
	Pull	---Select---	2.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Non-Bolt Lock	
Non-Remington Components	Description		TWO PIECE BASE

7220

11/30/11

Salmon, Id.

24"
DU 9/01
2.5"
10/14

Two Tibbatts

190 Wyz 28

PO Box 943

Salmon, Id. 83467

208-756-1050

To Remington

ALLISON E

Portland, Oregon 97209
(503) 226-5100

I purchased the gun (Model 700, Ser#E6778397)

used from a gun dealer in town in 2006. I have used
the gun since then and had no issues. Last
week I was sighting it in for my son to hunt
with and on the second round, the gun fired
without my finger on the trigger.

Thank you for your help
in this matter.

Michael W.

Return TO

Serial
Number

E6778397


Model: 700



RE00252009

T.A. dirty + ~~set~~ set screws altered
.. Trig. not returning properly. Replace TPA,
clean & test fire at 1/2 normal cost

Quote

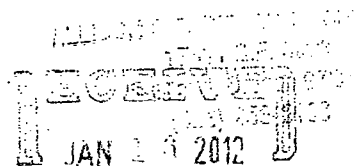

BY:.....





