

Remington Arms Co., Inc.
Product Service
Legal Case #:7306

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
255097	1/19/2012	1/20/2012	1/20/2012				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Bass Pro Shops		Bass Pro Shops	7970 Northfield Blvd	Denver	CO	80230		W 720-385-3674 E relongone@basspro.com

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4006	Altered Adjustments or Components		
S	Has had several accidental discharges	Concern:1025	Unexplained Discharge - No Mention of Safety Position	Unknown
C				
1/31/12 Per note with rifle, customer states he has had several accidental discharges.cm				

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/222 REM	n/a	10962	KJ	5/1/1962
Date Purchased	Where Purchased	Accessories	Original Owner			
		TWO PIECE BASE	U			

CONCERN: AD'S

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean, test fire at BLSM program price						
	Repair/Replacement Cost	Repair/Replacement Date				
	30.40	1/31/2012				

1/31/12 Per Ilion, trigger assm dirty and set screws altered. Replace TPA, clean, test fire at BLSM program price.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/20/2012
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4006	Altered Adjustments or Components	
Barrel	Description		20" 222 REM
	Date Code		KJ
	Bore Plugged	False	
	Bulged	False	
	Fired	False	

	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Facc	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	--Select--	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	--Select--	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	--Select--	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	--Select--	.006
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	DRTY, TRIG NOT RETURNING WILL FOLLOW DOWN
	Pull	--Select--	2#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE BASE

7970 Northfield Blvd
Denver, Colorado 80230

7306

20"
22210#
2#
1006
K551

Bass Pro Shops 034


January 12, 2012

14 Hoelfer Ave
Ilion, NY 13357

Dear Sir or Madam:

Enclosed is a Remington 700, SN: 10962. Customer states he has had several AD's. Please repair.

Sincerely,

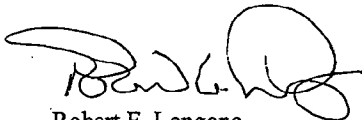


Robert E. Longone
Gunsmith
Shop: (720) 385-3674
Fax: (303) 373-0504

relongone@basspro.com

Serial Number:

10962

Model: 700



RE00255097

RECEIVED
JAN 24 2012

BY:

T.A. dirty + set screws altered.
Replace TPA, clean + test fire.
under ECP for 20.1

Quote

We All Live Downstream

