

Remington Arms Co., Inc.
Product Service
Legal Case #:8453

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
295573	1/9/2013	1/10/2013	1/10/2013				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Lucas	Evans	320 Cerny Ave.	Eureka	MO	63025		H 314-973-7396 E laeppf@mst.edu

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015	Improper Maintenance		
S FBC	Concern:1008	Fired on Bolt Closing	Unknown	
C				

SR# 39822 - Service Request Section: WHEN THE BOLT IS CLOSED THE FIRING PIN FALLS THIS HAPPENS WHEN THE SAFETY IS OFF. df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/308 WIN	25739	G7162311	AG	3/21/2012 1:25:14 PM
Date Purchased	Where Purchased	Accessories	Original Owner			
	SIMMONS GUN SPECIALTIES I		U			

CONCERN: FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion - Replace TA @ n/c - goodwill gesture						
	Repair/Replacement Cost	Repair/Replacement Date				
	\$50					

1/14/13: Per Ilion - TA has a dried & sticky lube residue causing sear to work sluggish. As a goodwill gesture - will replace TA, clean & test at n/c. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/10/2013
	Product Type		RF
	Action Type		A
	Assigned To		J.BALIO
Cause	4015	Improper Maintenance	
Barrel	Description		20" 308 WIN HB FL
	Date Code		AG
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		


	Muzzle/Crown Condition	Like new; Functioning	
Bolt	Firing Pin	Like new; Functioning	
	Shroud	Like new; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Like new; Functioning	
	Stop	Slightly Worn; Functioning	HAS HAMMER INDENTS ON BOTTOM EDGE
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Like new; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Like new; Functioning	
	Stock Condition	Like new; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Like new; Functioning	
	Bulged	False	
Safety	Description		STANDARD SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.014
	Notch	Like new; Functioning	
	Tests	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Like new; Not Functioning	DRIED LUBE RESIDUE SEAR WORKS SLUGGISH WILL FOLLOW DOWN
	Pull	---Select---	6#
	Altered	False	40X TPA
	Sub-Assembly	M/700 Non-Bolt Lock	

PS 32059

30 DAY LAY AWAY FORM

EVANS
LUCAS ARTHUR
223 CERNY AVE
EUPEKA, MO 63025


Birthdate 07-14-1990 Expiration Date 07-14-2017
Male 5'07 130 lbs Blue Eyes
Restrictions Endorsements

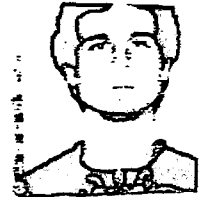

NAME	
ADDRESS	
CITY, STATE, ZIP	
PHONE #	
PHONE #	

LAY AWAY DATES	FROM: 4-9-2012 TO: 6-9-2012
ITEM	Remington 700 LTR 308 scr-H G7162311
ITEM PRICE W/TAX	\$ 1070.00

DOWNPAYMENT AMT	300.00	DATE
BALANCE DUE	770.00	DATE 6-9-2012
PAID ON ACCOUNT	500.00	DATE
BALANCE DUE	270.00	DATE 4-13-12 SP
PAID ON ACCOUNT		DATE
BALANCE DUE		DATE
PAID ON ACCOUNT		DATE
BALANCE DUE		DATE
PAID ON ACCOUNT		DATE
BALANCE DUE		DATE

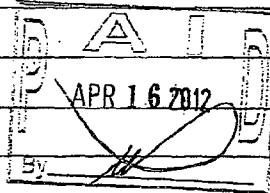

Layaways are for 30 days only. There are no refunds on layaways.

X [Signature]



