

File Number: 9696		Arms Service number: 10721228	
Last Name: COKER GA		First Name: RY W.	
Street: 635 PARK STREET		City: SEAFMONT	
State: TX	Zip: 77701	Home Ph: _____	
Work Ph: _____	Product Type: F	F A T O	
Type Concern: S	PI PD P S C	Concern Code: 1007	
Concern: FIRED ON SAFE RELEASE			
Cause Code: 401'S	Cause: IMPROPER MAINTENANCE		
Assigned To: KAS	Classification: UNJ	UNJ UNG UND J	
Settlement Detail: REPAIR SPOT PRICE	Settlement Amount: \$0.00		
Date Opened Rem: 12/5/97	Date Opened by RIS: 12/12/97	Caliber: 270	
Date of Incident: _____	Date Closed: 12/12/97	Bullet Weight: _____	
Date to Analyze: _____	Date from Analyst: _____	Manufacture: REM	
Model: 700	Serial: 6584328	Date Mfgt: 9/1/72	Obsolete: <input type="checkbox"/>
RABAC: 700	Litigation: <input type="checkbox"/>	PreLitigation: <input type="checkbox"/>	
Custody: _____	Comments: _____		
Time of Modification: 8:57:14 AM		Date of Modification: 12/12/97	

## RECEIVING AND ESTIMATING REPORT

COMMENTS

*Product Service*ORDER  
R 97-21228

INITIAL <b>JJM</b>	CUSTOMER ORDER NO.	DATE RECEIVED <b>12/04/97</b>		DATE OPENED <b>12/05/97</b>	DATE CODE <b>WW 8-72</b>	SERIAL NUMBER <b>6584328</b>	NEW SERIAL NUMBER	MODEL AND GRADE <b>700 270 ADL</b>
ACCESSORIES <b>W/STUDS</b>								

FROM:

COKER GARY W.  
835 PARK STREET  
BEAUMONT

TX 77701

SHIP TO:

COKER GARY W.  
835 PARK STREET  
BEAUMONTTX  
77701

CUST NO: 178123 C.O.D.

ACCOUNT NUMBER	ACCOUNT NUMBER NC	WRITE <input type="checkbox"/>	PROM. DATE	ESTIMATED	VIA <b>UPS</b>
----------------	-------------------	--------------------------------	------------	-----------	-------------------

GUN CONDITION

- ☐ NEW  
☐ LIGHTLY WORN  
☐ WORN  
☐ VERY WORN  
☐ UNREPAIRABLE  
☐ MARRED

REPAIR CHARGE

EXCISE

TAX

INSURANCE

UPS

PARCEL POST

TOTAL

**38.00**

CUSTOMER CONCERN	AMMO	FUNCTION	FINISH	ACCURACY	FIT	INSPECT	TOTAL
CYCLE	A7	B1					
TRIGGER GROUP		B2			F1	F1	
BOLT ASSY.					F2	F2	
BARREL ASSY.		B4		D1	E3	F3	
REC. ASSY.		B5		D3	E5	F5	
WOOD							
METAL							

MAIN FAULT

*Exchange trigger assy at a special price strictly  
as a gesture of good will.*

PARTS

COMMENTS

*Trig. part 5 1/4 lbs as rec'd.**Bolt stop sticks as rec'd.**Sec sticks down after firing  
triggers overhead and pounds  
pall screws all end.**See owners manual for proper  
care and maintenance.*

REPAIRMAN <i>WFA</i>	PROOF	CLEAN	TEST	TARGET	PATTERN
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

OFFICE COPY

RD6025 REV. 7-97

GARY W. COKER

Attorney at Law

835 Park Street  
Beaumont, Texas 77701  
(409) 835-2488 / Fax (409) 835-4488

November 17, 1997

Remington Arms Company  
Arms Service Division  
Department Z  
14 Houfler Avenue  
Ilion, N.Y. 13357

Re: Remington Model 700ADL Rifle; Serial No. 6584328

Dear Sir/Madam:


Enclosed is the above-referenced rifle for inspection. This rifle discharged on a recent hunting outing with my ten year old son. The discharge occurred without the trigger being pulled. Initially the gun would not fire, and then fired without the trigger being touched. Another shell was placed in the chamber and the gun fired immediately upon the safety being released. After removing all shells, the gun continued to snap when the safety was released.

The gun has now ceased to exhibit that problem. However, I have no intention of using this gun again. This gun has been well maintained and is in very good condition, considering its age. I do not believe that, under any conditions, this rifle should have discharged as described.

After inspecting the rifle, I would appreciate being contacted at the telephone number shown above to discuss disposition of this rifle.

I look forward to hearing from you.

Sincerely,

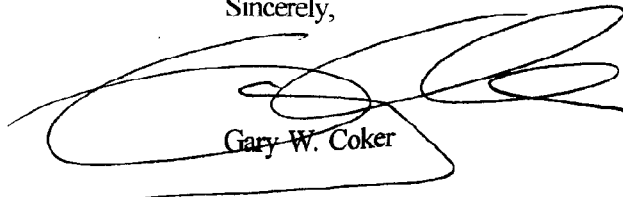

Gary W. Coker

GWC/sb