

Microsoft Access

File Edit View Records Window Help

Customer Service Data Entry

File Number: 9495 Arms Service number: 9710525

Last Name: GREAT GU First Name: NS INC

Street: 7550 OLD SEWARD HWY City: ANCHORAGE

State: AK Zip: 99518 Home Ph:

Work Ph: Product Type: F A T O

Type Concern: S PL ED P S C Concern Code: 1009

Concern: FIRED ON BOLT CLOSING

Cause Code: 4006 Cause: ALTERED ADJUSTMENTS OR COMPONENTS

Assigned To: KAST Classification: UNJ UNJ UNC UND J

Settlement Detail: REPAIR SPCL PRICE Settlement Amount: \$0.00

Date Opened Rem: 6/3/97 Date Opened by P/S: 8/13/97 Caliber: 30.06

Date of Incident: Date Closed: 8/13/97 Bullet Weight:

Date to Analysis: Date from Analysis: Manufacturer: REM

Model: 700 Serial: A6778239 Date Code: KV Date Mfgd: 5/1/79

RAMAC: 700 Litigation: ☐ PreLitigation: ☐ Obsolete: ☐

Custody: Comments:

Time of Modification: 11:49:03 AM Date of Modification: 8/13/97

Has this model been designated as obsolete?

FLTR

CAPS NUM

RECEIVING AND ESTIMATING REPORT

COMMENTS

ORDER

R 97-10525

INITIAL

CUSTOMER ORDER NO.

W/FLOOR PLATE, MAG BOX, MAG SPG, FOLLOWER, SCREWS

DATE RECEIVED

DATE OPENED

DATE CODE

SERIAL NUMBER

NEW SERIAL NUMBER

MODEL AND GRADE

05/28/97

06/03/97

KV 5-79

0677039

700 30-06

ACCESSORIES

L/WOOD

SCOPE BASE

FROM:

SHIP TO:

GREAT GUNS INC.
7550 OLD SEWARD HWY.
ANCHORAGE

AK 99518

GREAT GUNS INC.
7550 OLD SEWARD HWY.
ANCHORAGEAK
99518

ACCOUNT NUMBER

ACCOUNT NUMBER N.C.

CUST NO: 075936 C.O.D.

WRITE ☐

PROC. DATE

ESTIMATED

VIA

UPS

GUN CONDITION

- ☐ NEW
☐ LIGHTLY WORN
☐ WORN
☐ VERY WORN
☐ UNREPAIRABLE
☐ MARRED

REPAIR CHARGE

38.00

EXCISE

TAX

INSURANCE

UPS

PARCEL POST

TOTAL

CUSTOMER CONCERN

AMMO

FUNCTION

FINISH

ACCURACY

FIT

INSPECT

CYCLE

A1

B1

TRIGGER GROUP

B2

BOLT ASSY.

B3

BARREL ASSY.

B4

REC. ASSY.

B5

WOOD

B6

METAL

B7

MAIN FAULT

Inside of trig. Assy. is gummed up binding trig. and seal engagement has been altered. Outside of factory. Exchange trig. Assy. at a retail price strictly as a gesture of good will.

PARTS

Trig. Assy.

COMMENTS

See owners manual for proper care and maintenance.

REPAIRMAN

PROOF

CLEAN

TEST

TARGET

PATTERN

GALLERY TESTER

DATE

DATE


DATE

DATE

DATE

OFFICE COPY

RC8925 REV. 11/98

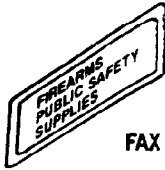

GREAT GUNS INC.

COMPLETE SALES & SERVICE CENTER
7550 OLD SEWARD HWY
FAX (907) 522-2528 ANCHORAGE, ALASKA 99518 (907) 522-3775

Remington Arms
Attn: Repair
Re: 700BDL, 30.06 #A67782399

Folks -

Customer says that on two separate occasions, hunting, below zero temps, chambering a round, closing the bolt caused the rifle to fire. He says the first time this happened he took the rifle to a shop, told him "it's full of grease - just needs cleaning". They supposedly cleaned completely.

Second time it happened he brought to us. He says also that last time in the field, the rifle would fire but firing pin would not indent primer.

Appreciate if you would take a look- either repair and return, etc.

GREAT GUNS INC.

Chuck Grubin, Mgr.