

A

P.I. NO GUN EXAMINATION REPORT NUMBER: 599 MODEL: 700 ADL
 GENERAL CONDITION: FAIR R #: 01375
 OUTSIDE WORK: SLING STRAP STUDS AND SCOPE DATE: 12-18-81
BASE ADDED FROM: LOUIS F. MADEW
216 N. MADISON ST.
STANTON VA
 FIRE ARMS TYPE: NOT KNOWN GUN #: 6596747
REVERSED
 & CONDITION: _____ CODE: ER-10-68
 PROOF: B TEMP.: U TEST: 79 GA./CAL.: 270
 READING: OK CHECKED BY: M-HARDY
 BREACH OPENING: OK APPROVED: GR 1/20/82
 RECOIL SHOULDERS: OK APPROVED: RG 1/20/82
 CHAMBER: OK APPROVED: P.H. 1/20/82
 TEST: _____ APPROVED: 8001-24-51
 COMPONENT COMMENT: (Damaged, Broken, Old Style) SLIGHT MARKS ON STOCK
 APPROVED: U

COMPLAINT: FIRES WHEN SAFETY IS RELEASED AT TIMES

REMARKS: _____

COMMENTS: Unable to duplicate customer complaint.
- OK on trick test
- Horizontal rear engagement .017

RECEIVING and ESTIMATE REPORT

ORDER R 01375

DATE 1-12-82
RECEIVED 12-18-81

ESTIMATED 1-12-82
2-16-82 VIA INS. 3158564 CHARGES

FROM Louis F. Maden

FEB 17 1982

216 N. Madison ST. STAUNTON, VA. 24401

MODEL and GRADE 700

270

SERIAL NO. 6596747

DATE CODE 7

GRADE CODE

FOR COMPUTER REFER. ONLY

W/STDs, Scope base
Trigger Shua

REPAIR CHG.

\$ 55

INS.

PARCEL POST

GUN CONDITION (New) (Slightly worn) (Very worn) (Misused) (Quote)

TOTAL

CUSTOMER'S COMPLAINT

fire at times when safe released

MAIN FAULT

inspected by P.E.C. - replace trigger

GALLERY REPORT

trigger action

DEFECT CODE

Score


2nd

(Clean) (Test) (Target)

Repairman

5 CP

FEB 18 1982

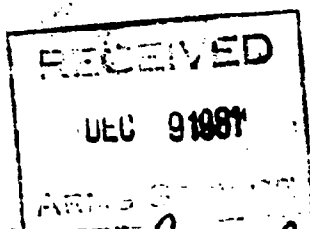

December 7th 1981
216 N. Madison Street
Staunton, Virginia 24401

Remington Arms Company, Inc.
Ilion, N. Y.

(1) 24/700

Dear Sir,

I have a Remington Mod. 700 - ADL which will go off sometimes when you take it off safety. It does not do it each time you take it off safety. you never know when its going to go off. It almost shot a fellow hunter in the foot.

Do you want this gun returned to you for repair? This gun is eight years old but has been shot less than a hundred times.

Thank you very much for your cooperation.

yours truly,
Louis J. Mader

Remington.



REMINGTON ARMS COMPANY, INC.

SPORTING ARMS-AMMUNITION-TARGETS-TRAPS

ILION, NEW YORK 13357

TELEPHONE (518) 894-9961

December 9, 1981

Mr. Louis F. Maden
216 N. Madison Street
Staunton, VA 24401

Subject: Model 700

Dear Mr. Maden:

Thank you for your recent letter regarding the repair of your Remington firearm.

Please package your gun and send it directly to:

Remington Arms Company, Inc.
Arms Service Division
Ilion, New York 13357

Please attach a letter to the outside of the package explaining the problem, and tag the firearm with your name and address in addition to the model number and serial number of the firearm.

As soon as we receive your firearm, we will acknowledge receipt and advise you of our findings.

We look forward to being of service to you.

Sincerely,

Arms Service Division

Done

Hold for Reply

R-1325

January 28, 1982

Mr. Louis F. Maden
216 N. Madison St.
Staunton, Virginia 24401

Dear Mr. Maden:

Examination has been completed on the Model 700 ADL 270 Win. caliber rifle, serial number 6596747, which you returned to us when it allegedly fired as the safety lever was moved to the "fire" position.

The returned firearm, which was produced in October of 1968, has been examined by our firearms experts who report that it contained our high-pressure proof test, gallery test, and final inspection stampings, indicating that it had successfully passed all our necessary tests prior to shipment.

The general condition of the gun appeared to be fair, and it was noted that sling-swivel studs and scope bases had been added after it originally left our factory. In addition, it was noted that the stock contained slight marks. In going over the individual parts, we found the headspace, recoil shoulders, and chamber all to be normal.

Examination of the rifle and trigger assembly could not duplicate the incident that was described. All parts tolerances and dimensions were found to be normal, including sear-connector engagement. Also, factory seals were intact on the trigger adjusting screws, indicating no alterations were made on the trigger outside our company. Trigger pull was within our specifications at 5 pounds.

Based on our findings, Remington Arms Company, Inc., cannot accept any liability or responsibility for the incidents. It is possible that while you were moving the safety lever from the "safe" position to the "fire" position, you, at the same time inadvertently contacted the trigger. When the safety lever reached the "fire" position, the gun then discharged - as it is designed to do - because the trigger was being pulled with the gun no longer on "safe".

Back Lock

Gennis:

Please hold this rifle for reply.

Thank you.

Jim

bcc: E.F. Barrett
P.T. Millener
K.D. Green
R.B. Sperling
D.J. Sanita

R-01375

January 28, 1982

-2-

We trust that we have clarified the circumstances that could possibly have caused the accidental firings and, as a gesture of good-will, even though there is nothing wrong with the present trigger assembly, we can replace it with another assembly at no-charge, to insure that your faith in the rifle is restored, or, the rifle can be returned as received. We will await the decision and reply.

Thank you for having afforded us this opportunity to examine the rifle and to be of service.

Sincerely,

J.A. Stahl, Supervisor
Firearms Product Service

JAS:tpp

FOR : SAT II - WRITE II

~~D.J. SANITA~~

Location

ARMS SERVICE 52-2

V. H. B.

J.A. STEKL

Location

PROD. SERVICE 52-4

Phone
No.

cc: R#01375 M/700 270 WIN. CALIBER RIFLE, SERIAL #6596747

Date 2/11/82

Please replace the trigger assembly on the subject rifle at no-charge and return to:

→ Mr. Louis F. Maden
216 N. Madison St.
Staunton, Virginia 24401

1 Please expedite the work and keep the old trigger assembly for possible future reference.

Thank you,

J.A. Stekl
JAS:tpp

2/15/82

178

STOP, LOOK, AND LIVE

Remington 7700, 100
Serial # 6596747

From Louis W. Mader
216 N. Madison Street
Staunton, Virginia 24401

DON'T SAY IT-WRITE IT

To D.J. SANITA Location ARMS SERVICE 52-2
From J.A. STEKL Location PROD. SERVICE 52-4 Phone No. _____
Subject R#01375 M/700 270 WIN. CALIBER RIFLE, SERIAL #6596747 Date 2/11/82

Please replace the trigger assembly on the subject rifle at no-charge and return to:

Mr. Louis F. Maden
216 N. Madison St.
Staunton, Virginia 24401

Please expedite the work and keep the old trigger assembly for possible future reference.

Thank you,

J.A. Stekl
JAS:tpv

RD 778

STOP, LOOK, AND LIVE

RECEIVED

FEB 11 1982

J.A. STEKL

216 N. Madison Street
Staunton, Virginia 24401
February 4th, 1982

Remington Arms Company, Inc.
Attn. Mr. J.A. Stekl
Elion, New York 13357

Dear Mr. Stekl,

Thank you for your nice letter and
to the condition you found this gun. Some
of the mass were due to a guide knocking
the gun over in a canoe on a moose hunt.

I would like a new Trigger Assembly for
it have never had any of my other guns to
go off as this gun did in forty-five years of
hunting. Thank you very much,

Yours Truly
Laurie Y. Maden

PS. The gun is a Model 700, ADL, 270 Win Caliber
Control order # R01375

RECEIVED

FFR 9 1982

AIR SERVICE

January 28, 1982

Mr. Louis F. Maden
216 N. Madison St.
Staunton, Virginia 24401

Dear Mr. Maden:

Examination has been completed on the Model 700 ADL 270 Win. caliber rifle, serial number 6596747, which you returned to us when it allegedly fired as the safety lever was moved to the "fire" position.

The returned firearm, which was produced in October of 1968, has been examined by our firearms experts who report that it contained our high-pressure proof test, gallery test, and final inspection stampings, indicating that it had successfully passed all our necessary tests prior to shipment.

The general condition of the gun appeared to be fair, and it was noted that sling-swivel studs and scope bases had been added after it originally left our factory. In addition, it was noted that the stock contained slight marks. In going over the individual parts, we found the headspace, recoil shoulders, and chamber all to be normal.

Examination of the rifle and trigger assembly could not duplicate the incident that was described. All parts tolerances and dimensions were found to be normal, including sear-connector engagement. Also, factory seals were intact on the trigger adjusting screws, indicating no alterations were made on the trigger outside our company. Trigger pull was within our specifications at 5 pounds.

Based on our findings, Remington Arms Company, Inc., cannot accept any liability or responsibility for the incidents. It is possible that while you were moving the safety lever from the "safe" position to the "fire" position, you, at the same time inadvertently contacted the trigger. When the safety lever reached the "fire" position, the gun then discharged - as it is designed to do - because the trigger was being pulled with the gun no longer on "safe".

Dennis:
Please hold this rifle for reply.
Thank you.
Jim

bcc: E.F. Barrett
F.T. Millener
K.D. Green
R.B. Sperling
D.J. Sanita
R-01375

January 28, 1982

-2-

We trust that we have clarified the circumstances that could possibly have caused the accidental firings and, as a gesture of good-will, even though there is nothing wrong with the present trigger assembly, we can replace it with another assembly at no-charge, to insure that your faith in the rifle is restored, or, the rifle can be returned as received. We will await the decision and reply.

Thank you for having afforded us this opportunity to examine the rifle and to be of service.

Sincerely,

J.A. Stekl, Supervisor
Firearms Product Service

JAS:tpp

P.I. NO GUN EXAMINATION REPORT NUMBER: 599 MODEL: 700 AOL
 GENERAL CONDITION: FAIR R #: 01375
 OUTSIDE WORK: SLING STRAP STUDS AND SCOPE DATE: 12-18-81
BASE ADDED FROM: LOUIS F. MADEN
216 N. MADISON ST.
STAUNTON VA
 FIRE AMMO TYPE: NOT KNOWN GUN #: 6596747
 & CONDITION: REVERSED
 PROOF: B INSP.: U TEST: 79 CODE: ER = 10-68
 HEADING: OK GA./CAL.: L70
 BREACH OPENING: OK CHECKED BY: M-HARDY
 RECOIL SHOULDERS: OK APPROVED: [Signature] 1/26/82
 CHAMBER: OK APPROVED: [Signature] 1/20/82
 TEST: OK APPROVED: P.N. 1/26/82
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: [Signature] 1-26-82
SLIGHT MARKS ON STOCK

COMPLAINT: FIRES WHEN SAFETY IS RELEASED AT TIMES

INCIDENT: _____

COMMENTS: Unable to duplicate customer complaint.

- OK on trick test

- Horizontal sear engagement .017