

Remington Arms Co., Inc.
Product Service
Legal Case #:640

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
120244	11/20/2006	11/21/2006	11/21/2006				X

Customer Information

Type	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Linus	Leppinic	5155 E Davies Dr.	Centennial	CO	80122		H 303-773-2034

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD				
S	Cause:4038	Could Not Duplicate Concern		Unknown
C	fires on bolt closing	Concern:1020 Fired on Bolt Opening		

11/21/06-correspondence from repair-the firearm discharges when a round is placed in the chamber as bolt is closed. Cust checked this with spent case.lw

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	660/243		6236086	XS	12/1/1969
Date Purchased	Where Purchased	Accessories	Original Owner			
		Scope base	U			

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/660/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV

Replace TA at
n/c under
recall

Repair/Replacement Cost	Repair/Replacement Date
\$25.00	11/21/2006

1/21/06-replaced trigger at n/c under recall.lw

Examination[Remington/CF/BA]

PS 7205

Part	Sub-Part	Code	Comment
Examination	Examiner		Supry
	Exam Date		11/21/2006
	Product Type		RF
	Action Type		A
	Assigned To		Supry
Cause	4015	Improper Maintenance	
Barrel	Description		20 inch 243 caliber 660
	Date Code		XS
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Worn; Functioning	
	Face	Slightly Worn; Functioning	lots of brass shavings on bolt face
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	Some sticky residue visible on bolt stop.
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Magazine	Condition	---Select---	
	Box Condition	Slightly Worn; Functioning	
Overall	Exterior Condition	Worn; Functioning	
	Stock Condition	Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	

(PS 7206)

	Bulged	False	
Safety	Description		Bolt lock safetu
	Function	Slightly Worn; Functioning	
Sear	Lift	---Select---	
	Notch	---Select---	
Trigger	Condition	Abused; Functioning	Sear movement sluggish due to sticky residue build up in TA.
	Pull	---Select---	3.5
	Altered	False	

(PS 7207)

Repair Inquiry

Repair Number: RE00120244

Serial: 6236086 Model 660 Center Fire Caliber:
243 GLOSS

Repairman: Carl Cotton

Verify Repair

Status: Inspected 11/28/2006 1:23:55 PM

Address Information

Customer:

☒ Received From

Return To:

☐ Received From

Name: LINUS LEPPINK

LINUS LEPPINK

Address 1: 5155 EAST DAVIES DRIVE

5155 EAST DAVIES DRIVE

Address 2: PO Box:

PO Box:

City: CENTENNIAL

CENTENNIAL

State: CO Zip Code: 80122

Country: US

State: CO Zip Code: 80122

Country: US

FFL: ☐ ☐ ☐ ☐ ☐ ☐ ☐

Contact / Condition

Problems

Estimate

History / Status

Shipping / Billing

Problems Reported

Code	Desc
M123	FORWARD TO PRODUCT SE
M992	DISCHARGED WHEN BOLT (

Repair Notes

Replaced trigger assy.
at n/c under the recall.

Repairman's Comments

Problems Found

Code	Desc
M176	RETURNED FOR RECALL/UI

CSR Comments

Repair Search

Refresh

Close

PS 7208

Imwalson

11/28/2006

4:09 PM

CAPS

NUM

INS

SCRL

Start

2 Micros...

2 Intern...

Arms Ser...

Serial Num...

Search for...

P-touch E...

Microsoft ...

FullShot 97

100%

4:09 PM

Serial
Number:

6236086

Model: 660



RE00120244



Linus Leppink
5155 E Davies Dr
Centennial CO
80122
303-773-2034

this firearm discharges
when a round is placed
in the Chamber; as
bolt is closed.
I checked this with
ammo with powder
removed.

STICKY RESIDUE IN TRIGGER ASSEMBLY
COULD NOT
DUPLICATE CONCERN
BOLT LOCK SAFETY
UPDATE PER CURRENT
PROCEDURES NR
FLS 11/21/2006

120244

#640

Mr. and Mrs. Linus Leppink

C15758

(PS 7209

File Number: 22116		Arms Service number: 107751	
Last Name: SAXION		First Name: MIKE	
Street: 5131 FM 2493 EAST		City: BULLARD	
State: TX	Zip: 75757	Home Ph: 903-571-5251	
Work Ph:	Product Type: F	F A T O	
Type Concern: S	PI PD P S	Concern Code: 1007	
Concern: FIRED ON SAFE RELEASE			
Cause Code: 4006	Cause: ALTERED ADJUSTMENTS OR COMPONENTS		
Assigned To: SUPRY	Classification: UND	UNJ UNC UND J	
Settlement Detail: BLM PROGRAM	Settlement Amount:		\$0.00
Date Opened Rem: 2/6/2006	Date Opened by P/S: 2/6/2006	Caliber:	308
Date of Incident:	Date Closed: 2/7/2006	Bullet Weight:	
Date to Analysis:	Date from Analysis:	Manufacturer:	REM
Model: 660	Serial: 111589	Date Code: CR	Date Mfgd: 4/1/1968
RAMAC: 660	Litigation: ☐	PreLitigation: ☐	Obsolete: ☒
Custody:	Comments: TA set screws altered. Clean action, install new TA \$20 under the Bolt-Lock Modification Program. Repair and Shipping Document 2/20/06.		
Time of Modification: 7:56:22 AM			
Date of Modification: 2/10/2006			

PS 7210

BARBER - Kinzer PPS GAL RE0006299

BARBER - Kinzer PPS GAL RE0006299

Remington Arms Company, Inc.

870 Remington Dr. P.O. Box 700

Madison, NC 27025-0700

Parts/Repairs
Fax800-243-9700
336-548-7801

www.remington.com info@remington.com

**REPAIR
DOCUMENT****REPAIR
DOCUMENT**

Repair Order Number RE00107751	Description/Serial Number 111589	Date Received - 2/6/2006 Estimate Date - Current Date - 2/8/2006
Account # - R-	Model 660 Center Fire Caliber: 308 WIN	
Customer MIKE SAXION 5131 8M 2493 CAST	Return To MIKE SAXION 5131 8M 2493 CAST	
BULLARD, TX 75757 US	BULLARD, TX 75757 US	
Phone (H) (903)-571-5251 Phone (W)	Fax Email DONALDMS00@EARTHLINK.NI	

Reported		Problems		Found	
M110	FAILS TO FIRE			M239	REPLACE TRIGGER ASSEMBLY
M992	DISCHARGES WHEN TRIGGER IS NOT TOUCHED				
M993	SEND TO PRODUCT SERVICE FOR EVALUATION				

Technician's Comments	
Problem/Notes	Had the old style trigger assem. Replaced trigger assem. under the recall.

Parts and Labor		Quantity	Warranty (Y/N)
Material #	Material Description		
Part			
F91469	600 TRIGGER ASSB	1	Y
Part Total:		1	
Service			
4000104	ARMS SERV SHIPPING & HANDLING	0	Y
4000119	GR-TEST	1	Y
4000294	GR-CHECK TPA	1	Y
Service Total:		2	

PS 7211

Remington

Factory Repair Instructions

(NOTE: Please print and complete this form, and then include it with your firearm.)

Model Number: 660	Serial Number: 111589
Are you the original owner? ☐ YES ☒ NO	
Name: Mike Saxion	Date of Purchase: 2007 1968
Address (no PO Boxes): 5131 FM 2493 east	
City: Ballard	State: TX Zip: 75757
Phone (Daytime): 903 571-5251	Fax:
E-mail Address: DonaldMS00@earthlink.net	
☐ I would like to receive future e-mail updates from Remington.	
Please describe your problem:	
The firing pin will not "set" / engage when the bolt is cycled. Sometimes the pin will set when the safety is on while cycling the bolt. However, when the safety is pushed off the rifle will will fire. The rifle will discharge when the trigger is not pressed. EVERY DANGEROUS	
Ammunition Information:	
Manufacturer: Federal	Type: MISC
Other (i.e. bullet weight/type, shot size, powder):	

passed down in family

*

Serial Number:

Information: N/A

Powder Weight:

Primer Used:

Shot Size:

Reloader Used:

(Cleaning and Lubrication):

Cleaning solution used: sharses chore

How often do you clean the bore? (Months or Number of rounds) 10 rounds


How often do you clean the action? (Months or Number of rounds) 30 rounds

How often do you clean the trigger assembly? (Months or Number of rounds) 1 per year

Brand used: Rem tech

TRNG-ASSM. set screws altered.
replace TPA, check over, clean under
Bolt lock program for \$20.00

Quote (PS 7212)

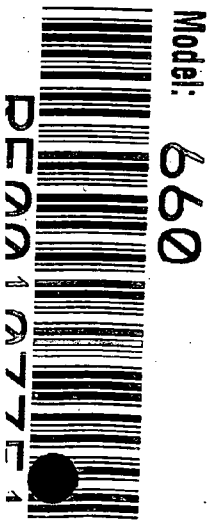

How often do you lubricate the bore? (Months or Number of rounds)	1/ month
How often do you lubricate the action? (Months or Number of rounds)	1/ month
How often do you lubricate the trigger assembly? (Months or Number of rounds)	
Have you reviewed the cleaning and maintenance recommendations on our web site or in our owners manual?	
☐ YES	☒ NO
Comments:	
When was the last time that your firearm was serviced by a Remington authorized repairman/gunsmith? ?	
What were the services performed?	
Ship your INSURED firearm by either UPS or Parcel Post to: REMINGTON ARMS CO., INC ATTN: Arms Service Division 14 Hoefler Ave Ilion, NY 13357	
⚠ WARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND SERIAL NUMBER OF YOUR FIREARM. :: Record the serial number of your firearm before sending it. :: Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.) :: Remove all accessories from your firearm to prevent loss or damage. :: Provide a return address on both the outside and inside the box. Shipments without a proper return address will be refused. :: Ship your INSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss during shipment, so you may elect to purchase insurance from your carrier. Charge repairs will be processed using the following guidelines: :: Repairs \$75.00 and under will be completed and returned to you C.O.D. (To avoid C.O.D. Charges, please include your credit card number and expiration date with your gun) :: For Repairs over \$75.00, you will receive a written estimate detailing the nature of the repair, applicable taxes and shipping. You will have 30 days to approve the repair estimate. Repairs can be paid by check, money order, or credit card (American Express, Discover, MasterCard, or VISA). If you wish, you can expedite repairs over \$75.00 by setting a pre-authorized amount that can be billed to your credit card.	

(PS 7213)

Date: 2/7/06By: B. TRAUISFIREARM INSPECTION WORKSHEETBACKGROUNDCustomer name: MIKE SAXIONR.E. Number: 107751Reason for inspection: FSRFIREARMManufacturer: Rum Model: 660Serial Number: 111589 Date of Manufacture: 4/68Overall external condition: FAIRBarrel condition: OKAYReceiver condition: OKAYStock condition: OKAYBolt/firing pin condition: OKAY

Trigger assembly condition:

Engagement: ALTEREDAdjustments/alterations: ALTEREDOther: —Headspace: —

Function evaluation:

(PS 7214)

Feeding: _____

Extraction/ejection: _____

Trigger pull: 2.5⁴

Manual safety: 0/144 - BOCTLOCK

Test firing results (if applicable): _____

DISPOSITION

TRIG. ASSM. SET SCREWS ADJUSTED. REPLACE TPA,
CHECK OVER, CLEAN UNDER BOLT LOCK PROGRAM \$20.00

ADDITIONAL COMMENTS

Quote

File Number:	22120		Arms Service number:	107842	
Last Name:	FRIEL		First Name:	PETER	
Street:	7 MANSEWOOD ROAD		City:	OLD LYME	
State:	CT	Zip:	06371	Home Ph:	
Work Ph:	203-488-8994		Product Type:	F	F A T O
Type Concern:	S	PI PD P S	Concern Code:	1008	
Concern:	FIRED ON BOLT CLOSING				
Cause Code:	4006	Cause:	ALTERED ADJUSTMENTS OR COMPONENTS		
Assigned To:	SUPRY	Classification:	UND	UNJ UNC UND J	
Settlement Detail:	UPDATE PER CURRENT PROCEDURES		Settlement Amount:	\$0.00	
Date Opened Rem:	2/7/2006	Date Opened by P/S:	2/7/2006	Caliber:	243
Date of Incident:		Date Closed:	2/7/2006	Bullet Weight:	
Date to Analysis:		Date from Analysis:		Manufacturer:	REM
Model:	660	Serial:	110241	Date Code:	CR
Date Mfgd:	4/1/1968				
RAMAC:	660	Litigation:	☐	PreLitigation:	☐
Obsolete:	☒				
Custody:		Comments:	Firearm never updated - update per current procedures at h/c. As received the set screw positions were altered. Repair and Shipping Document 2/20/06.		
Time of Modification:	8:11:27 AM				
Date of Modification:	2/10/2006				

(PS 7216)

BARBER - Kinzer PPS GAL RE0006305

BARBER - Kinzer PPS GAL RE0006305

*Remington.***TRACKING DOCUMENT**

Repair Order Number



Repair Order Number RE00107842	Description/Serial Number 110241	Repairman - Herb Brown
Account # - R-	Model 660 Center Fire Caliber 243 WIN	Date Received - 2/7/2006
		Estimate Date -
		Current Date - 2/8/2006
Customer PETER FRIEL 7 MANSEWOOD ROAD OLD LYME, CT 06371 US		Return To PETER FRIEL 7 MANSEWOOD ROAD OLD LYME, CT 06371 US
Phone (H) (203)-488-8774	Fax (203)-488-0359	
Phone (W)	Email PFRIEL@OUTDRS.NE	

Problems**Reported**

M992 FIRED WITHOUT TOUCHING
TRIGGER
M993 SEND TO PRODUCT SERVICE FOR
EVALUATION

Found

M176 RETURNED FOR RECALL/UPDATE
M993 SEND TO PRODUCT SERVICE FOR E

Repair

<u>Material #</u>	<u>MaterialDesc</u>	<u>Quantity Needed</u>	<u>Quantity From Inv</u>	<u>Quantity From Kit</u>	<u>Warranty (Y/N)</u>
Part					
F91469	600 TRIGGER ASSB	1	1	0	Y
Part Total:		1	1	0	
Service					
4000104	ARMS SERV SHIPPING & HANDLING	0	0	0	Y
4000119	GR-TEST	1	1	0	Y
Service Total:		1	1	0	

ProblemNotes up date done 2/7/06

Repairman	Proof	Clean	Test	Target	Pattern
Gallery Tester	Date	Date	Date	Date	Date

PS 7217

2.54 4/68

10784 Remington

Factory Repair Form

Return to Previous Page

NOTE: Please print and complete this form, and then include it with your firearm

Model Number: 660 (.243)		Serial Number: 110241	
Are you the original owner?: ☐ YES ☒ NO			
Name: PETER FRIEL		Date of Purchase: 1990	
Address (no PO Boxes): 7 MANSEWOOD ROAD			
City: OLD LYME		State: CT	Zip: 06371
Phone (Daytime): 203.488.8994		Fax: 203.488.0359	
E-mail Address: ☐ I would like to receive future e-mail updates from Remington. PFRIEL@OUTDOORS.NET			
Please describe your problem and date of occurrence: I BOUGHT THIS GUN IN 1990 FROM AN OLD TIMER WHO WAS SELLING OFF HIS GUNS. I NEVER FIRED THIS GUN UNTIL LAST FALL AND FOUND OUT THAT IT HAD A FAULTY TRIGGER AND SAFETY MECHANISM. AT FIRST IT HAD A DELAYED FIRE AFTER PULLING THE TRIGGER THEN IT FIRED AFTER CLOSING THE BOLT WITHOUT EVER TOUCHING THE TRIGGER. IF THE TRIGGER SYSTEM IS WHATS AT FAULT AND IT CAN BE REPAIRED IS IT THEN POSSIBLE TO ADJUST THE TRIGGER TO A 3# PULL? IF THIS CAN BE DONE			
Ammunition Information: FOR UNDER \$100.00 THEN PLEASE PROCEED WITH THE WORK			
Manufacturer:		Type: THANK YOU VERY MUCH	
Other (i.e. bullet weight/type, shot size, powder):			
* CREDIT CARD INFO: VISA EXP. 12/07			
Handload Information: # 4264 2901		REDACTED PETER FRIEL	
Powder Used:		Powder Weight:	
Case/Hull Used:		Primer Used:	
Bullet Type/Shot Size:		Reloader Used:	

Serial Number:

110241

Model: 660



RE00107842

TRIG. ASSM. SET SCREWS ALTERED.

Replace TPA, check over, clean under
 (number of rounds) ~~DO NOT SET TRIG. PULL TO MIN SPEC.~~ REGALL
 (number of rounds) SET TRIG. pull to min spec.
 (months or Number of rounds) H/C

factory_repair_form.asp

1/29/2006

(PS 7218)

Brand of lubricant used:	
How often do you lubricate the bore? (Months or Number of rounds)	
How often do you lubricate the action? (Months or Number of rounds)	
How often do you lubricate the trigger assembly? (Months or Number of rounds)	
Have you reviewed the cleaning and maintenance recommendations on our web site or in our owners manual? ☐ YES ☐ NO	
Comments:	
When was the last time that your firearm was serviced by a Remington authorized repairman/gunsmith? <i>NEVER WHILE IN MY POSSESSION</i>	
What were the services performed?	
Ship your INSURED firearm by either UPS or Parcel Post to: Remington Arms Co., Inc. Attn: Arms Service Division 14 Hoefler Avenue Ilion, NY 13357 <i>* RETURN ADDRESS</i> PETER FRIEL 17 MANSEWOOD ROAD OLD LYME, CT 06371 <i>(HOME PHONE 860-434-1811)</i>	
Ⓢ WARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND SERIAL NUMBER OF YOUR FIREARM. :: Record the serial number of your firearm before sending it. :: Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.) :: Remove all accessories from your firearm to prevent loss or damage. :: Provide a return address on both the outside and inside the box. Shipments without a proper return address will be refused. :: Ship your INSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss during shipment, so you may elect to purchase insurance from your carrier. Charge repairs will be processed using the following guidelines: :: Repairs \$75.00 and under will be completed and returned to you C.O.D. (To avoid C.O.D. Charges, please include your credit card number and expiration date with your gun) :: For Repairs over \$75.00, you will receive a written estimate detailing the nature of the repair, applicable taxes and shipping. You will have 30 days to approve the repair estimate. Repairs can be paid by check, money order, or credit card (American Express, Discover, MasterCard, or VISA). If you wish, you can expedite repairs over \$75.00 by setting a pre-authorized amount that can be billed to your credit card.	

Date: 2/7/06By: B. TimonisFIREARM INSPECTION WORKSHEETBACKGROUNDCustomer name: Peter FrielR.E. Number: 107842Reason for inspection: Delay Filed - FDCFIREARMManufacturer: Rm. Model: 660Serial Number: 110241 Date of Manufacture: 4/68Overall external condition: FAIRBarrel condition: OKAYReceiver condition: OKAYStock condition: OKAYBolt/firing pin condition: OKAY

Trigger assembly condition:

Engagement: ALTEREDAdjustments/alterations: ALTEREDOther: —Headspace: —

Function evaluation:

(PS 7220)

File Number:	21969		Arms Service number:	105430	
Last Name:	BRYANT		First Name:	JIMMIE	
Street:	PO BOX 1224		City:	LENOIR	
State:	NC	Zip:	28645	Home Ph:	828-758-2023
Work Ph:		Product Type:	F	F A T O	
Type Concern:	S	PI PD P S	Concern Code:	1007	
Concern:	FIRED ON SAFE RELEASE				
Cause Code:	4006	Cause:	ALTERED ADJUSTMENTS OR COMPONENTS		
Assigned To:	SUPRY	Classification:	UND	UNJ UNC UND J	
Settlement Detail:	UPDATE N/C		Settlement Amount:	\$0.00	
Date Opened Rem:	12/29/2005	Date Opened by P/S:	12/29/2005	Caliber:	308
Date of Incident:		Date Closed:	12/29/2005	Bullet Weight:	
Date to Analysis:		Date from Analysis:		Manufacturer:	REM
Model:	660	Serial:	6224418	Date Code:	PS
Date Mfgd:	6/13/1969				
RAMAC:	660	Litigation:	☐	PreLitigation:	☐
Obsolete:	☒				
Custody:		Comments:	TA screws positions altered. TA never updated. Update per current procedures at n/c. Repair and Shipping Document 2/20/06.		
Time of Modification:	10:01:06 AM				
Date of Modification:	1/10/2006				

(PS 7222)

BARBER - Kinzer PPS GAL RE0006311

BARBER - Kinzer PPS GAL RE0006311

Remington Arms Company, Inc.

870 Remington Dr. P.O. Box 700

Madison, NC 27025-0700

Parts/Repairs
Fax800-243-9700
336-548-7801

www.remington.com info@remington.com

**REPAIR
DOCUMENT****REPAIR
DOCUMENT**

Repair Order Number RE00105430 Account # - R-	Description/Serial Number 6224418 Model 660 Center Fire Caliber: 308 WIN	Date Received - 12/29/2005 ✓ Estimate Date - Current Date - 1/4/2006
Customer JIMMIE BRYANT P.O. BOX 1224 LENOIR, NC 28645 US	Return To GARYS GUNSMITHING 5366 STATE ROUTE 31 VERONA, NY 13478 US	
Phone (H) (828)-758-2023 Phone (W)	Fax Email	

Reported		Found	
M123	FORWARD TO PRODUCT SERVICE FOR INSPECTION	M123	FORWARD TO PRODUCT SERVICE FC
M239	REPLACE TRIGGER ASSEMBLY		
M992	FIRES WHEN TAKEN OFF SAFE		

Technician's Comments	
Problem/Notes	trigger set screws altered. trigger has not been updated. replace trigger plate assm under recall, check over, clean at no charge.

Parts and Labor		Quantity	Warranty (Y/N)
Material #	Material Description		
Part			
F91469	600 TRIGGER ASSB	1	Y
Part Total:		1	
Service			
4000104	ARMS SERV SHIPPING & HANDLING	0	Y
4000119	GR-TEST	1	Y
Service Total:		1	

PS 7223

Dec 12, 2005

Trig. setscrews altered.
Trig. has not been updated.
Replace TPA under recall, check
over, clean at N/C

3# 3/69

Dear Sir,

Enclosed is a Remington Model 660.
The safety needs to be repaired or replaced.
The rifle will fire when the safety
is taken off without touching the
trigger. There was a recall on this model
sometime ago. However, we have not
experienced any problems until
recently.

If there is a charge, please let me
know.

Thank you,

W 5430

Serial Number: 6224418

Model: 660



RE00105430

Jimmie Bryant
PO Box 12204
Lenoir, NC 28645
828-758-2023

(PS 7224)

Date: 12/29/05By: B. TRAVISFIREARM INSPECTION WORKSHEETBACKGROUNDCustomer name: Jimmie BRYANTR.E. Number: 105430Reason for inspection: FSRFIREARMManufacturer: Rum. Model: 660Serial Number: 6224418 Date of Manufacture: 3/69Overall external condition: FAIRBarrel condition: OKAYReceiver condition: OKAYStock condition: OKAYBolt/firing pin condition: OKAY

Trigger assembly condition:

Engagement: ALTEREDAdjustments/alterations: ALTEREDOther: OLD STYLE - NOT updatedHeadspace: -

Function evaluation:

(PS 7225

