

File Number: 21721		Arms Service number: 103374	
Last Name: READINGER		First Name: TERRY	
Street: 140 ARBORETUM ROAD		City: BERNVILLE	
State: PA	Zip: 19506	Home Ph: 610-488-7564	
Work Ph:	Product Type: F	F A T O	
Type Concern: PI	PI PD P S C	Concern Code: 1007	
Concern: FIRED ON SAFE RELEASE - THUMB			
Cause Code: 4015	Cause: IMPROPER MAINTENANCE		
Assigned To: SUPRY	Classification: UND	UNJ UNC UND J	
Settlement Detail: REPAIR N/C	Settlement Amount:		\$65.00
Date Opened Rem: 11/14/2005	Date Opened by P/S:	10/28/2005	Caliber: 243
Date of Incident: 10/15/2005	Date Closed: 11/15/2005	Bullet Weight:	
Date to Analysis:	Date from Analysis:	Manufacturer:	
Model: 673	Serial: 7788330	Date Code: PX	Date Mfgd: 6/10/2003
RAMAC: 673	Litigation: ☐	PreLitigation: ☐	Obsolete: ☐
Custody:	Comments: While on a guided hunt the rifle discharged when the safety was moved. He says it was stuck and he had to put additional pressure to move safety. Injured thumb, ARS label and letter sent 11/1/05. Trigger and trigger pin rusted causing trigger to bind. Clean action and install new TA n/c as gesture of goodwill. Charge 230145.		
Time of Modification: 2:13:43 PM			
Date of Modification: 11/1/2005			

Serial
Number:

7788330

Model: 673



RE00103374

6/10/03

6/03

DEAR FRED,

I WAS IN NEW BRUNSWICK, CANADA BEAR + DEER HUNTING. ON THE FIRST DAY OF THE HUNT, MY GUIDE AND I WENT TO MY BEAR STAND. WHEN I LOADED THE RIFLE, I LOOKED MY SAFETY WAS JAMED IN BETWEEN FIRE AND SAFETY. I OPENED THE BOLT HALF WAY AND THEN CLOSED THE BOLT. THEN I COULD MOVE THE SAFETY TO SAFE. TO MAKE SURE THE SAFETY DIDNT JAM BETWEEN FIRE AND SAFETY AGAIN, I PUSHED THE SAFETY TO FIRE WITHOUT MY FINGER ON THE TRIGGER. THE RIFLE FIRED IN THE AIR. THE RECOIL MADE THE SAFETY KNOB TEAR INTO THE TIP OF MY THUMB, RIPPING IT OPEN, CLOSE TO THE BONE. THE NEXT DAY I LOADED THE RIFLE AGAIN KNOWING THE PROBLEM, I WAS PREPARED FOR WHAT COULD HAPPEN. AND THE SAME THING HAPPENED TWO TIMES. I KNOW THAT REMINGTON MAKES A VERY FINE FIRE ARM AND I BELIEVE THIS WAS A VERY RARE INCIDENT. DUE TO THE DEFECT IN MY RIFLE, I WOULD LIKE REMINGTON TO REPAIR OR REPLACE MY MODEL 673 - 350 MAG. FOR THE INCONVENIENCE ON MY HUNTING TRIP AND MY INJURY I WOULD LIKE REMINGTON TO GIVE ME A MODEL 700 BDL. IN 338 MAG. I WOULD LIKE TO GO FOR LARGE BEAR, ELK, MOOSE SOME DAY. I HOPE YOU WILL HONOR MY REQUEST. I HAVE ALWAYS PURCHASED REMINGTON AND WILL CONTINUE TO DO SO.

REPAIR AS NEEDED w/c

Charge 230145

Please expedite!

FLS 11/15/05

TERRY L. READINGER

140 ARBORETUM RD.

BERNVILLE PA. 19506

121014007564

SINCERLY,

Terry L. Readinger

PS 7228

Serial
Number:

// 88330

Model: 673



RE00103374

6/03
DEAR FRED,

I WAS IN NEW BRUNSWICK, CANADA BEAR + DEER HUNTING. ON THE FIRST DAY OF THE HUNT, MY GUIDE AND I WENT TO MY BEAR STAND. WHEN I LOADED THE RIFLE I LOOKED MY SAFETY WAS JAMED IN BETWEEN FIRE AND SAFETY. I OPENED THE BOLT HALF WAY AND THEN CLOSED THE BOLT. THEN I COULD MOVE THE SAFETY TO SAFE. TO MAKE SURE THE SAFETY DIDN'T JAM BETWEEN FIRE AND SAFETY AGAIN I PUSHED THE SAFETY TO FIRE WITHOUT MY FINGER ON THE TRIGGER. THE RIFLE FIRED IN THE AIR. THE RECOIL MADE THE SAFETY KNOB TEAR INTO THE TIP OF MY THUMB, RIPPING IT OPEN, CLOSE TO THE BONE. THE NEXT DAY I LOADED THE RIFLE AGAIN KNOWING THE PROBLEM, I WAS PREPARED FOR WHAT COULD HAPPEN. AND THE SAME THING HAPPENED TWO TIMES. I KNOW THAT REMINGTON MAKES A VERY FINE FIRE ARM AND I BELIEVE THIS WAS A VERY RARE INCIDENT. DUE TO THE DEFECT IN MY RIFLE, I WOULD LIKE REMINGTON TO REPAIR OR REPLACE MY MODEL 673 - 350 MAG. FOR THE INCONVENIENCE ON MY HUNTING TRIP AND MY INJURY I WOULD LIKE REMINGTON TO GIVE ME A MODEL 700 BDL. IN 338 MAG. I WOULD LIKE TO GO FOR LARGE BEAR, ELK, MOOSE SOME DAY. I HOPE YOU WILL HONOR MY REQUEST. I HAVE ALWAYS PURCHASED REMINGTON AND WILL CONTINUE TO DO SO.

SINCERLY,

Terry L. Readinger

TERRY L. READINGER

140 ARBORETUM RD.

BERNVILLE PA. 19506

PS 7229

Date: 11/14/05By: Bruce T. MAUIFIREARM INSPECTION WORKSHEETBACKGROUNDCustomer name: TERRY L. RENDINGERR.E. Number: 103374Reason for inspection: FSRFIREARMManufacturer: Rm. Model: 673Serial Number: 7788330 Date of Manufacture: 6/03Overall external condition: GoodBarrel condition: OKAYReceiver condition: OKAYStock condition: OKAYBolt/firing pin condition: OKAY

Trigger assembly condition:

Engagement: —Adjustments/alterations: —Other: TRIP + PIN RUSTED/BINDINGHeadspace: —

Function evaluation:

PS 7230

Extraction/ejection: _____

Manual safety: 0124-1

Test firing results (if applicable): _____

This image shows a single sheet of white paper with horizontal blue or grey ruling lines. The lines are evenly spaced and run across the width of the page. There is no handwriting or printed text on the paper. A small dark speck is visible near the bottom left corner.

BARBER - Kinzer PPS GAL RE0006320

File Number:	21934		Arms Service number:	105560	
Last Name:	VIGNEAULT		First Name:	DENNIS	
Street:	12 SLEEPER ROAD		City:	SUNAPEE	
State:	NH	Zip:	03782	Home Ph:	603-863-4874
Work Ph:		Product Type:	F	F A T O	
Type Concern:	S	PI PD P S	Concern Code:	1007	
Concern:	FIRED ON SAFE RELEASE				
Cause Code:	4015	Cause:	IMPROPER MAINTENANCE		
Assigned To:	SUPRY	Classification:	UND	UNJ UNC UND J	
Settlement Detail:	NEW TA N/C		Settlement Amount:	\$65.00	
Date Opened Rem:	12/21/2005	Date Opened by P/S:	12/21/2005	Caliber:	300 SAUM
Date of Incident:		Date Closed:	12/21/2005	Bullet Weight:	
Date to Analysis:		Date from Analysis:		Manufacturer:	REM
Model:	673	Serial:	7783074	Date Code:	AX
RAMAC:	673	Litigation:	☐	PreLitigation:	☐
Custody:		Obsolete:	☐		
Time of Modification:	2:09:17 PM				
Date of Modification:	12/21/2005				
Comments:	Trigger assembly rusty - clean action and install new TA at n/c - charge 230145. Repair and Shipping Document 2/20/06				

PS 7232

Remington.**TRACKING DOCUMENT**

Repair Order Number



Repair Order Number RE00105560	Description/Serial Number 7783074	Repairman - Dale Lewis
Account # - R-	Model 673 Center Fire Caliber: 300 GUIDE RIFLE	Date Received - 12/21/2005
		Estimate Date -
		Current Date - 12/27/2005
Customer DENNIS VIGNEAULT 12 SLEEPER ROAD SUNAPEE, NH 03782 US		Return To DENNIS VIGNEAULT 12 SLEEPER ROAD SUNAPEE, NH 03782 US
Phone (H) (603)-863-4874		Fax
Phone (W)		Email

Reported		Found	
M123	FORWARD TO PRODUCT SERVICE FOR INSPECTION	M123	FORWARD TO PRODUCT SERVICE F
M207	FAILS TO COCK		
M992	FIRE WHEN MOVING SAFETY		

Material #	Material Desc	Quantity Needed	Quantity From Inv	Quantity From Kit	Warranty (Y/N)
Part					
F92458	7 TRIGGER ASSB	1	1	0	Y
Part Total:		1	1	0	
Service					
4000104	ARMS SERV SHIPPING & HANDLING	0	0	0	Y
4000119	GR-TEST	1	1	0	Y
4000294	GR-CHECK TPA	1	1	0	Y
Service Total:		2	2	0	


Problem Notes rusted ta, clean action and install new ta n/c per product service					
Repairman	Proof	Clean	Test	Target	Pattern
Galley Tester	Date	Date	Date	Date	Date

PS 7233

Serial Number:

7783074

Model: 673

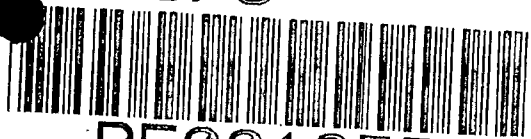

RE00105560

Remington.

Fair Instructions

form, and then include it with your firearm.)

Serial Number: 7783074

Are you the original owner?: ☒ YES ☐ NO

Name: Dennis Vigneault

Date of Purchase: 01/2004

Address (no PO Boxes): 12 Sleepex Rd.

City: Sunapee

State: N.H.

Zip: 03782

Phone (Daytime): (603) 863-4874

Fax:

E-mail Address:

☒ I would like to receive future e-mail updates from Remington. sdvigneault@adelphia.net

Please describe your problem: Fired when I pushed safety off if happened twice. I put the safety right through my thumb. It doesn't cock when I left bolt up and down.

Ammunition Information:

Manufacturer: Remington

Type: Premier S.A. ultra mag

Other (i.e. bullet weight/type, shot size, powder): 150 grain

Handload Information:

Powder Used:

Powder Weight:

Case/Hull Used:

Primer Used:

Bullet Type/Shot Size:

Reloader Used:

Firearms Care (Cleaning and Lubrication):

Brand of cleaning solution used: Scent eliminating Gun Cleaning System

How often do you clean the bore? (Months or Number of rounds) after each hunt

How often do you clean the action? (Months or Number of rounds) after each hunt

How often do you clean the trigger assembly? (Months or Number of rounds) have not

Brand of lubricant used: Invisible Gun

(PS 7234)

Date: 12/21/05By: FRED SUPRYFIREARM INSPECTION WORKSHEETBACKGROUND

Customer name: Dennis Vigneault
R.E. Number: 105560
Reason for inspection: FSR

FIREARM

Manufacturer: Rem Model: 673
Serial Number: 7783074 Date of Manufacture: AX-
Overall external condition: good

Barrel condition: ok
Receiver condition: ok
Stock condition: ok
Bolt/firing pin condition: ok
Trigger assembly condition:
Engagement: ok
Adjustments/alterations: ok
Other: Reset
Headspace: —
Function evaluation:

(PS 7235)

