

Remington Arms Co., Inc.
Product Service
Legal Case #:606

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
120166	11/13/2006	11/14/2006	11/14/2006				

Customer Information

Type	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Karl Mascia	Bensalem Township PD	2400 Byberry Road	Bensalem	PA	19020		W 215-633-3729 F 215-633-3656

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4039	No Fault Found		
S	Accidental discharge	Unexplained Discharge	Unknown	
C	Concern:1025	- No Mention of Safety Position		

Customer states: he was in a sniper situation and the gun started to fall off a roof, and in his attempt to secure the rifle from falling off the roof an accidental discharge occurred. No injuries, only some minor damage to a stone wall of the motel. Our examination showed the rifle to be within specifications and we could not make it fire unless the safety was off and the trigger pulled.

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bb
REMINGTON	CF/BA	40X/308 WIN	27174	065708B	O

Date Purchased	Where Purchased	Accessories	Original Owner
	FIRING LINE INC (WL)	SCOPE,RINGS,BASE,BIPOD,SLING,HARD CASE	Y

CUST.CONCERN:ACCIDENTAL DISCHARGE

Ammunition Information - None Defined

Other Products Information - None Defined

(PS 8181)

PrintDisplay

Page 2 of 3

Settlement

REMINGTON/40X/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Ca Date Da APV AP
------------	-------------------	--------------	---------------	-----------------	-------------------------------

Repair/Replacement Cost	Repair/Replacement Date
----------------------------	----------------------------

After our inspection we forward the rifle to the Custom Shop for them to examine since the rifle was originally produced in the Custom Shop.


Examination[REMINGTON/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		11/14/2006
	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		28" 308 WIN HB FL
	Date Code		OX
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
		Slightly Worn;	

PS 8182

	Stop	Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Like new; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	MARS ON BBL AT MUZZLE
	Stock Condition	Slightly Worn; Functioning	SCRATCHES ON FLOOR PLATE AND STOCK AT FRONT TAKE DOWN SCREW
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/40X SAFETY
	Function	---Select---	
Sear	Lift	---Select---	N/A WITH SCOPE, ATTRIBUTE OK
	Notch	Like new; Functioning	
Tests	Test Fired	False	
	Feeding Test	False	
Trigger	Condition	Like new; Functioning	
	Pull	---Select---	4#
	Altered	False	

PS 8183

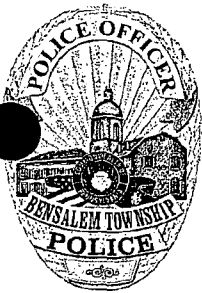

BENSALEM TOWNSHIP POLICE DEPARTMENT

2400 Byberry Road • Bensalem, PA 19020 • (215) 633-3700 • Fax (215) 633-3656

Frederick A. Harran
Director of Public Safety

November 8, 2006

Fred Supry
Remington Arms Company
14 Hoefler Avenue
Ilion, NY 13357

*could not duplicate concern.
check over completely, repair/adjust
as needed.*

*4#
04/7/03
28"*

Dear Fred,

On November 2, 2006, the Bensalem Township Police Department SWAT Team responded to a neighboring jurisdiction for assistance in serving an arrest warrant for a member of the Crips street gang. During this operation a Department sniper experienced an Accidental Discharge (AD). The following is the sniper's account of what took place

During the surveillance of the target room, this writer's firearm (.308 rifle) slid forward off the roof edge it was lying on and began to fall forward. In my attempt to secure the rifle from falling off the roof an accidental discharge occurred. The discharged rifle round struck the stonewall of the motel at an downward angle and disintegrated upon impact. There were no injuries to any police personnel in the area or to any civilians. Some very minor cosmetic damage occurred to the stonewall.

On Wednesday, November 8, 2006, Det. Glenn Vandegrift of the Bensalem Township Police Department advised me that he spoke to you and you have generously offered to assist us by inspecting the rifle used by our sniper. Please conduct the following checks and any others you feel are appropriate; function check, original manufactured parts, wear and/or out of tolerance parts etc... If any parts are found to be defective, please advise me so I can complete the necessary Purchase Order for payment.

Enclosed Rifle: Remington 700XB (serial# 065708B) with mounted scope and bipod.

Upon completion of your examination, please forward me any relative paperwork along with the rifle.

Thank you very much for your assistance.

Karl A. Mascia

Sergeant Karl A. Mascia
Bensalem Township Police Department
2400 Byberry Road
Bensalem, PA. 19020
215-633-3729 Fax 215-633-3656
email: kmascia@bensalem-township.org

Serial Number:

065708B

Model: **40X**



RE00120166

~ Protect with honor, Serve with pride ~

PS 8184

Arms Services Repair & Estimate System

File Add Repair Estimate Repair Expedite Repair Inquiry Repair Tools CSR Tools Reports Table Maintenance System Maintenance Help

Repair Inquiry

Repair Number: **RE00120166** Serial: 0657088 Model 40XB Center Fire Caliber 308 WIN Produced: 07/28/2003 Repairman: Status: New 11/13/2006 10:10:30 AM

Address Information

Customer: Received From: Return To: Received From:

Name: **BENSALEM TOWNSHIP POLICE DEPT** **BENSALEM TOWNSHIP POLICE DEPT**

Address 1: **2400 BYBERRY ROAD** **2400 BYBERRY ROAD**

Address 2: **PO Box** **PO Box**

City: **BENSALEM** **BENSALEM**

State: **PA** Zip Code: **19020** Country: **US** State: **PA** Zip Code: **19020** Country: **US**

FEL: ☐ ☐ ☐ ☐ ☐ ☐

Contact / Condition **Problems** **Estimate** **History / Status** **Shipping / Billing**

Date	Code	User ID	Desc1	Desc2	Current Status
11/13/2006 10:0	New	valentds	Repair Added		New
11/13/2006 10:10	Update	valentds	Repair information change		11/13/2006 10:10:30 AM
11/13/2006 10:1	Expedite	valentds	From: Check In	To:	valentds
11/14/2006 7:24	Expedite	Travisbw	From: Product Services	To:	Custom Shop

☐ Shipping Hold ☐ InterFace Hold ☐ Estimate Sent ☐ Parts Received ☐ Passed Inspection ☐ Return As Received ☐ Has been Approved ☐ Internal Repair

Repair Location: **CST**

Current Location: **ILN**

Transfer Number:

Repair Search **Refresh** **Close**

supryll 11/15/2006 11:38 AM CAPS INUM INS SERL

start | Inbox - Microsoft | Arms Services | Search for | Microsoft Office | Microsoft Excel | Enter New Case | 11:30 AM

PrintDisplay

Remington Arms Co., Inc.
Product Service
Legal Case #:918

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
122984	1/11/2007	1/12/2007	1/12/2007				

Customer Information

Type	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Tom	Wanner	5145 Eden Ave	Edina	MN	55436		H 612-940-4263

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD				
S	Cause:4006 Fires on safe release	Altered Adjustments or Components Concern:1007 Fired on Safe Release	Unknown	
C				

1/15/07-correspondence from repair-When the safety is pushed to the off position gun fires. Please repair.lw

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial Bbl	DOM
REMINGTON	RF/BA	40-X/22 LR		9896 LG	2/1/1960
Date Purchased	Where Purchased	Accessories	Original Owner		
		PEEP SIGHT BASE,ONE BASE ON REC,TWO BASES ON BBL	U		

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Replace under SMP						
	Repair/Replacement Cost	Repair/Replacement Date				

1/15/07-replace under SMP.lw

Examination[REMINGTON/RF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/12/2007
	Product Type		RF
	Action Type		A

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=918&Type=Case

PS 8186

1/30/2007

PrintDisplay

	Assigned To		F.SUPRY
Cause	4006	Altered Adjustments or Components	TRIGGER ASSM SET SCREWS ALTERED
Barrel	Description		28" SS LR HB
	Date Code		LG
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	---Select---	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/40-X BOLT LOCK SAFETY
	Function	Slightly Worn; Functioning	
Tests	Test Fired	False	
	Feeding Test	False	
Trigger	Condition	Slightly Worn; Functioning	
	Pull	---Select---	1.5#
	Altered	True	SET SCREWS ALTERED

(PS 8187)

Remington.com -- Support

CASE #
91860 2/60 Page 1 of 1
1.5" 28"

Request a Catalog | Partners | Retail Locator | Online Help Center

PAGE 1

HOME

SAFETY

SPORTSMEN'S LIBRARY

WHAT'S NEW

PRODUCTS

COUNTRY STORE

SUPPORT

Home > Support > Repair Services

Support

Help Center

Retail Locator

Parts Information

Repair Services

Online Product

Registration

Firearm Warranty

Repair Services

-- Select Shotgun --

-- Select Centerfire --

Model 40X(RF)

Submit

Serial Number:

9896

Model: 40 X

BY: _____



RE00122984

RECEIVED
JAN 15 2007

Other Repair Information

- General Repair Form
- Factory Repair Form
- Services for Older and Other Remington Firearms
- Canadian Repair Centers
- International Repair Centers

Online Repair Progress Tracking

Now there is a quick and easy way to monitor the progress of an existing firearm repair - online, 24 hours a day, 7 days a week.

Track Your Firearm Repair Now!

Request a Catalog

Partners

Online Help Center

Retail Locator

About Us

If you cannot locate your Remington model number from the menus above, or if you need further assistance, please call our Consumer Services Department at 1-800-243-9700, Monday - Friday, 9:00AM - 5:00PM ET.

©2006 Remington Arms Company, Inc. All Rights Reserved.

Investor Relations | Other Remington Brand Products | Legal Notices | About Us

Visit Our Other Remington Websites

Other Sites

RZ model 40X - .22RF
S/N 9896

Dear Repair Dept.

When the safety is pushed to
off position gun fires. Please repair.

Thank You!

Tom Wanner
5145 Eden Ave.
Edina, MN

55436

Phone (612) 940 4263 Fax 952 929 5933

(PS 8188)

Arms Services Repair & Estimate System

Add Repair Estimate Repair Expedite Repair Inquiry Repair Tools CSR Tools Reports Table Maintenance System Maintenance Help

Repair Inquiry

Repair Number: **RE00122984** Serial: 9896 Model 40 X Rim Fire with 26 inch barrel: Caliber: 22 LR BARREL ASSEMBLY ONLY Repairman: Status: Closed 1/11/2007 8:24:18 AM

Address Information

Customer: Received From Return To: Received From
 Name: **TOM WANNER** **TOM WANNER**
 Address 1: **5145 EDEN AVE** **5145 EDEN AVE**
 Address 2: PO Box: PO Box:
 City: **EDINA** **EDINA**
 State: **MN** Zip Code: **55436** Country: **US** State: **MN** Zip Code: **55436** Country: **US**

FFL:

Contact / Condition	Problems	Estimate	History / Status	Shipping / Billing												
<p>Problems Reported</p> <table border="1"> <thead> <tr> <th>Code</th> <th>Desc</th> </tr> </thead> <tbody> <tr> <td>M123</td> <td>FORWARD TO PRODUCT SE</td> </tr> <tr> <td>M239</td> <td>REPLACE TRIGGER ASSEME</td> </tr> <tr> <td>M932</td> <td>FIRES WHEN TAKEN OFF SA</td> </tr> </tbody> </table> <p>Problems Found</p> <table border="1"> <thead> <tr> <th>Code</th> <th>Desc</th> </tr> </thead> <tbody> <tr> <td></td> <td></td> </tr> </tbody> </table>	Code	Desc	M123	FORWARD TO PRODUCT SE	M239	REPLACE TRIGGER ASSEME	M932	FIRES WHEN TAKEN OFF SA	Code	Desc			<p>Repair Notes</p>	<p>Repairman's Comments</p>		
Code	Desc															
M123	FORWARD TO PRODUCT SE															
M239	REPLACE TRIGGER ASSEME															
M932	FIRES WHEN TAKEN OFF SA															
Code	Desc															
		<p>CSR Comments</p>														

Repair Search

Refresh

Close

PS 8189

Repair Tools

Imwatson 1/17/2007 3:12 PM CAPS NUM INS SCRL
 Start 3 Micr... 3 Inte... Arms S... 3 Micr... P-touch... PS.chec... FullShot... Part Se... 2 SAP... 97% 3:12 PM

BARBER - Kinzer PPS GAL RE0007277