Remington Arms Co., Inc. **Product Service** Legal Case #:2602

Case Information

**Incident Date** Date Opened(PS) **Date Closed** RE# Obsolete **Date Opened** Pre Lit Lit 8/13/2008 148947 8/8/2008 8/13/2008

**Customer Information** 

First Name State Last Name Street City Contact Type Business Age Reporter LL Cote Sports Center LL Cote Sports 25 Main St Errol NH W 603-482-7777

Incident Information

Codes Repair Est. **Medical Treatment Medical Status** Claims

ΡI

PD Cause:4038 Could Not Duplicate Concern Unknown S

Concern:1007 Fired on Safe Release Fired on safe release

C

As received we could not get the firing pin to release unless the safety was in the ready to fire position and the trigger pulled. We did note some sticky residue on the magazine box insert but very little on the TA fls.

Firearm Information

Model/Ga. SKU Serial Bbl. **DOM** Mfg. Type 7/7mm-08 24741 S7661772 EZ Remington CF/BA 10/19/2005 8:24:07 AM

**Date Purchased** Where Purchased Accessories **Original Owner** 

ACUSPORT (OH) CORPORATION U

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/7/CF/BA

Settlement Release of Claims Release Date Reimbursement Cash Settlement Reim. Date APV Cash Date APV

Repair/Replacement Cost Repair/Replacement Date


Install new X-Mark Pro trigger assembly at n/c as gesture of goodwill fls.

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		Supry
	Exam Date		8/13/2008
	Product Type		RF
	Action Type		A
	Assigned To		Supry
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		20 inch Model 7 7mm-08
	Date Code		EZ
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Like new; Functioning	
Bolt	Firing Pin	Like new; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Like new; Functioning	
	Stop	Like new; Functioning	

<del></del>			<b>±</b>
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	True	
Locking	Block Condition	Select	]
	Lug Condition	Like new; Functioning	
	Notch Condition	Select	
Magazine	Condition	Select	
	Box Condition	Slightly Worn; Functioning	minor amout of sticky residue on outside of magazine box insert
Overall	Exterior Condition	Like new; Functioning	
	Stock Condition	Like new; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Like new; Functioning	
	Bulged	False	
Safety	Description		Model 7
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	Select	
	Notch	Like new; Functioning	·
		Condition	Like new; Functioning
Pull	Trigger	Select	4.0 lbs
Altered		False	·
Sub-Assembly		M/700 Non-Bolt Lock	

## **BARBER - Kinzer PPS GAL RE0008534**

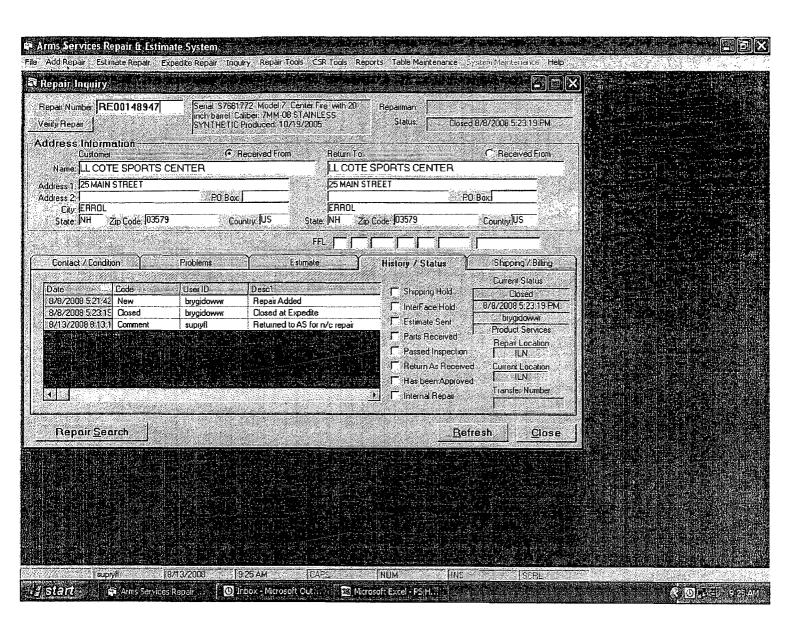

Completed RARBER F	नुनु PPS GAL RE0008535
LL Cote	

From:

Percy Tackle, Inc.

L.L. Cote 25 Main St Errol, NH 03579

To:

LL Cote Sports Center

PO Box 190 25 Main St Errol, NH 03579

Phone # 603-482-7777

#2062

57661772

148947

7/28/2008 1:46:16 PM

Page 1

Fold Here

Mail #: delivery

Clerk #: 29

Order Date: 7/27/2008

Item #: RETURNS

Remington Model 7 SST/Syn

---- Problem -----

Warranty Return on a Defective Remington Model 7 SST/Syn (new gun) #S7661772

\*Gun went off when moving safety from off to on position

Please repair or replace asap. Thank You, Dave Buckley

Remington will issue UPS Call Tag per Daniel 7/28

labor -

Could not part Doplicale concern Install new X-Mark Pro TA at MC as gestore of goodwill Change 230145 FCS 8/13/08