

Case Information

Customer Information

Incident Information

PI

PD

S	fired when it was taken off safety	Concern:1007 Fired on Safe Release	Unknown
---	------------------------------------	------------------------------------	---------

2/1

2/15/08-correspondence from repair-gun fired when it was taken off safety.lw

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial Bbl.	DOM
Remington	CF/BA	700/3006 SPR	20000	A6645953	DQ 9/20/1978
Date Purchased	Where Purchased	Accessories	Original Owner		
	OUTDOOR SPT DAYTON OH	TWO PIECE SCOPE BASE,BBL NOT OF REM MFG	U		

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Replace TA under SMP						

Repair/Replacement Cost	Repair/Replacement Date
----------------------------	----------------------------

2/15/08-quote sent to replace TA under SMP.lw

Examination[Remington/CF/BA]

<http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=2140&Type=Case>

2/18/2008

	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.009
	Notch	Like new; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	
	Pull	---Select---	2.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE SCOPE BASE,BBL NOT OF REM MFG

Arms Services Repair & Estimate System

File Add Repair Estimate Repair Expedite Repair Inquiry Repair Tools CSR Tools Reports Table Maintenance System Maintenance Help

Repair Inquiry

Repair Number: **RE00141634** Serial: **A6645953** Model: **700** Center Fire Caliber: **30.06** Produced: **09/20/1978** Repairman: **Patrick Bielanski** Status: **Repairing 2/14/2008 8:31:41 AM**

Verify Repair: ☐

Address Information

Customer: **BASS PRO SHOPS** Received From: ☒ Return To: ☐ Received From: ☐

Name: **BASS PRO SHOPS** Address 1: **7970 EAST 49TH AVENUE** Address 2: **DENVER** PO Box: City: **DENVER** State: **CO** Zip Code: **80238** Country: **US**

FFL: ☐

Contact / Condition	Problems	Estimate	History / Status	Shipping / Billing
Date: 2/13/2008 10:11	Code: New	User ID: sanguinegl	Desc1: Repair Added	Shipping Hold: ☐
Date: 2/13/2008 10:14	Code: Closed	User ID: sanguinegl	Desc1: Closed at Expedite	InterFace Hold: ☐
Date: 2/14/2008 7:40:1	Code: ReOpened	User ID: pencil	Desc1: From: Product Services	Estimate Sent: ☐
Date: 2/14/2008 7:40:2	Code: Expedite	User ID: pencil	Desc1: Estimate Update	Parts Received: ☐
Date: 2/14/2008 8:31:4	Code: Estimate	User ID: bielanskp	Desc1: Estimate Update	Passed Inspection: ☐
Date: 2/14/2008 8:33:2	Code: Estimate	User ID: bielanskp	Desc1: Estimate Update	Return As Received: ☐
				Has been Approved: ☐
				Internal Repair: ☐

Current Status

Repairing: **2/14/2008 8:31:41 AM**

Repair Bench: **bielanskp**

Repair Location: **ILN**

Current Location: **ILN**

Transfer Number:

Repair Search Refresh Close

supryll 2/14/2008 9:27 AM CAPS NUM INS SRL

start Inbox - Microsoft Outlook Arms Services Repair Microsoft Excel Port Security Watch...

Belt lock mod. Reaction program repair
not being test fired due to non-Remington
barrel on rifle. will be bench tested
and final tested at Arms Service.

Customer stated that gun fired when it was taken off safety. Please contact Robert Longone, service writer/gunsmith for payment. (720)385-3674.

2140

.009
DQ 9/78
24" Not Rem.
2.5#

Serial Number: **A6645953**

Model: **700**



RE00141634

BBL. not of rem. mfg.
could not duplicate concern
mfg-set screws altered.
Replace TPA, check over, clean
under BOLT LOCK program.
Con \$20.00 + S+H.

(DO NOT TEST)

ORIGIN ID: BKFA (720)385-3600
Mike Wilkins
Bass Pro Main Office
7970 East 49th Avenue

Ship Date: 05FEB08
ActWgt: 8 LB
System#: 1382491/INET8011
Account: S *****

Denver, CO 80238
UNITED STATES US

Remington Arms Co. Att: Arms Service 800-243-9700

FedEx
Express


14 HOEFLER AVE

ILION, NY 133571816



Ref: 02562110006533001
INV:
PD: 328322 1-30-08

Dept:

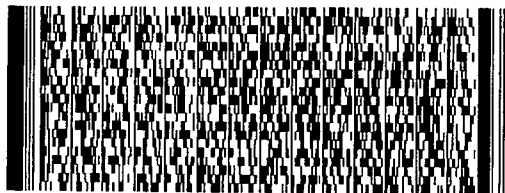

Delivery Address
Barcode

BILL SENDER

TRK# 7920 0039 7847
0201


THU - 07FEB

AA

** 2DAY **
DSR

133571816
NY-US
SYR

SG UCAA

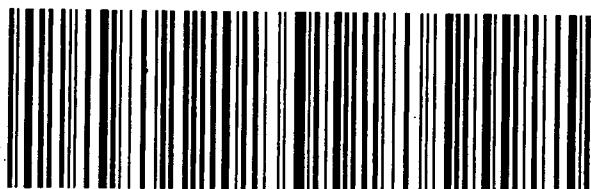

Part # 156297-435 RIT 08/07