First Name

Remington Arms Co., Inc. Product Service Legal Case #:2660

Case Information

RE# **Date Opened**

Business

Date Opened(PS)

Date Closed

Incident Date

Pre Lit Obsolete

150381

9/4/2008

9/5/2008

9/5/2008

Street

City State Zip Age Contact

Reporter Gander Mountain

Last Name

Gun Parts Dept 8635 Clinton St New Hartford NY 13413

W 651-325-4300, K. Nadeau

Incident

Type

Incident Information

Customer Information

Claims

Codes

Repair Est.

Medical Treatment

Medical Status

PΙ

PD

Cause:4015 Improper Maintenance

S fired on safe release Concern:1007 Fired on Safe Release

Unknown

C

Customer states the onece safety is off the firing pin drops.

Firearm Information

Mfg.

Type

Model/Ga.

SKU

Serial Bbl.

DOM

Remington

CF/BA

700/270 WIN

25939

1/16/2003 2:39:50 F6251503 BX

PM

Date Purchased

Where Purchased

Accessories

Original Owner

WAL-MART DC 6003R-REGULAR

TWO PIECE SCOPE BASE, GUN SOCK

U

CONCERN: FBC

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement

Release Date

Reimbursement Cash Settlement Reim. Date APV Cash Date APV

Repair/Replacement Cost Repair/Replacement Date

65.00

Release of Claims


9/5/2008

9/5/2008 returned to AS for n/c repair - clean and install new TA fls.

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date]	9/5/2008
	Product Type]	RF
	Action Type]	A
	Assigned To		F.SUPRY
Cause	4015	Improper Maintenance	TRIG ASSM SET SCREWS ALTERED
Barrel	Description]	22" 270 WIN
	Date Code		BX
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	

In	II	A	
· .	Shroud	Slightly Worn; Functioning	·
Bolt	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
Extractor	Stop	Slightly Worn; Functioning	<u>.</u>
	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
Locking	Ext/Eject Test	False	
	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	
Overall	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
D	Fore End Condition	Select	
	Condition	Slightly Worn; Functioning	
Receiver Safety	Bulged	False	
	Description]	STANDARD M/700 SAFETY
	Function	Like new; Functioning	
Sear	Sub-Assembly	ISS	
	Lift	Select	N/A
	Notch	Like new; Functioning	
	Tests	Test Fired	False
Feeding Test	Tests	False	
	Condition	Slightly Worn; Not Functioning	TRIGGER RUSTED,SEIZED
Trigger	Pull	Select	N/A
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Non-Bolt Lock	
Non-Remington Components	Description		TWO PIECE SCOPE BASE,GUN SOCK

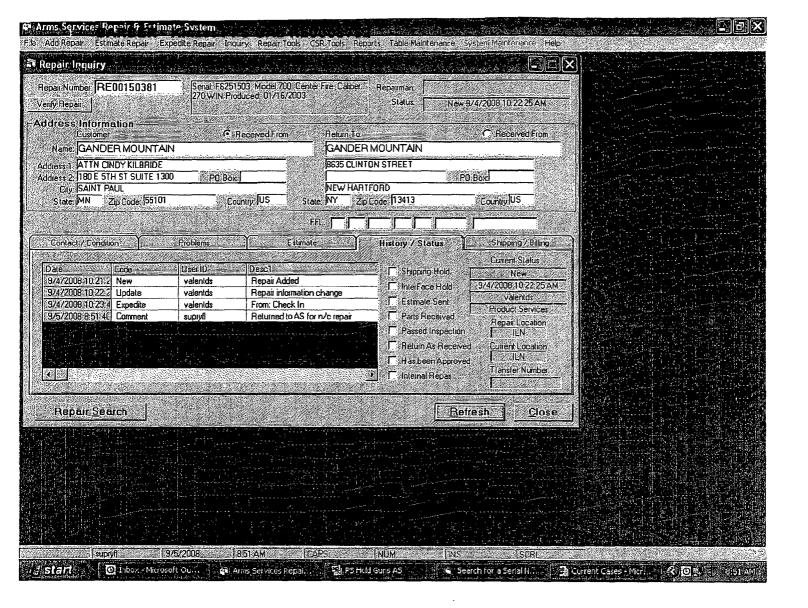

BARBER - Kinzer PPS GAL RE0008753



2660

Service Request Service Order # 2207

ZZ"

SHIPPED TO VENDOR/STORE:

REMINGTON ARMS
14 Hoefler Ave

Illion, NY 13357

Attn:

Date Shipped: 08/28/2008

Phone: (800) 243-9700

RETURN SHIP TO:

Gander Mountain, FFL# 6-16-065-01-0H-00910

Attn: Gun Parts Dept. 8635 Clinton Street

New Hartford, NY 13413

FIREARM INFORMATION:

Manufacturer: Remington Arms Co Inc.

Type:

Rifle

Serial Number: F6251503

Cased?:

Model:

700

Cal/Ga.: .270cal

DESCRIPTION OF ITEM RETURNED:

Rem 700 270 rifle - bolt action. Ser #F6251503. Like new condition

REASON FOR RETURN:

Customer wants trigger assembly checked. Says once safety is off the the firing pin drops. Safety check

ATTENTION VENDOR

Please contact me with any questions or concerns.

Kelly Nadeau (651) 325-4300

BILLING INFORMATION:

Please include the service order number on all invoices and correspondence:

SHIP TO ABOVE ADDRESS

Forward all invoices to:

Gander Mountain

Attn: Cindy Kilbride

180 E. Fifth Street Suite 1300

St. Paul, MN 55101

Trig. set screws Altered

Trig. + Trig. pin rusted And

Seized. Replace TPA, check

oven, elean at 14/c

230145

