Remington Arms Co., Inc. **Product Service** Legal Case #:3454

Case Information

RE# Date Opened(PS) Date Closed Incident Date Pre Lit Lit Obsolete **Date Opened** 167162 4/29/2009 4/30/2009 4/30/2009

**Customer Information** 

First Type **Business Last Name** Street City State Zip Age Contact Name 9263 Crane Mihalak's Mihalak's W 814-756-Reporter Cranesville PA 16410 Rd. Guns Guns 4092

Incident Information

Repair Medical Medical Claims Codes Est. Treatment Status

PΙ

والملكوج

PD Could Not Duplicate

Cause: 4038 Concern Unknown Fired on Safe

release Concern:1007 Fired on Safe Release

Dealer reported - Rifle has fired twice when the safety was pushed forward to fire with no fingers on the trigger.

Firearm Information

SKU Serial Bbl. DOM Mfq. Type Model/Ga. Remington CF/BA 700/2506 REM 6326827 CT 4/1/1970 Original Date Where Purchased Accessories Owner Purchased

**ROSKIN BROS MIDDLETOWN** TWO PIECE SCOPE

NY

BASE

U

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Reim. Cash Reimbursement Settlement **Settlement** Release of Claims **Release Date** Date **Date APV** APV

Repair at special price under **BLSM** program

Repair/Replacement Repair/Replacement

Cost **Date** 

\$47.38

5/4/2009


5/4/09: Per Fred S. - Could not duplicate concern. Trigger set screws altered, Trigger assembly very dirty. Replace trigger assembly, check over, clean under BLSM. dmf

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		4/30/2009
	Product Type		. RF

l		╡	
	Action Type	_	Α
	Assigned To	_	F.SUPRY
Cause	4038	Could Not Duplicate Concern	
	Description		24" 2506 REM
	Date Code		СТ
	Bore Plugged	False	
  Barrel	Bulged	False	
Darrer	Fired	False	
	Fired while Obstructed	d	
	Muzzle/Crown Condition	Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	DIRTY/STICKY
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Worn; Functioning	
Overall	Stock Condition	Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Lift	Select	.010
Sear	Notch	Slightly Worn; Functioning	
	Tosts	Test Fired	False
Feeding Test	Tests	False	
	Condition	Slightly Worn; Functioning	DIRTY
Trigger	Pull	Select	2.5#
- u	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE SCOPE BASE

## **BARBER - Kinzer PPS GAL RE0009002**

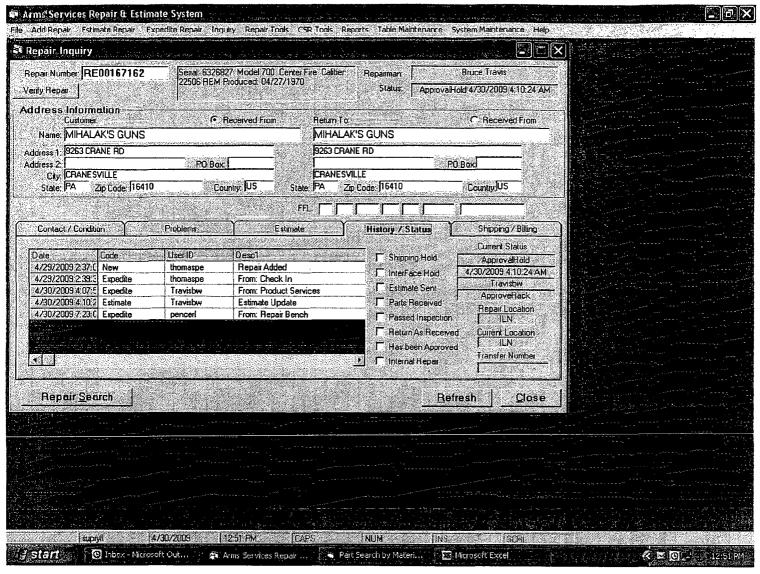

3454



## BARBER - Kinzer PPS GAL RE0009003 9263 Crane Road CRANESVILLE, PA 16410 4-23-09 SUBJECT REMING TOW (814) 756-4092 TO TOU ADL ARMS SERVICE REMINGTON ARMS CO. SER# 6326827 14 HOEFLER AVE CA-25-06 ILION, N.Y. 1335.7 REPAIR DEPT 8 THIS RIFLE HAS FIRED (TWICE) WHEN THE SAFETY WAS PULLED FORWARD TO WITH NO FINGELS ON THE TRIGGER.

6326827
Model: 700
RE00167162

PLEASE REPLY

TRIGSET SCREWS Altered
TRIGSET SCREWS Altered
TRIG ASSM VERY direty.

Rephalice TPA, check onen,

Elenwounder bolt Lock

1110 9840 on Con \$ 20.00

Quote

## U.S. Department of Alcohol, Tobacco, Firearms and Explosives

## **Federal Firearms License** (18 U.S.C. Chapter 44)

In accordance with the provisions of Title I, Gun Control Act of 1968, and the regulations issued thereunder (27 CFR Part 478), you are licensed to engage in the business specified in this license, within the limitations of Chapter 44, Title 18, United States Code, and the regulations issued the regulations is sued the regulations. shown. See "WARNINGS" and "NOTICES" on reverse. ATF - Chief, FFLC Direct ATF 8-25-049-01-1L-08103 2600 Century Parkway, NE Strite Correspondence To Atlanta, Georgia 30345-3/104 Chief, Federal Firearms Licensing Center (FFLIC November 1, 2011 Date MIHALAKS GUNS Premises Address (Changes? Notify the FFLC at leas RD 1 9263 CRANE RD CRANESVILLE, PA 16410-0000 Purchasing Certification Statement.

The licensee named above shall use a copy of this licensee to assist a transferor of firearms to verify the identity and the licensed status of the licensee as provided by Mailing Address (Changes) Notify the FFLC of any changes.) 27 CFR Part 478. The signature on each convenuate be an original signature. A faxed, scanned or e-mailed copy of the license with a signature intended to be an original signature is acceptable. The signature must be intended to be an original signature or a responsible person of the FFL—teorita that his is a true copy of a license issued to the licensee named spove to engage Licensee/Responsible Person Signature J. MIHUC ATF Form 8 (5310.11) Printed Name Revised December 2007 Previous Edition is Obsolete