PrintDisplay BARBER - Kinzer PPS GAL RE 0009619

Remington Arms Co., Inc. Product Service Legal Case #:4785

•	T. C.	
Lase	Inform	tation

RE# Date Opened Date Opened(PS) Date Closed Incident Date Pre Lit Lit Obsolete 205991 10/12/2010 10/13/2010 10/13/2010 X

Customer Information

Business First Name Last Name Street City State Type Zip Age Contact 2001 Dona Ana Rd. SW Deming Incident Ray Trejo NM 88030 H 575-494-5507

Incident Information

Claims Codes Repair Medical Medical Est. Treatment Status

ΡI

PD Cause: 4038 Could Not Duplicate Concern

S Concern 1025 Unexplained Discharge - No Mention of Safety Unknown

Gun fired Concern: 1023 Position

accidentally

Customer wrote in a note - He is sending us this rifle to repair. The gun went off accidentally. dmf

Firearm Information

Mfg. Model/Ga. SKU Bbl. DOM Type Serial CF/BA 600/243 WIN 65960 PN 6/1/1966 Remington n/a **Original Owner Date Purchased** Where Purchased Accessories

U

CONCERN: GONE OFF ACCIDENTLY

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/600/CF/BA

Settlement Release of Claims Release Date Reimbursement Cash Reim. Date Cash Date
Settlement APV APV

Per Ilion - Repair @

n/c

Repair/Replacement Cost Repair/Replacement Date

\$43.48 10/20/2010

10/20/10: Per Fred S. - Could not duplicate concern. Replace tpa under recall. Safety check, test fire at n/c. dmf


Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		10/13/2010
Examination	Product Type		RF .
	Action Type		A
	Assigned To		F.SUPRY
Cause	4038	Could Not Duplicate Concern	O/S TPA
Barrel	Description		18.5" 243 WIN
	Date Code		PN
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=4785&Type=Case

10/20/2010

1	Muzzle/Crown Condition	Slightly Worn; Functioning	1
Bolt	Firing Pin	Slightly Worn; Functioning	=
	Shroud	Slightly Worn; Functioning	=
	Face	Slightly Worn; Functioning	=
	Handle	Slightly Worn; Functioning	7
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False .	
Locking	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	
C-C-L.	Description		STANDARD M/600 BOLT LOCK SAFETY
Safety	Function	Like new; Functioning	
	Lift	Select	N/A
Sear	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	
	Pull	Select	3#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	Other Remington	•

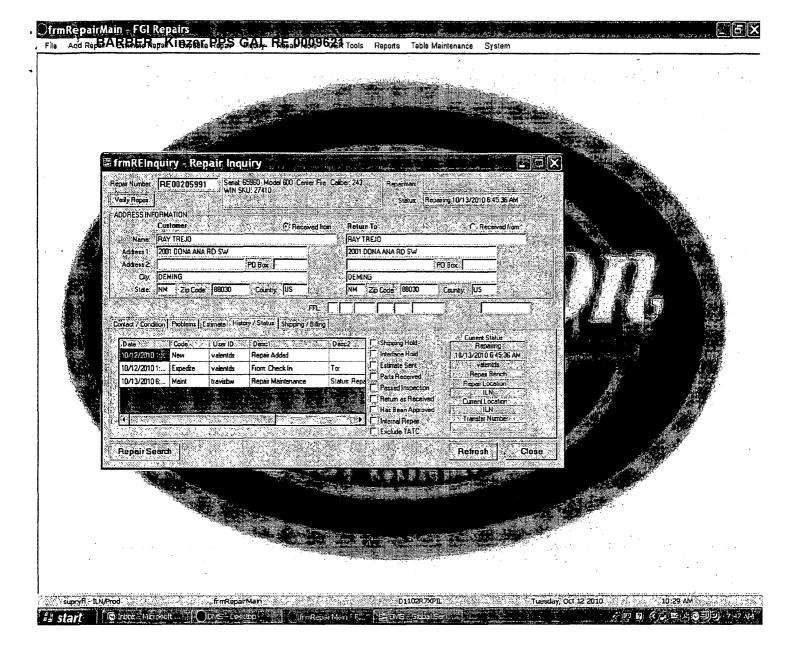

<u> </u>	ZC'	E	辽	VI 2010	
Ŋ	OCT	1	4	2010	الل
В	Y:				

4785

18.5°1

Dear Remington,

I am sending you this model 600 to you for a repair on the trigger. This gun has gone off accidently. Thank you for returning this back to me asap... My grandchildren have a hunt at the end of this month.

Thank you,

Ray

Return Address:

Ray Trejo 2001 Dona Ana RD. SW Deming, NM 88030 575-494-5507



replace TPA UNDER NECA 11.

SALLY CLECK& TRUTFINE AT

H/C #230145