Remington Arms Co., Inc. Product Service

Legal Case #:4987

Case Information

Incident Date RE# **Date Opened** Date Opened(PS) **Date Closed** Pre Lit Lit Obsolete

11/5/2010 12/7/2010 212971 12/6/2010

Customer Information

Business First Name Last Name Street City State Zip Contact Type Age

4 Wayne Dr Jeff 29687 C 864-238-8325 Incident Ouzts **Taylors** SC

Incident Information

Repair Est. Medical Treatment Medical Status Claims Codes

ы

PD

Could Not Duplicate Concern

Fired on bolt S closing

Concern:1008 Fired on Bolt Closing

Unknown

C

11/5/10 Per call from Ouzts, he saw the CNBC program and he has had his 700 fire twice when closing the bolt. He bought it from his grandad and is not sure if he was the original owner or not.cm

Firearm Information

Mfg. Remington

Type CF/BA

Model/Ga. 700/243 WIN

SKU n/a

Serial Bbl. DOM 6570709 PW 6/1/1972

Date

Where Purchased

Accessories

Original Owner

Purchased

SULLIVAN HDWE ANDERSON SC

SCOPE, SEE THRU RING **MOUNTS**

N

CONCERN: WILL GO OFF WITHOUT TOUCHING IT

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Settlement

Release of Claims

Release Date

Reimbursement

Cash Settlement Reim. Date

APV

Cash Date APV

Per Ilion, replace trigger assm, clean at BLSM program price

Repair/Replacement

Repair/Replacement

Cost

Date

40.23

12/10/2010

11/5/10 Mailing ARS.cm 12/12/10 Per Ilion, could not duplicate concern. Trigger assm is very dirty. Replace TPA, clean and test fire under BLSM program price of \$20 + shipping.cm 12/14/10 Spoke with Ouzts, he approved replacing the trigger and the \$37 charge. He can replace the barrel himself and asked that we remove that from the estimate.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner	B.TRAVIS	
	Exam Date		12/7/2010


http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=4987&Type=Case

12/14/2010

٠,٠	Product Type	<u></u>	RF
Examination	Action Type	Ī	A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	POOR MAINTENENCE
	Description		22" 243 WIN
Barrel	Date Code	Ī	PW
	Bore Plugged	False	
	Bulged	False	
Barrer	Fired	False	
	Fired while Obstructed		•
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	·
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
Receive	Bulged	False	
	Description		STANDARD M/700 BOLT LOCK SAFETY
Safety	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
	Lift	Select	N/A, SCOPE MOUNTED
Sear	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	
	Pull	Select	5.5#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		SCOPE,SEE THRU RING MOUNTS

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=4987&Type=Case

12/14/2010

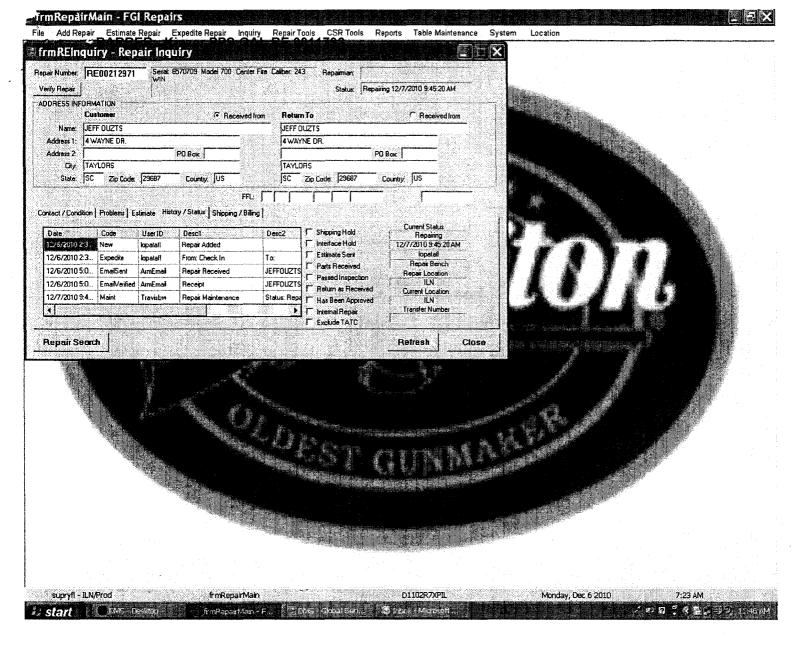

REDACTED

'297 DEC - 8 2010 D

5/11

Model Number: 700 Are you the original owner?: YES NO Name: Jeff Ouzts	slatinament 65	70709	
Name: Jeff Ouzts			
	Date of Purchase:	2008	
Address (no PO Boxes): 4 Wayne	Drive		
city: Taylors	State: 5C	zip: 129687	,
Phone (Daytime): 338-8325 (8	(64) Fax:		
E-mail Address:(if e-mail address is provided, notifi	cation of receipt and shipment w	rill be	
sent) Jeffourts@att.no	<u>e</u>	·	
E-mail Address:			
I would like to receive future e-mail updates from			
Please describe your problem and date of occurr		·	
When bullet is in	Pipe que w	sill go	34
When bullet is in off without tour	china it i	Ralt is	:
down safety is o		- 00	· ·.
34.619 13	in our will	go off.	
			÷1
500			لنث
Ammunition Information:			
Manufacturer: Reminqton	Type: 243		
Other (i.e. bullet weight/type, shot size, powder):	, v	*	
	:		
Handload Information:			
Powder Used:	19 aug-19ht:		
Case/Hull Used:	Pilitar Vecck		
Odden lun Odde.	prainted OSector		
Bullet Type/Shot Size:	Raioan Viseda		
	We for		

BARBER - Kinzer PPS GAL RE 001179

22"
PW 45

6/987

November 5, 2010

Jeff Ouzts 4 Wayne Dr Taylors, SC 29687

Subject: #4987, Model 700

Dear Mr. Ouzts,

Per our phone conversation, enclosed is a prepaid UPS ground shipping label for shipment of the firearm to our factory for inspection. Please include a copy of this letter with the firearm. The letter inside is important as sometimes the outside label gets damaged in transit and we want to be sure the firearm is logged in correctly. Please mark the ends of the box with "Product Service".

I apologize for the inconvenience that this incident has caused and I hope that these actions will keep you as a loyal Remington customer.

Sincerely,

Christy Mitchell Consumer Affairs Administrator Phone: 800-243-9700, ext 8684 christy.mitchell@remington.com

enclosure



could not duplicate concern. T.A. is very dirty. Replice TPA, clean + Trit Rine under BLP for # 10.00 + ship

Quote

Remington Arms Company, Inc. • 870 Remington Drive • P.O. Box 700 • Madison, NC 27025 Phone 800-243-9700 • www.remington.com



Remington Arms Company, Inc. 870 Remington Drive P. O. Box 700 Madison, NC 27025-0700

ARS LABEL REQUEST FORM

DATE:	11/5/	2010 REQUESTED BY:	christy	
QUANTITY:	1	WEIGHT PER PACK	AGE:	10
REASEICHECKONES MEDIA COORDINATOR			xxxxx	
TO MAIL		I WILL MAIL		
DESCRIPTION:				
Mode	1 700			

LABEL INFORMATION

MAIL LABEL TO:	Jeff Ouzts		
	4 Wayne Dr		
	Taylors, SC 29687		
RETURN ITEM TO	: Rem Product Service		

APLEASE COMPLETE ALL PARTS OF THIS EORM AND SEND TO THE MEDIA COORDINATION AND A COORDINATION OF THE MEDIA COORDINATION OF THE COORDINATION OF THE MEDIA COORDINATION OF THE M

4XX596 NOV 5, 2010 ALL CURR USD 1 OF 1 SVC GNDCOM ACT WT 10.0 LBS TRACKING 1Z4XX5969066500455 REF 1.JEFF OUZTS/CD/CM REF Z:760

HANDLING CHARGE 0.00 STNGLE-PIECE PUB RATE CHRGS: SVC 1/P USD CV 0.00 COD 0 00 RS 0.50 DC 0 00 DGD 0.00 SD 0.00 AH 0.00 PR 0.00 SP 0.00 TOT PUB CHC 8.74

