BARBER - Kinzer PPS GAL RE 0013596

Remington Arms Co., Inc.
Product Service

Legal Case #:5094

Case Information

 RE#
 Date Opened
 Date Opened(PS)
 Date Closed
 Incident Date
 Pre Lit
 Lit
 Obsolete

 214023
 12/13/2010
 11/15/2010
 12/14/2010

Customer Information

Type Business First Name Last Name Street City State Zip Age Contact 2825 Hanover St Kline Dallas TX 75225 H 214-648-7820 Incident Kevin

Incident Information

Claims Codes Repair Est. Medical Medical Treatment Status

ΡI

PD Cause:4038 Could Not Duplicate

Fires when pressure on trigger and Cause.4038 Concern Unknown

S removing safety Concern:1007 Fired on Safe Release

C

11/15/10 Per call from Kline, he has a CDL SF 30-06 he bought in 2008 and it has the X-Mark Pro. He adjusted the trigger to 3 1/2 lbs. He had a accidental discharge. Any pressure on the trigger when safety is released and it fires.cm

Firearm Information

Mfg. Type Model/Ga. SKU Serial Bbl. DOM

Remington CF/BA 700/30-06 SPR n/a S6597736 LB 2/13/2007 11:00:39 PM

Date Purchased Where Purchased Accessories Original Owner

6/20/2007 WILLIAMS SHOOTERS SUPPLY TWO PIECE SCOPE BASE Y

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement Release of Claims Release Date Reimbursement Cash Reim. Date APV APV

Per Ilion, replace TPA, clean and test at 1/2 normal cost

Repair/Replacement Repair/Replacement Cost Date

63.42 12/20/2010

11/15/10 Mailing ARS.cm 12/16/10 Left voice message for Kline with inspection info and quote. Awaiting reply.cm 12/20/10 Per Ilion, could not duplicate concern. Trig assm screw altered. Trigger has min return. Replace TPA, clean and test fire at 1/2 normal cost.cm


Examination[Remington/CF/BA]


Part -	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		12/14/2010
Examination	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
	Description		3006 SPR
	Date Code		LB
Barrel	Bore Plugged	False	
	Bulged	False	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=5094&Type=Case

12/21/2010

BARBER - Kinzer PPS	Fired	False	1
,	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Slightly Worn; Functioning	
Joil	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	· ·
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
Sooking	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	SCRATCHES/MARS
	Fore End Condition	Select	
	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	
	Description		STANDARD XMP SAFETY
Safety	Function	Like new; Functioning	
·	Sub-Assembly	Non-ISS	
	Lift	Select	.010
Sear	Notch	Like new; Functioning	
	T	Test Fired	False
Feeding Test	Tests	False	
	Condition	Like new; Functioning	
r	Pull	Select	2.2#
Trigger	Altered	True	PULL SCREW ALTERED
	Sub-Assembly	X-Mark Pro	
Non-Remington Components	Description		TWO PIECE SCOPE BASE

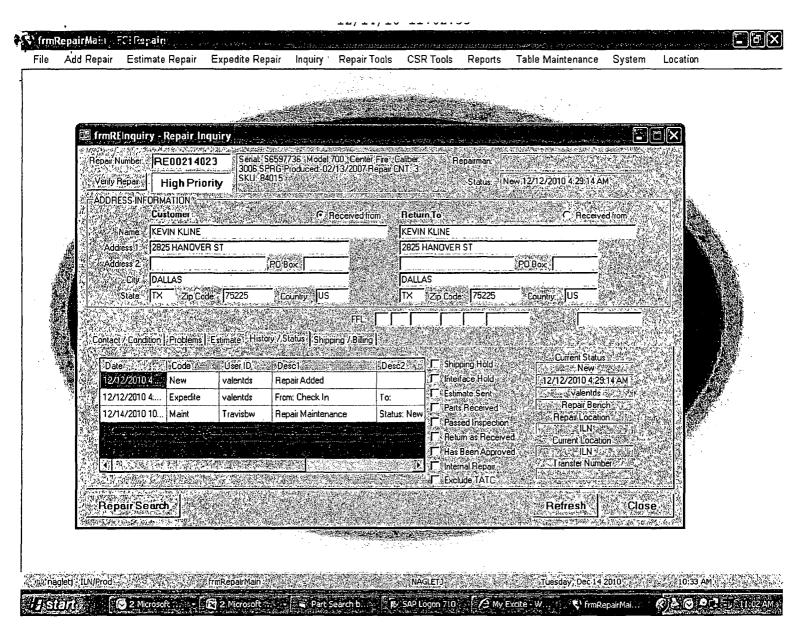



BARBER - Kinzer PPS GAL PORTINGTON®

5094

November 15, 2010

Kevin Kline 2825 Hanover St Dallas, TX 75225

Subject: #5094, Model 700

Dear Mr. Kline,

Per our phone conversation, enclosed is a UPS ground prepaid shipping label. Please include a copy of this letter with the firearm. The letter inside is important as sometimes the outside label gets damaged in transit and we want to be sure the firearm is logged in correctly. Please mark the ends of the box with "Product Service".

I apologize for the inconvenience that this incident has caused and I hope that these actions will keep you as a loyal Remington customer.

27 . 21.42

Sincerely,

Christy Mitchell
Consumer Affairs Administrator
Phone: 800-243-9700, ext 8684
christy.mitchell@remington.com

enclosure



could not deplicate concern.

TA, set Screw Altered. Trig.

HAS MIN NETURN. Replace TPA,

CLEAN+ TEST Rine AT 1/2

NORMA (LOST.

Quote

Remington Arms Company, Inc. • 870 Remington Drive • P.O. Box 700 • Madison, NC 27025 Phone 800-243-9700 • www.remington.com NOTE: Please complete and print this form, and then include it with your firearm.

Model Number: 700 CDL	Serial Number: 56597736
Are you the original owner?: YES NO	
Name: Kerin Klein >	Date of Purchase: 6/20/2007
Address (no PO Boxes): 2825 Hanove	rst.
city: Dallas	State: 1X Zip: 75225
Phone (Daytime): 214-893-0396	Fax: 214-648-7660
E-mail Address: (if e-mail address is provided, notification sent) Kevin Kleinmd egmail.	
E-mail Address:	
I would like to receive future e-mail updates from Rem	nington.
Please describe your problem and date of occurrence:	
My trigger will often go safety is released and	
I would like a newer x	•
pro that is externally	
like a pull of 31/2 pour	nds The current trigger
Thank you K arriv	nds The current trigger red with a pull of 1/2 pounds
500 1 Mac	the adjusted by a
Ammunition Information:	57710New(
Manufacturer:	Type:
Other (i.e. bullet weight/type, shot size, powder):	
Handload Information:	
Powder Used:	Powder Weight:
Case/Hull Used:	Primer Used:
Bullet Type/Shot Size:	Reloader Used:

BARBER - Kinzer PPS GAL RE 0013601

Firearms Care (Cleaning and Lubrication):
Brand of cleaning solution used:
How often do you clean the bore? (Months or Number of rounds)
How often do you clean the action? (Months or Number of rounds) After hunting, wipe off
How often do you clean the trigger assembly? (Months or Number of rounds)
Brand of lubricant used: Ram oil
How often do you lubricate the bore? (Months or Number of rounds)
How often do you lubricate the action? (Months or Number of rounds)
How often do you lubricate the trigger assembly? (Months or Number of rounds)
Have you reviewed the cleaning and maintenance recommendations on our web site or in our owners manual? YES NO
When was the last time that your firearm was serviced by a Remington authorized repairman/gunsmith?) 7/14/2007
What were the services performed?) Trigger assembly replaced
Remington Arms Co., Inc. Attn: Arms Service Division 14 Hoefler Avenue Ilion, NY 13357
⊕WARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND SERIAL NUMBER OF YOUR FIREARM.
:: Record the serial number of your firearm before sending it. :: Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.) :: Remove all accessories from your firearm to prevent loss or damage. :: Provide a return address on both the outside and inside the box. Shipments without a proper return address will be refused.

Madison, inc 21020 0.00

Parts/Repairs 800-243-9700

www.remington.com info@remington.com

Fax

BARBER - Kinder PPS IGAL RE 0013602

REPAIR

REPAIR

7/19/2007

DOCUMENT

DOCUMENT

Repair Order Number	Description/Seria! Number	Date Received -	7/16/2007
DECOMARAGO	0.00000	T 41 4 70 4	

RE00131309 S6597736 Estimate Date -

Account # - R-Current Date -Model 700 Center Fire Caliber: 3006

SPRG CDL SS FL BBL

Customer Return To KEVIN KLEIN KEVIN KLEIN

2825 HANOVER STREET 2825 HANOVER STREET

DALLAS. TX 75225 US DALLAS. TX 75225 US

(214)-648-7820 (214)-648-7660 Phone (H) Fax

Email KLEINHOUSE@CHARTERNET Phone (W)

Reported	Problems Found A.	3
M101 ACCURACY	M178 TRIG ADJ SCREWS RESET, CANNOT R	
	·	l
	·	-

Technician's Comments

Condition **ProblemNotes**

or and state of the transfer of the second state of the second sta

NOTE - At target rifle shot to point of aim and put three shots in the same hole at 50 yds.

No fault found with receiver scope base holes. We mounted Weaver rings and bases with a Bushnell scope. Bore sighted with plenty of adjustment for both windage and elevation. Rifle will be targeted for

group and point of impact.

Material #	Material Description	Quantity	Warranty (Y/N)
Part			
F305571	700 X-MARK PRO TRIG ASSB RH SILVER	1	N
Part	Total:	1	
Service			
4000104	ARMS SERV SHIPPING & HANDLING	0	Y
4000119	GR-TEST	1	Y
4000120	GR-TARGET	1	Y
4000294	GR-CHECK TPA	١	Y
Service	Total:	3	

Supplied the state of the state

INVOICE - repeat printout

BARBER - Kinzer PPS GAL RE 0013603 ington Arms Company, Inc.
870 REMINGTON DRIVE

dington Arms Company, Inc 870 REMINGTON DRIVE P.O. BOX 700 MADISON, NC 27025-0700 UNITED STATES www.remington.com

104# 51-0380938 1104473070170 113601309R 1431-148911094RT

ACCT. NO.	INVOICE NO.	INVOICE DATE
COD	41596370	07/19/2007

BHI 10:

KEVIN KLEIN

2825 HANOVER STREET DALLAS TX 75225

SHIP TO:

KEVIN KLEIN

2825 HANOVER STREET DALLAS TX 75225

PURICHASE ORDER NO.	P.O. DATE	OHDLE NO.	NECHO STAC	DELIVERY NO.	DELV. DATE	DELIVERY TERMS	GROSS WEIGHT
In.00131309	07/19/2007	855013	07/19/2007	81505285	07/19/2007	PPA	0 L8
CARRIER		Taki	OF LABING	91 November 21801		L color IIII color	

CARRIER BILL OF LADING PRO NUMBER FEENUMBER

ITEM NO:	DESCRIPTION	SHIP QTY.	UNIT	PROGRAM PRICE	EXT PRICE
F305571	700 X-MARK PRO TRIG ASSB RH SILVER	1	ĒΑ	45.0000	45.00

Items total

45.00

Tax State Level

6.250 %

45.00

2.81

Tax City Level

2,000 %

45.00

0.90

CURRENCY CODE: USD

TOTAL INVOICE AMOUNT:

48.71 USD

CUST. SERV. REP: CONSUMER

PH: 1-800-243-9700 FAX: 336-548-7801

Email: info@remington.com

TERMS:

NET 30 DAYS

PAY

48.71 IN FULL BY 08/18/2007

EXCEPT WHERE PROHIBITED BY LAW, PAST DUE ACCOUNTS ARE SUBJECT TO A SERVICE AND INTEREST CHARGE OF 1.5% PER MONTH OR MAXIMUM AMOUNT ALLOWED BY LAW, WHICHEVER IS LESS. RETURNED MERCHANDISE NOT ACCEPTED WITHOUT HETURN AUTHORIZATION FHOM CUSTOMER SERVICE. CLAIMS FOR SHORTAGE OR DAMAGE ARE CONTROLLED BY THE REMINGTON ARMS STANDARD CONDITIONS OF SALE.

IMPORTANT - PLEASE CUT ALONG DOTTED LINE AND RETURN TO ASSURE PROPER CREDIT TO YOUR ACCOUNT. IF AMOUNT SHOWN REPRESENTS A CREDIT(CR) BALANCE, IT WILL BE CREDITED TO YOUR ACCOUNT.

ACCTS. REC. NO.	INVOICE/DEBIT/CREDIT MEMO NO.	INVOICE DATE	INVOICE DUE DATE	INVOICE AMOUNT
COD	41596370	07/19/2007	08/18/2007	48.71

REMIT TO:

Remington Arms Co, Inc.

PO BOX 503810

SAINT LOUIS MO 63150-3810

D-U-N-S No. 00-145-3216

STATEMENT OF AND SUBJECT TO THE APPLICABLE REMINGTON ARMS CUSTOMER AGREEMENTS AND STANDARD CONDITIONS OF SALE. COPY AVAILABLE UPON REQUEST.

PG 1 OF



Remington Arms Company, Inc. 870 Remington Drive P. O. Box 700 Madison, NC 27025-0700

ARS LABEL REQUEST FORM

DATE: 11/1	5/2010 REQUESTED BY:	christy	
QUANTITY:	1 WEIGHT PER PACKAG	iE:	10
PUEASE CHECKONE:			
MEDIA		XXXXXX	
COORDINATOR			
TO MAIL	I WILL MAIL		
DESCRIPTION:	•		
	700		

LABEL INFORMATION

MAIL LABEL TO:	Kevin Kline	
]	2825 Hanover St	
	Dallas, TX 75225	
RETURN ITEM TO	:	
	Rem Prod Serv Ilion, NY	
L		


```
4XX596 NOV 15, 2010 ALL CURR USD 1 OF 1
SVC GNDCOM ACT UT 10.0 LBS
TRACKING# 1Z4XX5969065123221
REF 1:KEVIN KLINE/CD/CM
REF 2:700

HANDLING CHARGE 0.00
SINGLE-PIECE PUB RATE CHRGS: SVC T/P USD
DV 0.00 COD 0.00 RS 0.50
DC 0.00 DGD 0.00 SD 0.00
AH 0.00 PR 0.00 SP 0.00
TOT PUB CHG 9.45 PUB+HANDLING 9.45
```

