

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST RING ROAD ELIZABETHTOWN, KY 42701

Remington Arms Company, Inc.

Test Report – Trial & Pilot Test

M/710 Centerfire

Rifle

.30-06 Springfield

(PART A)

January 2001

Distribution List:

Bristol, R

Diaz, D.D.

Danner, D.R.

Golemboski, M.

Keeney, M.


Franz, S.R.

File

Page 1

CONFIDENTIAL

to a mar term

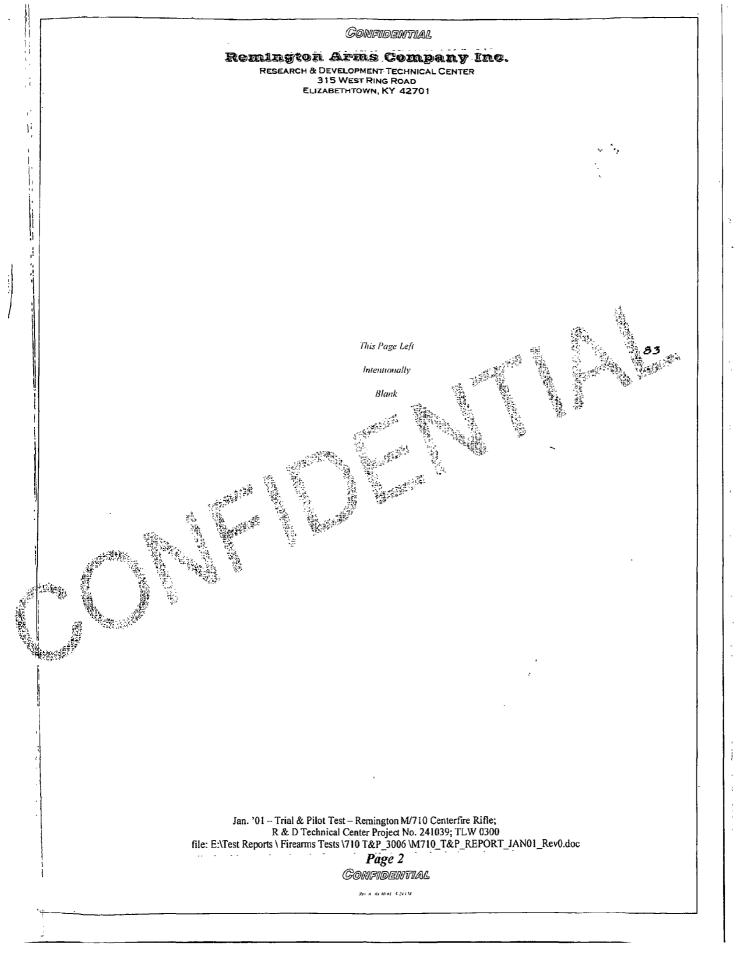

Reminston Arms Company Inc.
RESEARCH & DEVELOPMENT TECHNICAL CENTER
315 WEST RING ROAD
ELIZABETHTOWN, KY 42701

PART A

ABST	TRACT:	5
INTR	ODUCTION	6
1.0 PU	JRPOSE & SCOPE OF TEST PROGRAM	7
1.1	PURPOSE	7
1.2	SCOPE	
2.0	EXECUTIVE SUMMARY	7
2.1		9
	TEST SUMMARY TABLE T&P SUMMARY – (DETAILED)	12
3.0	T&P SUMMARY – (DETAILED)	. 13
3.1	INITIAL INSPECTIONS, TESTS & MEASUREMENTS	13
3.1.1	Visual Examination, Packaging Audit & Packaging Test	13
	2.1.1. TINO2004 (TRIP and SCOT) William 1970	12
	3.1.1.2 TLW0300B – Packaging Audit	14
	(1xP Series "A") - performer by marketing as specified by the test plan.	14
	3.1.1.3 TLW0300C Packaging Test Headspace and Proof	15
3.1.2	Headspace and Proof	16
	23:22 TLW0300E Measure Headspace	16
. 189 189 188	3.1.2.2 FLW0300F - Proof Test	16
HD G	3.1.2.3 TEW0300G - Re-Measure Headspace after Proof	16
3.1.3	Forces	16
	3.1.3.1 TLW0300H -Measure Firing Pin Indent	16
	3.1.3.2 TLW03001 - Trigger/Sear Engagement	17
	3.1.3.3 TLW0300J – Measure Trigger Pull Forces	17
	3.1.3.4 TLW0300K - Measure Safe On/Off Forces	17
	3.1.3.5 TLW0300L – Measure Bolt Lift and Bolt Closing Force	
	3.1.3.6 TLW0300M – Measure Magazine Spring Force	18
	3.1.3.7 TLW0300N - Measure Firing Pin Head to Sear Engagement	
	3.1.3.8 TLW03000 – Bolt Stop Function Check	
	3.1.3.9 TLW0300P - Function Check of ISS System	
	3.1.3.10 TLW0300Q - Magazine box Weld Strength Test.	
	3.1.3.11 TLW0300AT - Perform bore sighting Using Bushnell Scope	24
	Page 3 CONFIDENTIAL	

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST RING ROAD ELIZABETHTOWN, KY 42701

3.1.4.1 TLW0300R - Balance Point - "System" (Includes Scope and Mount Rails)	25
3.1.4.2 TLW0300S -Balance Point - Rifle Only (Without Scope, Rails and with Iron Sights)	
3.1.5 Firearms Measurements	2б
3.1.5 1 TLW0300T - Chamber Cast	26
3.1.5.2 TLW0300U – Bore Diameter.	
3.1.5.3 TLW0300V - Groove Diameter	26
3.1.5.4 TLW0300W - Twist Rate (.30-06)	26
3.1.5.5 TLW0300X - Magazine Capacity Test	27
3.2 FUNCTION & ENDURANCE TESTING	28
3.2.1 Function and Endurance Testing	28
3.2.1.1 TLW0300Y - Ten (10) Round Safety Function Test with Lanyard	28
3.2.1.2 LW0300Z - Basic Jack Function Test (100 Rounds with Remington Ammunition.)	28
3.2.1.3 TLW0300AA – Extended Function & Endurance (400 Rounds w/Remington & Competitive Anymunition.)	29
3.2.1.4 TLW0300AB – Clean Rifles and Inspect	35
3.3 ACCURACY AND POLITECTING	35
3.3.1 Accuracy and POI Testine	35
3.3.1.1 TLW0300AC - POI & Group Size - Initial Test with High Quality 36X Scope	35
3.3.1.2 TUMO200AD AR and AR Group Size and BOI of 100 wards "Syntate Stability Fact w/Bushnell Scane @ "zero" rounds "	'າດ"
rounds and at "40" rounds.	36
rounds and at "40" rounds. 3.4 ENVIRONMENTAL TESTING.	37
3.4.1 Temperature & Humidity Testing 3.4.1.1 TLW0300AC - Ho Finition Test	37
3.4.1.1 TLW0300AC - Ho Function Test	37
3.4.1.2 TEWO DOAH Cold Function Test	
3.4.1.3 TLW0300AF Baat & Humidity Test	
ABUSIVE ESTING	
3.5.1 Impact Testing	
3.5 FT TLW0300AJ – SLAM Testing	
3.5.1.2 TLW0300AK – SAAMI Drop Test – "System" (Includes Scope and Mounting Rails)	
3.5.1.3 TLW0300AL - SAAMI Jar-Off Test - "System" (Includes Scope and Mounting Rails)	
3.5,1.4 TLW0300AM – SAAMI Rotation Test – "System" (Includes Scope and Mounting Rails)	
3.5.1.5 TLW0300AN - SAAMI Drop Test - Rifle Only (Without Scope and Mounting Rails and w/ Iron Sights)	
3.5.1.6 TLW0300AO - SAAMI Jar-Off Test - Rifle Only (Without Scope and Mounting Rails and w/ Iron Sights)	
3.5.1.7 TLW0300AP - SAAMI Rotation Test - (Without Scope and Mounting Rails and w/ Iron Sights)	39
3.5.2 Intentional Abuse	
3.5.2.1 TLW0300AQ - Pierced Primer Test	
3.5.2.2 TLW0300AR – High Pressure Test	
3.5.2.3 TLW0300AS – Obstructed Bore Test	
Jan. '01 - Trial & Pilot Test - Remington M/710 Centerfire Rifle;	

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \ 710 T&P_3006 \ M710_T&P_REPORT_JAN01_Rev0.doc

Page 4

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST RING ROAD ELIZABETHTOWN, KY 42701

Remington Arms Company, Inc.

Test Report - Trial & Pilot Test

January 2001

M/710 Centerfire Rifle

Caliber: .30-06 Springfield

ABSTRACT:

This Report covers the results of the Trial & Pilot Testing (T&P) procedures performed on the Remington M/710 Centerfire Rifle during November & December 2000 at the Remington Arms Company, Inc., Research & Development Technical Center located at Elizabethtown, KY.

This Testing Program was organized around the goal of determining if this the product met design specifications specified by R&D and produced using production methods and processes at the Remington Arms Mayfield Kriplant

Several "information only" tests were also conducted during the same test program have purpose of evaluating the products under extreme conditions.

The following general grouping of test procedures were used to determine product and process capability.

- Headspace and Proof Checks
- Initial Inspections, Tests and Measurements
- -Weights, Lengths and Gun Characteristics
 - Firearms Measurements
 - Functional / Endurance Testing

 - Accuracy Environmental Tests
 - Abustve Testing

should be noted that although there were a couple of minor areas of concern (primarily pertaining to firing pin head assembly, Magnine Box and Bolt Stop function, the team determined that the product presented no concerns relative to safety. There were also some conferms with the Bushnell optics that still must be addressed by Mayfield. With the understanding that these concerns will be addressed prior to warehousing, the team concluded that production could proceed and product released for shipment to the warehouse.

After reviewing each of the individual tests in the program and taking the entire series of T&P tests as a whole, the Research Test Lab and the Research Design Group have concluded that this product met the acceptance requirements as set forth by the Trial & Pilot Test Plan.

Report Prepared By

J. R. Snedeker

Jan. '01 - Trial & Pilot Test - Remington M/710 Centerfire Rifle; R & D Technical Center Project No. 241039; TLW 0300

file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 5

Confidential

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 3.15 WEST RING ROAD ELIZABETHTOWN, KY 42701

INTRODUCTION

The Model 710, Centerfire Rifle is a new product line for the Remington Arms Company.

This report will review and summarize the results of various Trial & Pilot Tests (T&P) conducted during the time period November 2000 and December 2000 at the Remington Arms Company, Inc., Research & Development Technical Center located in Elizabethtown, KY.

Due to the extensive nature of the testing involving this product this report will consist of two parts. Part A (this occurrent) presents a brief explanation of each of the individual tests that were a part of the overall Trial & Pilot test plan, along with a partief review of the results for that particular test. Part B consists of 1 large binder and contains the raw data for the T&P as well as the individual test reports associated with the test program. It is more extensive in both volume and detail and is intended to give the reader an in-depth look at each of those same tests if desired. Part B also provides additional details such as the flow chart for the T&P test plan, copies of the individual test requests and any supplementary reports of data that was generated during or after the completion of a particular test.

Part B is divided into three parts. B:1 contains the information pertinent to the 1st Trial & Pilot effort (series "A".) B.2 contains the information pertinent to the 2nd Trial & Pilot (series "B") and B.3 the 3nd final Trial & Pilot series (series "C") of test. Part B also contains copies of supplementary tests that were not scheduled as part of the original test plan.

For reference and consistency, the same section numbering scheme is used in both Part A and in Parts B.1 - B.3.

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 6

CONFIDENTIAL

des constant. Ser

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST RING ROAD ELIZABETHTOWN, KY 42701

1.0 PURPOSE & SCOPE OF TEST PROGRAM

1.1 PURPOSE

The first purpose of this series of tests was to determine if the Model 710 Centerfire Rifle would perform as designed and meet the established function and safety criteria as proposed by the Research & Development Firearms Design Group. The second purpose of this series of tests was to assure that Mayfield production processes were capable of meeting the function, safety and design criteria established for this model by R&D.

-1.2-Scope

This report covers Trial & Pilot testing of the Remington Model 710 Centerfire in .30-06 caliber only

2.0 EXECUTIVE SUMMARY

This section of the report is a summary of the test work accomplished through a series of three Trial & Pilot (T&P) Test Programs for Remington's new Model 710 Centerfire Rifle. The testing and associated design development improvements were completed during the time period November through December 2000.

The following is summary letter issued at the end of Trial & Pilot testing (per D. Danner) and is a good summary description of the status of the project and the necessary further steps to be taken prior to shipment of product.

The Test and Measurement organization within the Elizabethtown Research and Development facility formally supports exit from both Design Acceptance and Trial and Pilot testing of the M/710 Bolt Action Firearm (configured in .3006 caliber with Bushnell 763942 riflescope) subject to the following issues and conditions:

- 1. Prior to product shipment from Mayfield a Design Transmittal <u>must</u> occur to formally establish component dimensional parameters. All product must conform to these parameters or a written deviation from design must be obtained from the Design team.
- Mayfield <u>must</u> address the continuing problem of the Firing Pin Head loosing from the Firing Pin Body. Test recommends a statistically significant audit of product by Mayfield to confirm resolution of the issue.
- 3. Mayfield <u>must</u> re-examine the process, which allowed two firearms to be swapped between boxes. This issue is driven by BATF serial number tracking requirements.
- 4. Several issues continue to exist which Test reasonably believes will result in customer dissatisfaction. These issues have no test objective criteria associated with them so Test has no

Jan. '01 - Trial & Pilot Test - Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 7

CONFIDENTIAL

54 9 14 (43) + 24 PS

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER
315 WEST RING ROAD
ELIZABETHTOWN, KY 42701

basis to withhold ship approval. Consequently, Test supports ship contingent on Marketing approval of these issues:

- Magazine Box Bottom Retention Latest data from Series C product indicates that 17% of the 5, product will experience this problem within the first 100 rounds of use. During the Series C test the earliest occurrence was at round 49.
- Magazine Box Difficult to Remove This problem was pervasive on the Series C product and may potentially contribute to the Bottom Retention issue above.
- Bolt Stop Detent Freedom Latest data from Series C product suggests that 20% of the product will experience a loosing of the detent lever during the first 100 rounds of use.
- Bushnell Scope Data from Series B product suggests that approximately 8% of the product will experience scope issues early in life. Bushnell has confirmed that an assembly issue exists with the scope.
- Take Down Screw Torque Data from Series C product indicates that 37% of the product will have some loosing of the takedown screws. Further, data obtained by Mayrield and reported on 20 NOV '00 supports the conclusion that some loss of torque does occur. While this does not constitute a safety issue consumers may potentially notice the prenomena.

Test further recommends that these issues be resolved as quickly as possible via design/process change to limit negative customer exposure.

5. Test recommends that Mayfield re-examine process controls and limits around the Trigger Pull Force via a process capability study. Data obtained in E'town from the Series C product indicated that some product was slightly below the low pull specification of 4.00 pounds. All product however was in excess of the SAAMI specified minimum of 3.00 pounds.

83

Jan. '01 - Trial & Pilot Test - Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 8
Confidential

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST RING ROAD ... ELIZABETHTOWN, KY 42701

2.1 TEST SUMMARY TABLE

The following Table lists the individual test procedures that were completed during the T&P series and the Final Status of each by individual category.

1. Note on Final Status: Determination made after final review of all test data was completed by Test management team.

TEST PROCEDURE	A-SERIES	B-SERIES	C-SERIES	Final
TRIAL & PILOT TEST	Status	Status	Status	Status ^{t.}
3.1 Initial Inspections, Tests & Measurements				83
3.1.1 Visual Examination, Packaging Audit & Packaging Test				
3.1.1.1 TLW0300A - Visual Examination			Completed	For Information
3.1.1.2 TLW0300B – Packaging Audit	Completed	₹₩ **		Passed
3.1.1.3 TLW0300C ← Packaging Test	Completed			Passed
3.1.2 Headspace and Proof				
3.1.2.1 TLW0300E Neasure Headspace			Completed by Mayfield	
5 +2.2 TLW0300F – Proof Test			Completed by Mayfield	
3.1.2.3 TLW0300G – Re-Measure Headspace after Proof			Completed	Passed
3.1.3 Forces				
3.1.3.1 TLW0300H – Measure Firing Pin Indent		Completed		Passed
3.1.3.2 TLW0300I Measure Sear/Trigger Engagement and Sear Lift			Completed	Passed

Jan. '01 - Trial & Pilot Test - Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW-0300
file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 9
CONFIDENTIAL

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST RING ROAD ELIZABETHTOWN, KY 42701

ELIZABETI	HTOWN, KY 42701			
3.1.3.3 TLW0300J – Measure Trigger Pull Forces			Completed	Passed
3.1.3.4 TLW0300K – Measure Safe On/Off Forces		Completed		Passed
3.1.3.5 TLW0300L — Measure Bolt Lift and Closing Forces		Completed		For Information
3.1.3.6 TLW0300M – Measure Magazine Spring Force		Completed		For Information
3.1.3.7 TLW0300N - Measure Firing Pin Head / Sear Engagement			Completed	Passed
3.1.3.8 TLW03000 - Bolt Stop Function Check			Completed	Passed
3.1.3.9 TLW0300P - Function Check of ISS System		- 19 Mg	Completed	Passed ₃
3.1.3.10 TLW0300Q - Magazine Box Weld Strength Test	Completed			Passed
3.1.3.11 TLW0300AT – Perform Bore Sighting Using Bushnell Scope.		Completed	en"	Passed
3.1.4 Gun Characteristics				
3.1.4.1 TLW0300R - Balance Point - System.	-		Completed	For Information
3.1.4.2 TLW0300S Balance Point – Rifle Only (Without Scope, rails and Iron Sights)			Completed	For Information
3/1.5 Tirearms Measurements				
3.1.5.1 TLW0300T - Chamber Cast		Completed		Passed
3.1.5.2 TLW0300U – Bore Diameter		Completed		Passed
3.1.5.3 TLW0300V - Groove Diameter		Completed		Passed
3.1.5.4 TLW0300W - Twist Rate (.30-06)		Completed		Passed
3.1.5.5 TLW0300X - Magazine Capacity Test		Completed		Passed

Jan. '0.1 - Trial & Pilot Test - Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \ 710 T&P_3006 \ M710_T&P_REPORT_JAN01_Rev0.doc

Page 10

CONFIDENTIAL

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER
315 WEST RING ROAD
ELIZABETHTOWN, KY 42701

3.2 FUNCTION & ENDURANCE	A-SERIES	B-SERIES	C-SERIES	Final
TESTING	Status	Status	Status	Status
3.2.1 Function and Endurance Testing				
3.2.1.1 TLW0300Y - Ten (10) Round Safety Function Test with Lanyard.			Completed	Passed
3.2.1.2 TLW0300Z - Basic Jack Function Test (100 Rounds with Rem. Ammo.	_		Completed	Passed
3.2.1.3 TLW0300AA- Extended Function & Endurance (400 Rounds w/Rem. & Competitive Ammo)			Completed	Passed 83
3.2.1.4 TLW0300AB - Clean Rifles and Inspect			Completed	Passed
.3 ACCURACY AND POI TESTING				
3.3.1 Accuracy and POI Testing				
3.3.1.1 TLW0300AC - POI & Group Size - Initial Test with High Quality 36X Scope		Completed		Passed
3.3.1.2 Tt. W0300AD - George Size at 100 yards (System Stability Test, w/Bushnell Scope @ "zero" rounds		Completed		Passed
3.3.1.3 JEW0300AE – Group Size at 100 yards (System Stability Test, w/Bushnell Scope @ "20" rounds		Completed		Passed
3.3.1.4 TLW0300AF – Group Size at 100 yards (System Stability Test, w/Bushnell Scope @ "40" rounds		Completed		Passed
.4 Environmental Testing				
3.4.1 Temperature & Humidity Testing				
3.4.1.1 TLW0300AG - Hot Function Test			Completed	Passed

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \ 710 T&P_3006 \ M710_T&P_REPORT_JAN01_Rev0.doc

Page 11

CONFIDENTIAL

and it is form a serve

Reminston Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER
315 WEST RING ROAD . . .
ELIZABETHTOWN, KY 42701

THIOWN, KT 4270	·		
		Completed	Passed
		Completed	Passed
			·
			_
		Completed	Passed
		Completed	Passed
		Completed	Passed
		Completed	Passed)
		Completed	Passed
		Completed	Passed
		Completed	Passed
	Completed		Passed
	Completed	,	Passed
	Completed		Passed
		Completed	Completed

Jan. '01 - Trial & Pilot Test - Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW-0300
file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 12
CONFIDENTIAL

ai i liilinii Cara

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST RING ROAD. ... ELIZABETHTOWN, KY 42701

3.0 T&P SUMMARY - (DETAILED)

Note: The most recent series of tests is reported on in Part A. See Part B for previous series results.

3.1 INITIAL INSPECTIONS, TESTS & MEASUREMENTS

3.1.1 Visual Examination, Packaging Audit & Packaging Test

3.1.1.1 TLW0300A - (T&P series "C") Visual Examination - Performed by Elizabethtown Technicians

710 TRA	IL&PILOT SER	IES- C					RECEIVING INSPECTION
	12/11/00						PROOF TEST & MAGNAFILIX COMPLETED AT MAY FIELD
TEST LA	B TRACKING	NUMBER-TLWO	300				(\$). (\$).
иотии	G FAGS WERE	ON THE GUNS					a 5 % \$ 83
GUN	SERIAL.	SAFETY	INTREGATED SECURITY	INSPECT FOR	INSPECT FOR	TRIGGER	227 72 2.5 75
ID#	NUMBER	POSITION	SYSTEM	STAMP	STAMP	POSITION	NOTES OF COMMENTS
				TLW0300E	TLW0300F	-	
		[1		. Kone.	
C-1	71002561	ON	LOCKED	YES	YES	16 166 7(5)	DOUBLE PROOF STAMP
C-2	71002558	ON	LOCKED	YES	YES	οк*	DOUBLE PROOF STAMP, ONLY V2 OF STAMP VISIBLE,
					kan 🤲 .	25.0	WR TSERIAL NUMBER ON BOX (7100 1950)
				رائن المراقع ا	The Year's		
C-3	71002552	ON	LOCKED	YES.	YES	TO RIGHT	DOUBLE PROOF STAMP, WHITE PAINT OF ISS DOT NOT SOLID
C-4	71002505	ИО	госкер 📆	YES	Kes 🐎	OK	
C-5	71001848	ОИ	rocktap	YES 🐎	Wes 🞏	''″ ок	ONLY 1/2 OF STAMP MARK VISIBLE
C-6	71001683	ON g	LOCKED	tes	YES	TOLET	MULTIPLE PROOF STAMPS
C-7	71001834	ON	TOCKED :	Was 🥡	YES	ок	
C-8	71002501	E CON	, ഥയ്യാ	YEX.	YES	ок	
C-9	710.0.14.2.9	pN .	rockep	YEŠ	YES	ок	
C-10	#¥f0 0 2 554	gin ,	POCKED.	YES	YES	ок	
C-11 🙀	71002555	ON .	HOCKED	YES	YES	OK	
C-12	71001680	ON.	LOCKED	YES	YES	ок	
C-13 🖟	3 7 10 0 16 8 6	ON	LOCKED	YES	YES	ок	ONLY 1/2 OF STAMP MARK VEIBLE
C-14	\$ \$100 1787	ои "	LOCKED	YES	YES	ок	
C	7 10 0 19 4 8	ĎИ	NOCKED.	YES	YES	ŏκ	DOUBLE PROOF STAMP
Cilis	71001888	ON	LOCKED	YES	YES	ок	
\$\$ \$ \$\$717	71001844	ОИ	LOCKED	YES	YES	TO LEFT	
C-18	7 10 0 19 50	ON	LOCKED	YES	YES	ок	DOUBLE PROOF STAMP, WRONG SERIAL NUMBER ON BOX (71002558)
C-19	71001911	ON	LOCKED	YES	YES	ок]
C-20	71001157	ON	LOCKED	YES	YES	TO RIGHT	·
C-21	7 10 0 176 1	ON	LOCKED	YES	YES	ок	
C-22	71001745	ON	FOCKED	YES	YES	ок	
C-23	71001174	OM	TOCKED	YES	YES	ок	
C-24	7 100 1709	ON	TOCKED	YES	YES	ок	WHITE PAINT OF ISS DOT NOT SOLID
C-25	71002563	ON	LOCKED	YES	YES	ок	
C-26	71002580	ON	TOCKED	YES	YES	ок	
C-27	71002557	ON	FOCKED	YES	YES	ок	
C-28	71002565	. ON	LOCKED	. YES	· YES	· ok.	
C-29	71002569	ON	LOCKED	YES	YES	ок	
Ç-30	7 (00 1744	ON	LOCKED	YES	YES	ок	

Jan. '01 - Trial & Pilot Test - Remington M/710 Centerfire Rifle;

R & D Technical Center Project No. 241039; TLW 0300

file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 13

CONFIDENTIAL

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER
315 WEST RING ROAD
ELIZABETHTOWN, KY 42701

3.1.1.2 *TLW0300B - Packaging Audit -*

(T&P Series "A") - performed by Marketing as specified by the test plan.

The following is from an e-mail message sent to concerned parties by John C. Trull, Product Manager – Firearms. John performed a marketing audit on the first shipment of trial and pilot rifles (T&P, "A") shipped from Mayfield to the Elizabethtown site. This letter describes the results of that audit.

Packaging

Overall, packaging looked good. There were no cartons damaged outside of a few minor tears that did not penetrate through the corrugated container. All guns were secure inside of the package and did not appear to have shifted. With the exception of three guns packaged without ISS keys, all required contents were present.

Stock

Overall appearance of the 710 stock was good. No marring to speak of was noticed. In my opinion, I saw nothing that would inhibit our ability to proceed with the production of the guit, however below are some comments which hopefully can be addressed with the implementation of a new mold at some point next year.

- On approximately half of the guns, a noticeable gap existed along the left-hand side of the barrel. In contrast, the right hand side of the barrel on the same guns showed very little or no gap. In the more extreme cases, when viewed from the muzzle, the parrel appeared off center in it's bedding.
- On the same guns, a more noticeable gap appeared on the right rear corner of the receiver/stock mate (by the safety lever) than was visible on the left. With the both of these gap issues, it was almost as if the barreled action was not moligied straight into the stock.
 - On nearly all guns, the safety lever dug slightly into the stock when placed in the "fire" position. Mike Keeney said that the only good way to address this would be to build a shelf into the stock when a new mold was constructed.
- One stock was observed with excessive "sink" on the left-hand side. A "not to exceed" sample was identified
 which Mayfield will measure in order to obtain maximum acceptance criteria.

Bolt Camming/Bolt Translation

Force required to cam the bolt into battery was noted to be tight but acceptable on essentially all guns. My opinion is that if we can take measures to reduce this on future production, we should do so. The issue raised by all was how to consistently and accurately measure bolt camming force. No consensus was reached on how to do so. I feel strongly that we should explore developing a means to test this criterion on the Model 710.

Jan. '01 - Trial & Pilot Test - Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 14

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST RING ROAD ELIZABETHTOWN, KY 42701

Bolt translation varied from gun to gun slightly with one gun being unacceptable with respect to this criterion. The gun in question is going to have both the receiver insert and bolt dimensions measured to determine if they exceeded specification. Again, the issue at hand is how to appropriately measure the forces required to cycle the bolt. As with the camming force, I feel a quantitative test is needed here in order to set acceptance criteria.

All in all, I felt that the evaluation went well. Although there are areas in which we can improve, the guns were suited to move forward with the test.


3.1.1.3 TLW0300C - Packaging Test

In addition to the above-mentioned Packaging Audit, a Packaging Test was conducted on a small sample of the T&P rifles. This test was designed to expose the product and the shipping carton to real world conditions of shipping to determine the probable effects of normal shipping on the packaging materials and evaluate the protection afforded the product.

Two rifles each were shipped from Elizabethtown by UPS to other Remington locations; Lonoke AR and Findlay OH.

Upon arrival at these locations, individuals were assigned to examine the exterior of the packages; note any damage and reship the product back to the Elizabethtown site for final evaluation.

The first package design was judged as providing inadequate protection to the product and a redesigned Styrofoam insert was used on later trial and pilot shipments.

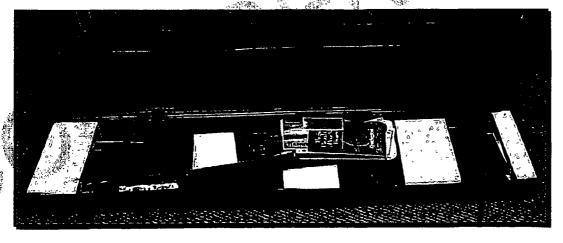

Picture #1- Early version of Packaging (after shipment)

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \ 710 T&P_3006 \ M710_T&P_REPORT_JAN01_Rev0.doc


Page 15

CONFIDENTIAL

or i nomination

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST RING ROAD ELIZABETHTOWN, KY 42701

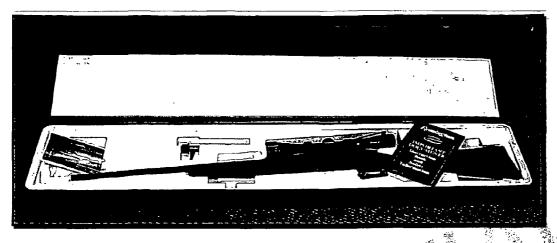

Picture #2 - Newest version of Packaging

3.1.2 Headspace and Proof

Note: For Series "C" sample rifles, the proof test and Magnathux™ hispections were performed at Mayfield prior to shipment to R&D.

> TLW0300E - Measure Headspace 3.1.2.1 (Please see Note above)

TLW0300F - Proof Test (Please see Note above)

TLW0300G - Re-Measure Headspace after Proof

	(ter, sories e) = specification. 2 Min. 1 0.007 and 1 100			≤ Min. + 0.007" after Proof.
Variable	N	Mean	Std. Dev.	95% Confidence Interval
Headspace: (all readings @ min. +)	30	0.0017	0.00064	0.0014; 0.0020

3.1.3 Forces

TLW0300H -Measure Firing Pin Indent 3.1.3.1

(T&P Series "B") - Specification: ≥ 0.017 indent.

Variable	N	Mean	Std. Dev.	95% Confidence Interval
Firing Pin Indent – Preliminary Measurements	29	0.0175 in.	0.00082	0.0172, 0.0178
Firing Pin Indent - After Live Fire Test.	24	0.1854	0.00114	0.01806, 0.0190

Jan. '01 - Trial & Pilot Test - Remington M/710 Centerfire Rifle; R & D Technical Center Project No. 241039; TLW 0300 file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 16

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER
315 WEST RING ROAD
ELIZABETHTOWN, KY 42701

3.1.3.2 TLW0300I - Trigger/Sear Engagement

(T&P, Series "C") Specification: 0.020 to 0.025 inches.

Variable	N	Mean	Std. Dev.	95% Confidence Interval
Trigger/Sear Engagement	30	0.028	0.0029	0.027, 0.029

Sear Lift, (T&P, Series "C"); specification: 0.006 to 0.018 inches.

Variable	N	Mean	Std. Dev.	95% Confidence Interval
Sear Lift	30	0.0178 in.	0.0017	0.617, 0.018

3.1.3.3 TLW0300J - Measure Trigger Pull Forces

(T&P, Series "C"); specification: 4.0 to 3.5 lbs., (Note: spring scale used for measurements.)

Variable	N	Mean	Std. Dev.	95% Confidence Interval
Trigger Pull Forces, in Stock	30	3.99 lb.	्र ^{्ड} 0.375	3.85 lb., 4.13 lb.
Trigger Pull Forces, out of Stock	30	4. L. b.	0.334	4.05 lb., 4.30 lb.

3.1.3.4 TLW0300K - Measure Safe On/Off Forces

(T&P, Series "B"); specification: ≥ 1.0 lb.

Variable .	N	Меап	Std. Dev.	95% Confidence Interval
Safe Off Force	10	2.37	0.1834	2.24, 2.50
Safe On Force	10	5.87	0.4480	5.55, 6.19

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \ 710 T&P_3006 \ M710_T&P_REPORT_JAN01_Rev0.doc

Page 17

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST RING ROAD ELIZABETHTOWN, KY 42701

3.1.3.5 TLW0300L - Measure Bolt Lift and Bolt Closing Force

(T&P, Series "B"); no specification listed - measurements taken for information.

Variable	·N	Mean	Std. Dev.	95% Confidence Interval				
Bolt Opening Force – Chamber Empty, Cocked	1Ò	2.79	0.0894	2.72, 2.85				
Bolt Opening Force – Chamber Empty, Fired	10	10.02	0.5570	9.63, 10.42				
Bolt <u>Closing</u> Force – Chamber Empty	10	20.67	3.49	18.17, 23.16) 83				
Bolt Opening Force – With Dummy Cartridge in Chamber, Cocked	10	3.21	03827	201, 3.41				
Bolt Opening Force – With Dummy Cartridge in Chamber, Fired	10	10.23	0.486	9.89, 10.58				
Bolt <u>Closing</u> Faree – With Dummy Cartridge in Chambet	-10	27.66	7.43	22.34, 32.97				

3.1.3.6 TLW0300M - Measure Magazine Spring Force

(T&P, Series "B"); no specification established - measurements taken for information.

Variable	N	Mean	Std. Dev.	' 95% Confidence Interval				
Magazine Spring Force @ 0.2"	10	2.02	0.1582	1.90, 2.13				
Magazine Spring Force @ 1.0"	10	3.38	0.2735	3.18, 3.57				

Jan. '01 - Trial & Pilot Test - Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \ 710 T&P_3006 \ \ M710_T&P_REPORT_JAN01_Rev0.doc

Page 18

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST RING ROAD ELIZABETHTOWN, KY 42701

3.1.3.7 TLW0300N - Measure Firing Pin Head to Sear Engagement

(T&P, Series "C"); Specification: Minimum Vertical Engagement to be \geq .049".

Note that the measurement method produces a dimensional range.

Variable	Ņ	Mean	Std. Dev.	95% Confidence Interval
		(Range)		
Firing Pin Head to Sear Engagement - range	30	0.065 – 0.076	0.0029	0.064, 0.077

3.1.3.8 TLW03000 - Bolt Stop Function Check

(T&P, Series "C

Variable	Good	Marginal / Loose
Stop Function	10	0
Release Detent	8	2

3.13.9 TLW0300P - Function Check of ISS System

(T&P, Series "C")

All ten samples, C-11 to C-20, passed the ISS Function Test without incident.

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 19

CONFIDENTIAL

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER
315 WEST RING ROAD
ELIZABETHTOWN, KY 42701

3.1.3.10 TLW0300Q - Magazine box Weld Strength Test

HISTORY: (details and analysis per M. Jiranek)

Thirteen M/710 magazine boxes were delivered to the Remington Arms Company Research and Development Technology Center in Elizabethtown, Kentucky for weld evaluation of the T&P product. The current specification of the welded box is that no box shall fail when loaded as described in this report below 2,000 pounds of applied load. Of the thirteen boxes supplied, 10 were tested and 1 inadvertently was destroyed during set-up. There are two boxes remaining.

SUMMARY:

All 10 of the boxes tested passed the current specification criteria. The average failure load for all 10 tested magazine boxes was 3,037 lbf. The boxes were loaded in the Instron tensile testing machine as depicted in Figure 1. The first two magazine boxes tested did not fail the welds, but rather failed the magazine box material. The test set-up was then altered (for the remaining eight magazine boxes tested) by removing the small block in the bottom of the magazine box. This allowed for the failure of the weld rather than the material in six of the remaining eight magazine boxes tested. The average failure load of the last eight magazine boxes tested was 3,229 lbf.

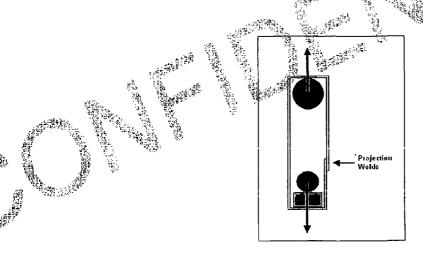


Figure 1. Schematic of the testing set-up for tensile testing the M/710 magazine boxes.

Figures 2 presents an image of one of the magazine boxes which failed the material rather than the welds. Figure 3 presents an image of a magazine box which failed both of the welds during the testing process.


Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \ 710 T&P_3006 \ M710_T&P_REPORT_JAN01_Rev0.doc

Page 20

CONFIDENTIAL

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST RING ROAD ELIZABETHTOWN, KY 42701

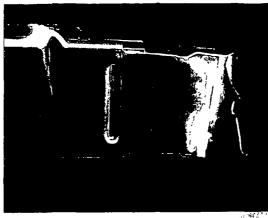

83

Figure 2. Image of a magazine box, which did not fail the welds, but did fail the magazine box material during the weld strength testing process.

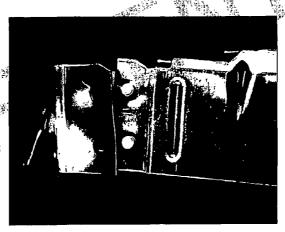


Figure 3. Image of a magazine box, which did fail the welds during the weld strength testing. Note the partial failure of the material at the front of the box as well.

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 21

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER

- 315 WEST RING ROAD

ELIZABETHTOWN, KY 42701

PROCEDURE:

A total sample of ten magazine boxes was tested to failure. As shown in Figure 1, the magazine boxes were loaded into the Instron tensile testing machine using two pins which passed through the ends of the magazine box and a small block which was meant to keep the front of the box square under the loading conditions.

The welds were strong enough, however, to allow the magazine box to deform around the block and tear along the front edge of the magazine box. An example of this type of failure is shown in Figure 2. By removing the block, the magazine box was allowed to deform around the two fixture pins. Once the magazine box had conformed to this geometry, the applied load increased with the displacement until the welds ultimately failed.

RESULTS:

Table 1 presents the maximum load obtained prior to failure of each of the magazine boxes as tested. This table also included the average, standard deviation, and the average minus three standard deviations for all ten poxes as well as for the last eight boxes tested (after the set-up change was performed).

ļ	M/7	10 Magazine B	0	x Weld Sh	ear Test
	Box No.	Maximum Load at Fallure (lb.)		Box No.	Maximum Load at Fallure (lb.)
1	165	iii. 2,354 🗓		6	2,820
	2	55 2,184 A		Sec. 37	3,285
3	3 🖑 :	3,029	1	^a 8	3,393
- 1	4	3,166°		9	3,321
25	2 ¹ 5	3.624		10	3,197
	3,037	10 Box Average		3,229	8 Box Average
3	459	10 Box St. Dev.		241	8 Box St. Dev.
1	1,660	10 Box μ-3σ		2,506	8 Вох µ-3σ

Table Individual testing results of each of the ten magazine boxes evaluated for weld strength.

Figure 4 presents a graph of a typical load / displacement curve for the weld strength testing. This graph has the key characteristics of the weld strength testing labeled directly in the regions of interest. These included the magazine box deformation (when the box deforms around the two fixture pins), the failure of the first of the two welds, and the failure of the second weld. This particular curve is of magazine number 8.

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 22
CONFIDENTIAL

to a summary

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER
315 WEST RING ROAD
ELIZABETHTOWN, KY 42701

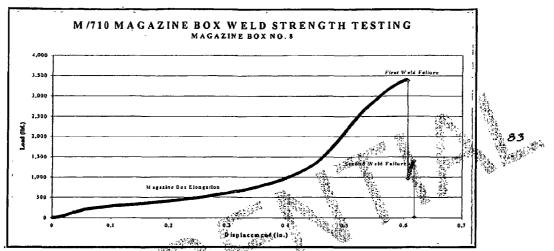


Figure 4. Load / displacement graph of test magazine box number 8.

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \ 710 T&P_3006 \ M710_T&P_REPORT_JAN01_Rev0.doc

Page 23
CONFIDENTIAL

dia 1 12 30 01 5 24 25

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST RING ROAD ELIZABETHTOWN, KY 42701

3.1.3.11 TLW0300AT - Perform bore sighting Using Bushnell Scope

(T&P, Series "B"), no specification established - measurements taken for information.

Prior to the start of live fire or accuracy testing a sample of the rifles was tested to determine if production had performed a bore sighting/adjustment after mounting the Bushnell Scopes. The scopes were not adjusted prior to testing. One 5-shot group was shot from each of the test rifles.

From the test data it would appear that the scopes were not adjusted prior to submission to trial & pilot testing. See Pattern Chart next page. The individual points represent the location of each rifles POI (Point of Impact) relative to POA (Point of Aim), (with the POA located at (0,0))

The "Overall Average Position" on the chart represents the average POI relative to POA for the ten rifles tested.

MODE	L 710 T&P	POI RELATIVE TO	POA BORE SIG	ЭH.	TING USING BUSHNE	LL SCOPE
GUN	SCOPE	AMMO	GROUP SIZE		POI RELATIVE TO POA	DISTANCE (in.)
B-21	BUSHNELL	REM R30064 180GR	2.68	Х	-2.49 🚅 🕌	
l			,	Y	11081	12.07
B-22	BUSHNELL	REM R30064 180GR	2.37	X	-7.25	
1			100 m 100 100 m 100 m 10	Ÿ	9.47	_ු 11.93
B-23	BUSHNELL	REM R30064 180GR	2:46	X	-8. 52	·
		الولاية . الولاية الولاية . - الولاية الولاية .	The Spark	Ý	9.32	12.63
B-24	BUSHNELL	REM R30064 180GR	3,52	Χ .	្រ ុំ -16.11	
1	م 8€ نے	apa ik ik		Ý	15.15	22.12
B-25	BUSHNELL	REM.R3006# 180GR	- <u>-</u> 21.05	X	4.45	
28£>-			and the second	Y	-2.65	5.17
B-26	BUSHNELL	REM R30064 180GR	1.54	X	1.72	
	12 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		,	Y	17.22	17.30
B-27	BUSHNELL	REM R30064 180GR	2.34	X	-13.83	
1	Ä			Y	9.50	16.78
B-28	BUSHNELL	REM R30064 180GR	2.62	X	-4.47	
				Y	12.4 9	13.26
B-29	BUSHNELL	REM R30064 180GR	1.89	X	3,50	
				Y	-2.28	4.17
B-30	BUSHNELL	REM R30064 180GR	2.387	x	-9.279	
			<u>.</u>	Υ	9.978	13.63
			_		AVERAGE	12.9
1					STD, DEV.	5.4

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc


Page 24

CONFIDENTIAL

ben what with

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER
315 WEST RING ROAD...
ELIZABETHTOWN, KY 42701

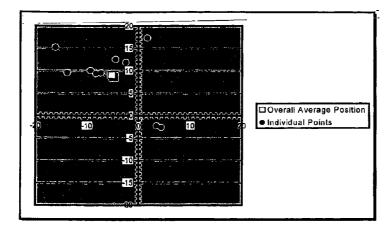


3.1.4 Gun Characteristics

(T&P, Series "C"), no specification established - measurements taken for information.

3.1.4.1 TLW0300R - Balance Point System" (Includes Scope and Mount Rails)

3.1.4.2 TLW0300S - Balance Point - Rifle Only (William Scope, Rails and with Iron Sights)

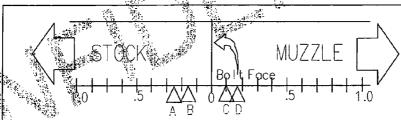

A.-Balance, Rifle w/ Scope & Rails, Loaded (Avg. = -.25)

B.-Balance, Rifle w/ Scope & Rails, Empty (Avg. = -.18)

C. - Balance, Rifle, w/o Scope & Rails, Loaded (Avg. = .10)

D. - Balance, Rifle, w/o Scop; e & Rails, Empty (Avg. = .18)

The balance point is measured from the bolt face (to establish a common reference location) and is important in terms of rifle "pointability". In addition, the balance point is used an indicator of the Center of Gravity of the rifle and is used as the height locator when performing the S.A.A.M.I. Drop test. For this model the balance point is within a ¼ inch of the bolt face for all 4 test conditions, with and without scope and rails and loaded and unloaded

Jan. '01 - Trial & Pilot Test - Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 25

CONFIDENTIAL

191 H. H 142H \$2(1)

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER
315 WEST RING ROAD
ELIZABETHTOWN, KY 42701

3.1.5 Firearms Measurements

3.1.5.1 TLW0300T - Chamber Cast

(From series "B" - see "Variable" column for specifications)

Variable	N	Mean	Std. Dev.	95% Confidence Interval
.47084728	10	0.4702	0.00087	0.4696 0.4709
.44254400	10	0.444	0.00055	0.4437, 0.4445
34.5 Deg.	10	34.5°	0.2550	34.3°, 34.7°
.3404 – 3424	10	0.3437	0.00100	0.3430, 0.3444
.30953105	10	0.3100	0.00059	0.3096, 0.31.05

83

3.1.5.2 TLW0300U - Bore Diameter

(T&P Series "B"), specification: 0300 / 0.301"

Variable	N	Meah	Std. Dev.	95% Confidence Interval
Bore Diameter		0.3002 - 0.3005	0.00007	0.30014, 0.30054

3.1.5.3 TEW0300V - Groove Diameter

(T&P, Series "B"), specification: 0.308 / 0.309

ines-	Variable	N	Mean	Std. Dev.	95% Confidence Interval
	Groove Deimeter	10	0.309	0.00018	0.3090, 0.3093
	## NG25 12 ACM				

3.1.5.4 TLW0300W - Twist Rate (.30-06)

(T&P, Series "B"), specification: 1" in 10", ± 0.25", RH

Variable	N	Mean	Std. Dev.	95% Confidence Interval				
Twist Rate	10	1 in 10.	0.150	9.9, 10.1				

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TEW 0300
file: E:\Test Reports \ Firearms Tests \ 710 T&P_3006 \ M710_T&P_REPORT_JAN01_Rev0.doc

Page 26
CONFIDENTIAL

tive milket 1217 ti



Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST.RING ROAD ELIZABETHTOWN, KY 42701

3.1.5.5 TLW0300X - Magazine Capacity Test

(T&P, Series "B"), specification: with 4 rounds in magazine

box, must be able to load and latch into receiver.

All ten rifles (B11 to B20) passed the Magazine Capacity Test.

. 53

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 27

CONFIDENTIAL

o. . wand the

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST RING ROAD ELIZABETHTOWN, KY 42701

3.2 FUNCTION & ENDURANCE TESTING

3.2.1 **Function and Endurance Testing**

TLW0300Y - Ten (10) Round Safety Function Test with Lanyard 3.2.1.1

Test completed without incident.

LW0300Z - Basic Jack Function Test (100 Rounds with Remington Ammunition.) 3.2.1.2

		MALFUNCTIONS BY AMMO TYPE – SERIES "C" - RIFLES C1 – C24,																						
Ammo Types	С	C	C	C	С	C	C	C	Ċ.	С	C	С	C	C	С	С	C	C	С	С	C	C	C_{\parallel}	C 1
	1	2	3	4	5	6	77.	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24:
REM, L30062, 150 gr. MC							:3°	10 m		185. 185.														
REM, PRT3006B, 165 gr. NBT								10/A 8/A/A 14/A/A 17/42 17/43 17/44 17/44	100 mg/s	Ň														
REM, R30064, 180 gr. SP					3C					. 1986 1989 1989 1989 1989 1989 1980 1980 1980													,	
REM, R30065, 180 gr. PSP			lA		3D							<u> </u>				-						,		7
REM, R30067, 220 gr. SP				1B	3E				ű.	100		100 210 300 300 300									4F			
												21	-4. 743 <u>.</u>											

1A - Rifle C3 - Magazine Box Bottom came off @ 74 rounds into test.

1B - Rifle C4 - Magazine Box Bottom came off @ 90 rounds into test.

3C - Rifle C5 - Magazine Box Bottom came off @ 49, 54 & 58 rounds into test.

3D - Rifle C5 - Magazine Box Bottom came off @ 62, 71 & 78 rounds into test.

Magazine Box Bottom came off @ 86, 91 & 97 rounds into test.
Magazine Box Bottom came off @ 82, 90, 94 and 98 rounds into test 3E - Rifle C5

Jan. '01 - Trial & Pilot Test - Remington M/710 Center fire Rifle R & D Technical Center Project No. 241039; TL W 0300

file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&R_RHBORT_JAN01_Rev0.doc

Page 28

CONFIDENTIAL

ET0855

Remington Arms Company Inc.

BEARCH & DEVELOPMENT TECHNICAL CENTER
315 WEST RING ROAD
ELIZABETHTOWN, KY 42701

3.2.1.3 TLW0300AA - Extended Function & Endurance (400 Rounds w/Remington & Competitive Ammunition.)

This test procedure is used to determine an estimate of the products expected rate over an extended period of shooting. Not counting the magazine box bottoms that came off during shooting (12 instances in 4000 rounds), there were a total of 13 malfunctions, 12 stem low and 1 Bolt Over-ride, in 4000 rounds for a malfunction rate of 0.3%. The acceptable malfunction rate for Bolt-Action Centerfire rifles is $\leq 2\%$. It was need that rifles C-6 through C-10 had difficulty removing the magazine box. Rifles C12 through C-15 had additional clearance machined into the magazine well were noted as not having a problem removing the magazine box throughout the test.

400 Round Extended Function Test Rifles C-6 to C-15, TLW0300AA; 12/20/00

This 400 round Extended Function Test was performed in the Function & Casualty Range using std. Remington Test Jacks. An assortment of Ammunition Types was used without specific order or amount.

Note: Rifles C-11 to C-15 had additional clearance machined into the Magazine Well to improve Magazine removal.

RIFLE NUMBER	SERIAL NUMBER	AMMUNITION TYPE	LOT NUMBER ROUNDS FIRED	MALFUNCTIONS
C-6	71001683	Rem.R30064, 180 gr. SP	K29G C4214 100	0
		Rem. L30062, 150 gr. MC	M03G B1 100	0
		Fed. P3006Q, 165 gr.	010614X250 100	0
		Rem. R30064, 180 gr. SP	K29G C4214 100	0
Technician:	J. Arnold	ı	\$ 	ingering.
Comments:	Magazine box became	very difficult to remove from g	un, straightened magazine box 220 re	ounds into test & continue.

Jan. *01 - Trial & Pilot Test - Remington M/710 Centerfire Rifle:

R & D Technical Center Project No. 241039; T134 9300
file: E:\Test Reports \ Firearms Tests \ 710 T&P_3006 \ M/710_T&P_REPORT_JAN01_Rev0.doc

Page 29

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST RING ROAD ELIZABETHTOWN, KY 42701

RIFLE NUMBER	SERIAL NUMBER	AMMUNITION TYPE	LOT NUMBER	ROUNDS	MALFUNCTIONS			
		100 mg/s		FIRED				
C-7	71001834	Rem.R30064:180 gr. SP	K29G C4214	100	0			
		Rem. L.30062, 150 gr. MG	M03G B1	100	0			
		Fed. 3006b, 180 gr.		100	0			
		Win. S3006XB, 150 gr.	ME61	100	7 Stem Low			
Technician:	J. Arnold	واريم داري وارد						
Comments:	Magazine box became	Magazine box became very difficult to remove form grap, straightened magazine box 200 rounds & Rounds into test & continue.						
RIFLE NUMBER	SERIAL NUMBER	AMMUNITION TYPE	LOT NUMBER	ROUNDS	MALFUNCTIONS			
				FIRED				
C-8	71002501	Rem.R30064, 180 gr. SP	K29G C4214	100	0			
		Rem. L30062, 150 gr. MC	M03GB1	100	0			
		Win. SBST3006XA, 168 gr.	04RK31	100	0			
		Rem. R30065, 180 gr. PTD SP	L19D B27	100	0			
Technician:	J. Arnold		ş	La				
Comments:	Magazine box became very difficult to remove form gun, straightened magazine box 200 rounds into test & continue.							

Jan. '01 - Trial & Pilot Test - Remington M/710 Centerine Rifle; R & D Technical Center Project No. 241039 PLW 0300 file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 30

COMPIDENTIAL

Res & gr (unt 521PM

GONFIDENTIAL REMINGTON Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER
315 WEST RING ROAD

RIFLE NUMBER	SERIAL NUMBER	AMMUNITION TYPE	LOT NUMBER	ROUNDS	MALFUNCTIONS			
			\$	FIRED				
C-9	71001429	Rem.R30064, 180 gr. SP	K29G C4214	100	Mag. box bottom came off @ 93 & 100 Rounds.			
		Rem. L30062, 150 gr. MC	M03G B1	100	. 0			
		Win. SHV30064, 180 gr.	35PC52	100	0			
		Rem. L30062, 150 gr. MC	M02G-C1	100	0			
Technician:	Technician: J. Arnold							
Comments:	Magazine box became	very difficult to remove form g	un, straightened magazi	ne box 220 rour	nds into test & continue.			
RIFLE NUMBER	SERIAL NUMBER	AMMUNITION TYPE	LOT NUMBER	ROUNDS	MALFUNCTIONS			
				FIRED				
C-10	71001683	Rem.R30064, 180 gr. SP	K29G C4244	100	Mag. box bottom came off @ 49,53,65,70,84, & 96			
		İ	Constitution () In	Sign	Rounds			
		Rem. L30062, 150 gr. MC	M03G B1	100	2 Stem Low			
		Fed. P3006G, 150 gr.	A146782320	100	0			
		Rem. R30067, 220 gr. SP	M24H B14	100	Mag. box bottom came off @ 22 & 32 rounds.			

Jan. '01 – Trial & Pilot Test – Remington M/710 Centertie Rifle; R & D Technical Center Project No. 241039 TLW 0300 file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc G

Page 31

CONFIDENTIAL

Res 40-01 (491 3 3) PM

4.5

REMINSTON APMS COMPANY INC. RESEARCH & DEVELOPMENT TECHNICAL CENTER

315 WEST RING ROAD ELIZABETHTOWN, KY 42701

Comments:	Magazina hay bagawa	non diffic Plansmit	us straightourd massin	o how 200 normala i	into tool & continue
Comments:	Magazine oox became	very difficult to remove form gr	un, stratgnienea magazir	le box 200 rounds i	nio test & continue.
IFLE NUMBER	SERIAL NUMBER	AMMUNITION TYPE	LOT NUMBER	ROUNDS	MALFUNCTIONS
			rio Circini	FIRED	
C-11	71002555	Rem.R30063, 150 gr. BR.	J26N B97	160	Mag. box bottom came @ 24 rounds
		Win. S3006XB, 150 gr.	ME51	50	3 Stem Low
		Win. SHV30064, 180 gr.	14 15 16 16 16 17 Walt 1	50	0
		Fed. P3006G, 150 gr.	A146782320	70	0
		Fed. 3006b, 180 gr.	41047X228-	10	0
		Fed. P3006Q, 165 gr.	010614×250	30	0
		Rem. L30062, 150 gr. MC	M03G B	20	0
		Win. SBST3006XA, 168 gr.	04RK31	10	0
Technician:	J. Arnold			and the second	
Comments:	None		(3) ·	VII.V.	

Jan. '01 – Trial & Pilot Test – Remington M/710 Centergre Rifle; R & D Technical Center Project No. 241039, TLW 0390 file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 32

CONFIDENTIAL

Res w as 30 M 5 21 PM

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER
315 WEST RING ROAD

		्रिक पूर्व Et	IZABETHTOWN, KY 42701		
RIFLE NUMBER	SERIAL NUMBER	AMMUNITION TOPE	LOT NUMBER	ROUNDS	MALFUNCTIONS
		The second second	-	FIRED	
C-12	71001680	Rem.R30064, 180 gr SP	K28 GB3714	100	0
		Rem. L30062, 150 gr. MC	M03G B1	300	0
Technician:	J. Arnold		Section 1		
Comments:	None	5165 515			
RIFLE NUMBER	SERIAL NUMBER	AMMUNITION TYPE	LOT NUMBER	ROUNDS	MALFUNCTIONS
			7 V	FIRED	
C-13	71001686	Rem.PRT3006B,165 gr.	M31A C26	100	l Bolt Over-ride
		NOL. BAL. TIP			
		Rem. L30062, 150 gr. MC	M03GB1	300	0
Technician:	J. Arnold				
Comments:	None			(S).	·
RIFLE NUMBER	SERIAL NUMBER	AMMUNITION TYPE	LOT NUMBER	ROUNDS	MALFUNCTIONS
		-	The state of the s	FIRED	
C-14	71001787	Rem. R30064, 180 gr. SP	K28 GB3714	100	Mag. box bottom came off @ 7 rounds
		Rem. R30065, 180 gr.	K04U A7926	60	0

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle; R & D Technical Center Project No. 241639; TLW 0300 file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 33

CONFIDENTIAL

A 10 CO AMERICAN SERVICE STATE OF THE SERVICE STATE

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER
315 WEST RING ROAD
ELIZABETHTOWN, KY 42701

RIFLE NUMBER	SERIAL NUMBER	AMMUNITION TYPE	LOT NUMBER	ROUNDS	MALFUNCTIONS
Comments:	None	rt.	5 160 5 160 165 165		
Technician:	J. Arnold				
		мс		200	V
 ,		NOL BALETIP. Rem. L30062, 150 gr.	M03G B1	200	0
		Rem. PRT3006B, 165 gr.	M31A C26	40	0
'		PTD SP			

KIPLE NUMBER	SERIAL NUMBER	AMMUNITION LIFE	WINDER TOWNS	ROUNDS	MALFUNCTIONS
		1		FIRED	
C-15	71001948	Rem.R30062, 150 gr. MC	M03G BI	264	0
		Rem. L30064, 180 gr. SP	K28 GB37f4	78	0
		Rem. P30065, 180 gr. PTD SP		33	0
		Rem. R30063, 150 gr. BR PT	J26N B97	25	0
			(1) (1) (1) (1) (1) (1) (1) (1) (1) (1)	SIA.	

Technician: J. Arnold

Comments: None

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerline Riffe;
R & D Technical Center Project No. 241039; Tel 0300
file: E:\Test Reports \ Firearms Tests \ 710 T&P_3006 \ M710_T&REPORT_IAN01_Rev0.doc

Page 34

Comfidential

ος Us

Reminston Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER
315 WEST RING ROAD
ELIZABETHTOWN, KY 42701

3.2.1.4 TLW0300AB - Clean Rifles and Inspect

See "Clean & Inspect Checklist, series C, T&P", Part B; raw data sheets for details of the results of inspections and measurements.

3.3 ACCURACY AND POI TESTING

3.3.1 Accuracy and POI Testing

3.3.1.1 TLW0300AC - POI & Group Size - Initial Test with High Quality 36X Scope

This point of impact test involves the verification of the firearm's sighting system adjustment and the potential to hit the point of aim. Random variation and /or extreme differences shot to shot point of impact (as well as group size) typically indicate improper barrel processing and is used as a final inspection flag in production. Standard factory ammunition is used for this test and the same code of ammunition is used throughout the test. Three, 5-shot groups were shot in each of the test rifles B-21 to B-30. For this product and this caliber the average group must be ≤ 2.7 " at 100 yards.

All rifles in the test sample were under the 2.7" group size with the overall average group size calculated to be 1.6", (95% confidence interval = 1.4" to 1.8".)

Rifle	Scope	Ammo	Group:#1	Group #2	Group #3	Average Group
B-21	Swarovski 6-24x50	Rem R30064, 180 gr.	∌1.482	1.052	1.892	1.475
B-22	Swarovski 6-24x50	Rem R30064, 180 gr.	1.605	2.242	1.085	1.644
B-23	Swarovski 6-24x50	Rem R30064, 180 gr.	1.074	1.509	1.082	1.222
B-24	Swarovski 6-24x50	Rem R30064, 180 gr.	2.282	2.333	1.039	1.885
B-25	Swarovski 6-24x50	Rem R30064, 180 gr.	1.761	0.791	1.361	1.304
B-26	Swarovski 6-24x50	Rem R30064, 180 gr.	1.963	1.219	1.448	1.543
B-27	Swarovski 6-24x50	Rem R30064, 180 gr.	1.451	2.053	0.947	1.484
B-28	Swarovski 6-24x50	Rem R30064, 180 gr.	1.996	1.496	1.032	1.508
B-29	Swarovski 6-24x50	Rem R30064, 180 gr.	1.916	2.120	1.499	1.845
B-30	Swarovski 6-24x50	Rem R30064, 180 gr.	2.498	2.624	1.740	2.287
-	<u> </u>		-	Group Size	e - Overall Mean	1.620

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 35

CONFIDENTIAL

Remington Arms Company Inc.


RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST RING ROAD ELIZABETHTOWN, KY 42701


3.3.1.2 TLW0300AD, AE and AF – Group Size and POI at 100 yards (System Stability Test, w/Bushnell Scope @ "zero" rounds, "20" rounds and at "40" rounds.

(T&P, Series "B"), specification: ≤ 2.7" at 100 yards

The purpose of this test is to evaluate the "stability" of the optical scope system over a forty round shooting test. This test was shot at 100 yards using standard factory ammunition (using the same code of ammunition throughout the test.) The test consisted of three, 5-shot groups with the rifles cooled after every group. Each firearm was cleaned and fired with five fouling shots prior to the start of the test. The specification for average group size for this product and caliber was set at ≤ 2.7 " at 100 yards. The group size change over the 40 rounds was calculated to be 0.063" – an insignificant change.

The change in POI (Point of Impact) vs. POA (Point of Aim) changed approximately 0.5" over the 40 round test. Again, an insignificant change given the test measurement variability.

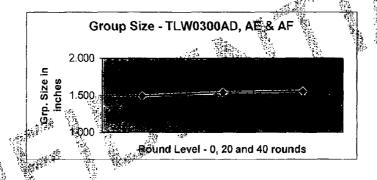

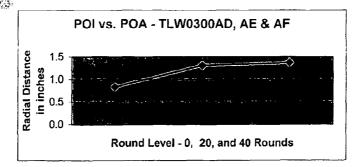

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 36

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER
315 WEST RING ROAD
ELIZABETHTOWN, KY 42701

3.4 Environmental Testing

3.4.1 Temperature & Humidity Testing

3.4.1.1 TLW0300AG - Hot Function Test

This test evaluates the effect(s) of extreme high temperatures on the functioning performance of firearms with special interest in the synthetic parts of the product. For this test Rifle C-21 and 100 rounds of ammunition were placed in the environmental chamber set at a temperature of 120°F for a minimum of six hours. After six hours, the rifle and 20 rounds of ammunition were removed from the chamber and shot in the test jack, cycling the safety every five rounds. After shooting the 20 rounds are rifle is returned to the chamber and allowed to return to the chamber temperature for two hours. At that point the rifle is again removed from the chamber with another 20 rounds and the shooting test is continued. This procedure is continued until the entire 100 rounds are fired through the rifle. No malfunctions or other items of note were observed during this test.

3.4.1.2 TLW0300AH - Cold Function Test

This test evaluates the effect(s) of extreme low temperatures on the functioning parformance of firearms. Rifle C-22 and 100 rounds of ammunition were put in the freezer set are 20°F for a minimum of six hours. After six hours the rifle and 20 rounds were removed from the freezer and shot with the safety being cycled every five founds. The rifle was then replaced in the freezer for a minimum of two hours. This procedure was repeated until the 100 rounds had been shot through the rifle.

There was one misfire flated a bound 88, the second round out of the box.

3.4.1.3 TLW0300AI - Heat & Humidity Test

for this test the rifle, C-23 was placed in the environmental chamber with 100 rounds of ammunition for a minimum of six hours. The chamber was set at 100°F and 80-90% Relative Humidity. After the initial six hours of conditioning the rifle and 20 rounds of ammunition were removed and shot in the test jack. The safety was cycled every five rounds. Every 20 rounds the test was repeated. There were no malfunctions noted during this test.

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 37

CONFIDENTIAL

Reminston Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST RING ROAD ELIZABETHTOWN, KY 42701

3.5 ABUSIVE TESTING

3.5.1 Impact Testing

3.5.1.1 TLW0300AJ - SLAM Testing

The purpose of this test is to determine if the firing pin will "follow-down" if the round is rammed home into the chamber as quickly as possible. For each of the four rounds in the magazine the tester closed the bolt "smartly". After each round was loaded into the chamber the round was fired. There were no inadvertent firings in twenty trials (or at least the number of rounds prior to the bolt handle coming off) for each rifle, therefore the test results were deemed to be acceptable for the purpose of the "slam" test.

Bolt handles that came off were determined to have poor braze to the bolt body.

	Rifles	Serial Number	Round Number	Comments	83
	CI	71002561	15	Bolt handle broke off at end of forward bolt movement Before starting rotation, bolt was left unlocked Stopped test of C1	7"
	C2	71002558	2 (************************************	Bolt handle broke off, same as £1 Stopped Test of £2	
Control of the Contro	C3	71002552	5 6 13	Grip Cap came off Magazine Box bottom came off Bolt Handle Broke off, same as C! Stopped Test of C3	
21 m	C4	71002505		No problems	

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 38

CONFIDENTIAL

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST RING ROAD ELIZABETHTOWN, KY 42701

- 3.5.1.2 TLW0300AK SAAMI Drop Test "System" (Includes Scope and Mounting Rails)
- 3.5.1.3 TLW0300AL SAAMI Jar-Off Test "System" (Includes Scope and Mounting Rails)
- 3.5.1.4 TLW0300AM SAAMI Rotation Test "System" (Includes Scope and Mounting Rails)
- 3.5.1.5 TLW0300AN SAAMI Drop Test Rifle Only (Without Scope and Mounting Rails and w/ Iron Sights)
- 3.5.1.6 TLW0300AO SAAMI Jar-Off Test Rifle Only (Without Scope and Mounting Rails and w/ Iron Sights)
- 3.5.1.7 TLW0300AP SAAMI Rotation Test (Without Scope and Mounting Rails and w/ Iron Sights)

Summary of TLW0300 AK, AL, AM, AN, AO & AP

		Summary	01 ILW03	00 AK, AL,	Aivi, Aiv, A	U & AP	era è	38 30 3 3 3/2 8	8. 89. 8 3
	Rifle	With/Without Scope and Accessories	Jar-O	Jar-Off Test		Drop Test		ion Test	
			Pass	Fait	Pass	Pail	Pass	Fail	
			All Size O	rientatio ns ,	All Six O	rientations	All Six O	rientations	
	C25	With Scope			1		√		
	C25	Without Scope	7	7 S	1		1		
	C26	With Scope			1		1		
	C26	Without Scope	1		1		1		
	C27	With Scope	1		1		1		
	© 7	Without Scope	√		√		√		
<u> </u>	C28	With Scope	1		1	-	√		
	C28	Without Scope	Not availal	ble for test – of test. See t	receiver ins est log – Gu	ert broken on n # C28, "C"	n previous t 'series of t	test – rifle ests.	
	C29	With Scope	1		1		1		
	C29	Without Scope	√		1		1		
	C30	With Scope	1		1		1		
	C30	Without Scope	1		1		√.		-
L		L							

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle; R & D Technical Center Project No. 241039; TLW 0300

file: E:\Test Reports \ Firearms Tests \710 T&P_3006 \M710_T&P_REPORT_JAN01_Rev0.doc

Page 39

CONFIDENTIAL

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST RING ROAD ELIZABETHTOWN, KY 42701

3.5.2 Intentional Abuse

3.5.2.1 TLW0300AQ - Pierced Primer Test

This test involves using a wedge-shaped firing pin point with the intent of piercing the primer thereby allowing high-pressure gases to escape from the shell in the chamber into the bolt, magazine box and receiver areas. The purpose of this test is to evaluate effects on the product due to this release of high-pressure gases into the action. A standard factory round is used for this test.

Three rounds were pierced for this test. There was no indication of damage to the rifle from any of the three test rounds.

3.5.2.2 TLW0300AR - High Pressure Test

83 200

The purpose of this test is to determine the probable extent of gun damage that might occur if a customer purposely of accidentally handloads an extremely high pressure load. In the case of the .30-06, a standard load case is loaded with approximately 50.5 grains of IMR4198 powder using a 220-grain bullet. Trial runs are made at lower powder volume levels (generating under 100,000 psi due to transducer limitations) to verify the load at known levels. In this case 47 grains of IMR4198 were used to produce an estimated pressure level of 94,800 psi. For the high pressure load, 50.5 grains of IMR4198 powder was used giving an estimated pressure level of 120,000 psi. (Note: 50.5 grains of powder is the maximum amount that will fit in the case without extensive compression of the powder.)

Damage on the rifle was noted as follows:

- Bolt Plug was set back on bolt body but remained attached to the bolt body.
- The magazine spring, magazine follower and magazine box bottom were thrown clear of the rifle.
- The bolt was firmly seized in the receiver/barrel assembly requiring milling of the parts to free the bolt assembly from the action.
- There was shear and set back noted on the locking lugs of the bolt head. The locking lugs in the barrel were unaffected.

This level of damage is not unusual given the pressure level.


Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \ \710 T&P_3006 \ \M710_T&P_REPORT_JAN01_Rev0.doc

Page 40

Reminston Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER
315 WEST RING ROAD
ELIZABETHTOWN, KY 42701

30-06 H	i Press L	oad Verif	ication	
Barrel:	# 129	# 2130 22	20g Bullet	
Powder:	IMR4198	Lot E99MY2	20 L3226	
Kisler Amp:		1v=20k		
	Sce	ope		
Max Voits	2.46	2.38	4.74	
Press:	49200	47600	94800	
500us	1v div	1v div	1v div	
Time	Warmer 1	Warmer 2	47g	

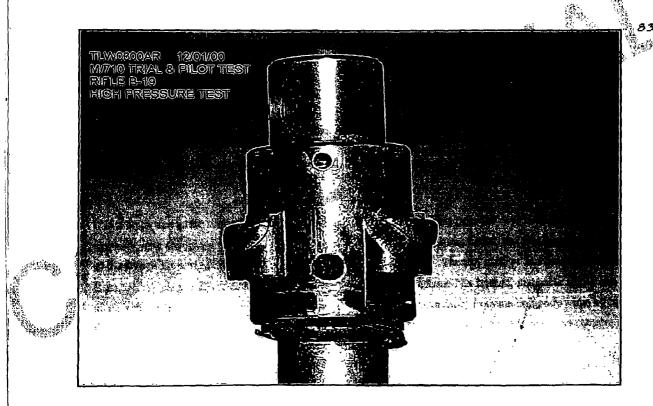

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \ 710 T&P_3006 \ M710_T&P_REPORT_JAN01_Rev0.doc

Page 41

CONFIDENTIAL

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER
315 WEST RING ROAD
ELIZABETHTOWN, KY 42701

3.5.2.3 TLW0300AS - Obstructed Bore Test

This test is conducted with an obstruction placed in the bore and a standard factory round is then fired in the rifle to determine what damage, if any, might result. To begin the test a rifle bullet is driven into the bore and is located to a position immediately in front of the chamber. A standard factory projectile, in this case a .30-06, 220 grain bullet, is placed in the chamber and the gun is fired using a lanyard. Witness paper is located directly behind the firearm to determine if debris might cause injury to the shooter.

When this test was conducted it was found that the bolt plug assembly separated from the bolt body when the gas escaping into the bolt head and bolt body traveled the length of the bolt body and impacted the bolt plug. The following is from a report issued on the results of an analysis conducted to determine if this might pose a safety issue for the shooter. The analysis determined that given the mass of the synthetic material bolt plug and the velocity of the part along with the requirement that an obstruction also be present in the bore of the rifle is was unlikely to pose a danger to the shooter

Test Description: (details & analysis per S. Franz)

Obstruct bore just forward of chamber with a 220-grain bullet

Set-up witness papers and shoot high speed movies to capture event.

Shoot a standard factory load with 220 grain bullet under controlled conditions as per high-pressure test procedures.

Results:

- Gin # B20 was tested as per the test Plan. The plastic bolt plug separated from the over molded metal insert and was ejected toward the reat of the rifle. A single sheet of witness paper was set-up behind the rifle perpendicular to the axis of the bore at the butt of the stock. The bolt plug penetrated this paper. The ISS tumbler and detent system broke free from the bolt plug and these parts were found in the room. The magazine box bottom, magazine spring and follower along with the grip cap also exited the rifle. The bolt handle was broken away from the bolt body while trying to open the rifle. The high-speed camera malfunctioned and therefore no movie was captured. Pictures were taken of the setup and the condition of the rifle after firing.
- Since no movie was captured and no estimate of part velocity and energy could be determined another gun was tested.
 Additional layers of witness paper were set-up at various distances behind the gun so as to better estimate part velocity and energy for this retest.
- Gun # B-10 was tested as per above and no failure of the bolt plug area occurred. The box bottom, spring and follower exited the rifle in a downward direction.

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: E:\Test Reports \ Firearms Tests \ 710 T&P_3006 \ M710_T&P_REPORT_JAN01_Rev0.doc

Page 42


Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER 315 WEST RING ROAD ELIZABETHTOWN, KY-42701

- Another gun, B-9, was tested as per the same procedure. This time the bolt plug cracked and separated slightly from the
 bolt assembly but it did not detach from the rifle. The grip cap, magazine box bottom, spring and follower also exited
 the rifle.
- Another gun, B-7, was tested per the above procedure. This time the bolt plug failed as it did in B-20 and was propelled rearward from the rifle. The ISS system components stayed intact with the bolt plug. The box bottom, spring and follower also exited the rifle and the operating handle was separated from the bolt body. The bolt plug penetrated three sheets of paper and hit and bounced off a fourth sheet at which point it fell almost straight downward. A high-speed movie was captured showing failure of the bolt plug and impact and penetration with the first sheet of paper only. The first sheet of paper was placed approximately 20 inches behind the rear surface of the receiver. The second sheet of paper was 39 inches from this reference point, the third 42-½ inches and the fourth 57-½ inches. The paper used was cut from a roll of 36 inch wide by 50-yd. long 20-lb. Hi-Bright computer plotter paper. The paper was taped to wooded frames as depicted in the following picture that shows the room set-up.

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle;
R & D Technical Center Project No. 241039; TLW 0300
file: EATest Reports \ Firearins Tests \ 710 T&P, 2006 \ W710, T&P, REPORT_JAN01_Rev0.doc

Page 43

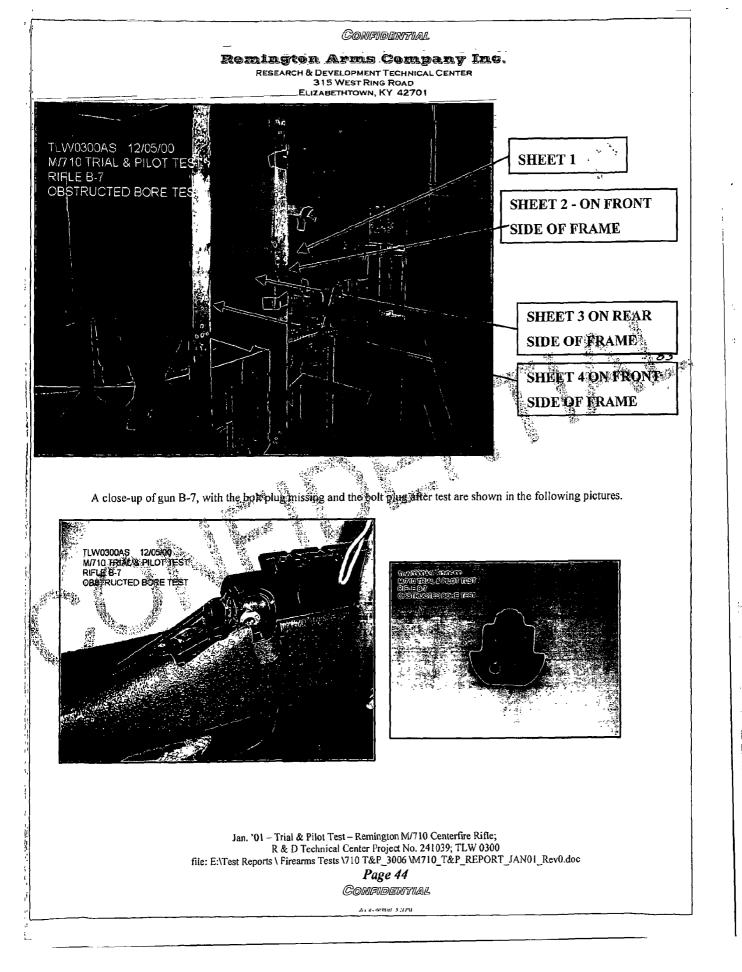

Remington Arms Company Inc.

RESEARCH & DEVELOPMENT TECHNICAL CENTER
315 WEST-RING-ROAD,
ELIZABETHTOWN, KY 42701

In order to determine the energy in the bolt plug the following information is required:

- Weight/Mass of part
- Velocity of part

The weight was measured on a precision scale as 155.1 Grains. This can be converted to mass units by converting grains to pounds and then using the equation W = mg where W is weight in lbs., m is mass in lbs.-sec.^2/ft. and g is acceleration due to gravity in ft./sec.^2:

The average velocity is determined from the distance traveled divided by the time required to travel this distance. A string was used to determine the distance from the original location of the part on the rifle to the hole in the first sheet of paper. This distance was measured to be 19.75 inches. The time required to travel this distance was taken from the high speed movie and was determined to be .040 sec.

The calculated average velocity of the bolt plug was:

Vavg. =
$$\Delta S/\Delta t = 19.75$$
 in./. 040 sec. = 494 in./sec. or 41.15 ft./sec.

From this data the calculated kinetic energy could be determined by the equation

K.E. =
$$\frac{1}{2}$$
 * Mass* Velocity*Velocity = $\frac{1}{2}$ * m*V^2

K.E. =
$$\frac{1}{2}$$
(.0006887 lb.-sec.^2/ft.)(41.15 ft./sec.)*(41.15 ft./sec.) = .58 lb:-ft.

For comparison purposes this same kitteric energy level can be obtained by dropping the same bolt plug piece a distance of 26.3 ft. or dropping a 1 lb. weight a distance of .584 ft. (2 inches). This was calculated using the relationship between kinetic energy and potential energy assuming no less in yellowing due to air testance.

For comparison purposes a table was generated listing kinetic energy levels of other common projectiles.

Description	Kinetic Energy (lbft.)			
Bolt Ping from obstructed bore test	.58			
	1.00			
BB filed from a Daisy Red Ryder (at the muzzle) 50-Grain paintball fired at 300 ft./sec.	10.40			
150 Grain .30-06 caliber bullet (at the muzzle)	2820.00			

In conclusion the calculated bolt plug kinetic energy is approximately ½ (50 %) of a BB fired from a BB gun, 1/20th (5 %) of a paintball fired at maximum allowable velocity and 1/4862 (.02 %) of a 150 grain .30-06 caliber bullet at the muzzle.

Jan. '01 – Trial & Pilot Test – Remington M/710 Centerfire Rifle; R & D Technical Center Project No. 241039; TLW 0300 file: E:\Test Reports \ Firearms Tests \ 710 T&P_3006 \ M710_T&P_REPORT_JAN01_Rev0.doc

Page 45

CONFIDENTIAL

and a water 5 at the