

Remington Arms Co., Inc.
Product Service
Legal Case #:5740

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
220003	1/21/2011	1/24/2011	1/24/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Clint Feland Inc.	---	Clint Feland In	306 Main	New Salem	ND	58563		W 701-843-7533

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4038	Could Not Duplicate Concern		
S	Concern:1007	Fired on Safe Release	Unknown	
C	FSR			

Dealer sent gun in with a note. Dealer stated the customer claimed rifle went off 3 times when he pushed the safety off when it was cold. df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/223 REM	84370	G6883375	OD	7/27/2009 8:46:26 PM
Date Purchased	Where Purchased	Accessories	Original Owner			
	CSI SPORTS, LLC		U			

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion - Check over completely @ n/c	Repair/Replacement Cost	Repair/Replacement Date				
	\$27	2/7/2011				

Per Ilion - Could not duplicate concern. TA functions as designed. Check over completely, clean & test fire at n/c - warranty. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/24/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	

Barrel	Description		22" 223 REM VTR BRAKE
	Date Code		OD
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		XMP SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	L011
	Notch	Like new; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Like new; Functioning	
	Pull	---Select---	3.5#
	Altered	False	
	Sub-Assembly	X-Mark Pro	

the customer said
this rifle
went off three
times when he
pushed the safety
ahead, when it
was cold. please
repair & return

Clint feland clu.
306 main
New Salem, N.D.
58563


701-843-7533

(Signature)

www.lafargenorthamerica.com

Serial
G6883375

Model: 700

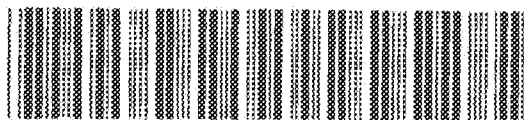

RE00220003

5740

22"
007/09
3.5th
011

could not duplicate concern
T.A. functions as designed.
check over completely, clean &
test fire at N/C
WARRANTY.

RECEIVED
MAR 25 2009
G.S.

