#### BARBER - Kinzer PPS GAL RE 0009725

Remington Arms Co., Inc. **Product Service** 

Legal Case #:5062

Case Information

RE# Date Opened 12/13/2010

Date Opened(PS) 11/11/2010

**Date Closed** 12/15/2010

**Incident Date** 

Pre Lit Lit Obsolete

214439 Customer Information

Type Business First Name Last Name

Street

City State Zip Age

Contact

H 305-662-1201

Incident

Rene

6315 Maynada St. Coral Gables FL 33146 Arencibia

C 786-493-4753

F 305-373-7593 E rene6315@yahoo.com

Incident Information

Claims

Codes

Repair Est.

Medical Treatment Medical **Status** 

ΡI

PD S

Cause: 4038 Could Not Duplicate Concern

Concern:1025 Unexplained Discharge - No Mention of Safety Position

Unknown

Unexplained C Discharge

11/11/10: Customer called in. He saw the media info & is upset we are not replacing triggers outright. He was hunting 10 yrs ago & he stated the rifle fired by itself. He doesn't remember the circumstances. df

Firearm Information

Mfg.

Type

Model/Ga.

SKU

Serial Bbl.

DOM

Remington

CF/BA

700/338 WIN MA Accessories

n/a Original Owner S6251920 DO 9/26/1994

**Date Purchased** 

Where Purchased JERRYS SPORT CENTER INC

SCOPE BASE

Y

CONCERN: FIRED OPENING THE BOLT

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement

Release of Claims

**Release Date** 

Reimbursement

Cash Settlement Reim. Date

APV

Cash Date APV

Per Ilion - Quote to repair

Repair/Replacement

Repair/Replacement

11/11/10: Sending ARS, ltr, form & box. Box order# 1158611. df 12/31/10: Per llion - Could not duplicate concern. To restore confidence in rifle can offer to replace TA, clean & test fire at 1/2 normal cost. Customer apprvd quote & paid by credit card.

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		12/15/2010

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=5062&Type=Case

12/31/2010

# BARBER - Kinzer PPS GAL RE 0009726

	Product Type		RF
Examination	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		24" 338 WIN MAG
	Date Code		DO
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		•
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	SOME LITE RUST ON F.P. HEAD
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
• •	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/700 SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	Select	.017
	Notch	Like new; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Like new; Functioning	
	Pull	Select	3.5#
	Altered	True	PULL SCREW ALTERED
	Sub-Assembly	M/700 Non-Bolt Lock	
Non-Remington Components	Description		SCOPE BASE

5062

COPY

24" D09/9" 3,5"

November 11, 2010

Rene Arencibia 6315 Maynada St. Miami, FL 33146 Ph: 786-493-4753

Ref: #5062

Dear Mr. Arencibia,

Enclosed is a prepaid UPS shipping label to cover shipment of your firearm to our factory for examination.

Please include a copy of this letter to put inside the shipping container. The letter inside is important as sometimes the outside label gets damaged in transit and we want to be sure the firearm is logged in correctly. Mark the ends of the box with "Product Service". Product Service will be inspecting the firearm and will contact me with the results.

I hope that this action will keep you a loyal Remington, H&R customer.

Sincerely, D. Fulcher Consumer Affairs Administrator Remington, H&R, Marlin Phone: 1-800-243-9700

Fax: 336-548-7872

enclosure

could not duplicate concern.
To restone confidence on rifle
can offen to replace TDA, clean
allest fine At 1/2 wormal cost.

DEC 2 2 2010

Remington Arms Company, Inc. • 870 Remington Drive • P.O. Box 700 • Madison; NC. 27025

Phone 800-243-9700 • www.remington.com


Print

Reset

Model	Serial					
Number: 700 SS	Number: 5 625 1920					
Are you the original owner?:						
Name: Rene Arencibia	Date of Purchase:					
Address (no PO Boxes): 6315 Maynada Street						
City: Coral Gables	<b>State:</b> FL <b>Zip:</b> 33146					
Phone (Daytime): 786-493-4753	Fax: 305-373-7593					
E-mail Address:(if e-mail address is provid be sent) rene6315@yahoo.com	ed, notification of receipt and shipment will					
E-mail A	· · · · · · · · · · · · · · · · · · ·					
☐ I would like to receive future e						
One time when I was in the range sighting in the rifle before the trip I did experience a shot fired without me pulling the trigger I was in the process of taking out a shell from the chamber and when I was opening the bolt with the safety ON the gun went off, thank God the line was HOT a everybody was behind the line.  Pluse Replace TRUGGER DON'T FLET SAFE Using Thanking There  2 characters left						
Ammunition I	nformation:					
Manufacturer: Remington/Federal/Winches	Type: various					
Other (i.e. bullet weight/type, shot size, powder): 180-225gr						
Handload Information:						
Powder Used:	Powder Weight:					
Case/Hull Used:	Primer Used:					
Bullet Type/Shot Size:	Reloader Used:					
Firearms Care (Cleani	ng and Lubrication):					
Brand of cleaning solution used: hoppe						

http://www.remington.com/asp/factory\_repair\_form.asp

11/16/2010

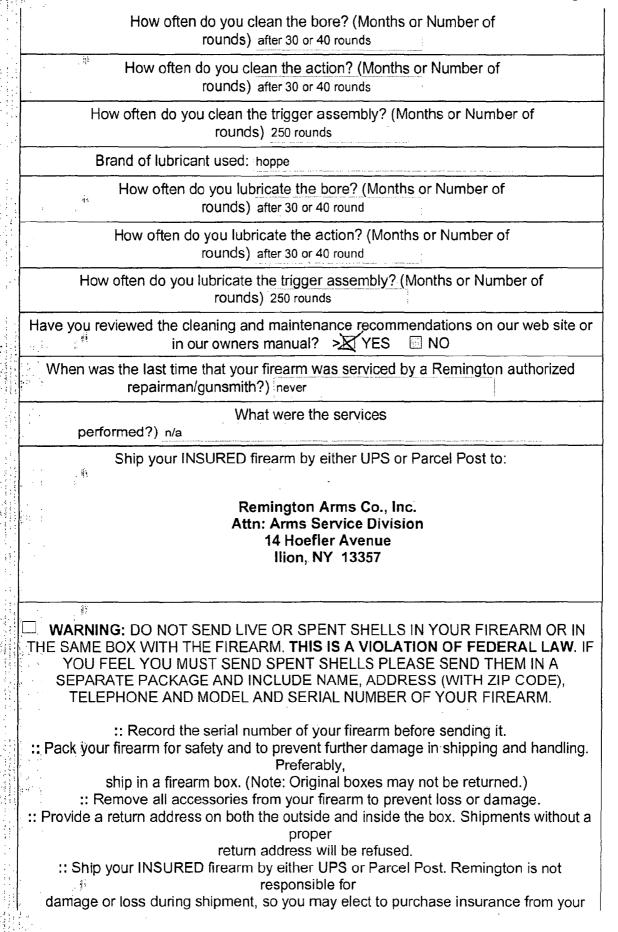

http://www.remington.com/asp/factory repair form.asp

11/16/2010

. #

carrier.

- Charge repairs will be processed using the following guidelines:
- :: Repairs \$75.00 and under will be completed and returned to you C.O.D. (To avoid C.O.D. Charges, please include your credit card number and expiration date with your gun)
- :: For Repairs over \$75.00, you will receive a written estimate detailing the nature of the repair, applicable taxes and shipping. You will have 30 days to approve the repair estimate. Repairs can be paid by check, money order, or credit card (American Express, Discover, MasterCard, or VISA). If you wish, you can expedite repairs over \$75.00 by setting a pre-authorized amount that can be billed to your credit card. We process checks electronically through Check21.



Remington Arms Company, Inc. 870 Remington Drive P. O. Box 700 Madison, NC 27025-0700

# ARS LABEL REQUEST FORM

DATE:		11/12/2010	REQUESTED BY:	Dell
QUANTITY: 1		WEIGHT PER PACKA(10 lbs		
PLEASEICHEGRIONE MEDIA COORDINATOR TO MAIL			I WILL MAIL	XXXXX
DESCRIPTION:	Ref# 5062 Rifle			

#### LABEL INFORMATION

MAIL LABEL TO: Rene Arencibia
6315 Maynada St.
Miami, FL 33146
Ph: 786-493-4753

RETURN ITEM TC Remington Arms
Attn: Product Service
Ilion, NY

### \*PLEASE COMPLETE: ALL PARTIS OF THIS FORM! AND SEND TO THE MEDIA COORDINATION: \*\*\*\*\*

4XX596 NOV 12, 2010 ALL CURR USD SVC GNDCOM ACT WT 10.0 LBS
TRACKING# 1Z4XX5969067134537
REF 1:RENE ARENCIBIA/CD/DMF
REF 2:5062/RIFLE 4XX596 SVC GNDCOM 1 OF 1 HANDLING CHARGE 0.00 SINGLE-PIECE PUB RATE CHRGS: SVC T/P USD DV 0.00 DC 0.00 COD RS 0.50 SD 0.00 0.00 0.00 AH 0.00 PR 0.00 0.00 TOT PUB CHG 9.45 PUB+HANDLING

