Н	
Η	
Ħ	
0	
0	
H	
H	
J	
\vdash	
∞	
J	

Su		Test + Proof Failures Total Rejected: Överall Reject Rate:	15053 1373 9.12							
	Proof	Shot:	1878	635		315	2507	1452	509	2516
	Proof	Shot: Rejected:	1	3		1	13	1	2	23
	Proof	Percent	0.1	0.5		0.3	0.5	0.1	0.4	0.9
		Shot	1628	534		728	2366	1303	373	2787
	Test	Rejected:	70	34		84	180	67	16	306
	Test	Rejected: Rejected: Percent: Shot: [Rejected: Percent: Shot: [Rejected:	4.3	6.4	ě.	11.5	7.6	5.1	4.3	11.0
		Shot:	137	39		63	163	62	371	116
	Target		0	<i></i> 0	*******	0	0	0	67	0
	3 3	Percent:	0.0	0.0		0.0	0.0	0.0	18.1	0.0

CODE	MALFUNCTION INDEX	700 S PS	700 SPS SS	700 BDL & ADL & ADL	700 SS	700 CDL	700 POLICE	MODEL 7
		. 1600						
AB	Action binds						20a	
BABS	Bulge at body shoulder							
BAC	Burr at chamber	2	1	Y	13	ē		14
BBMA	BBL-to-bolt misalignment			**				
BB	Bolt binds/catches	3	7	24	32	# 7		9
BCOBS	Boit catches on boit stop					*****		
BCOF	Bolt catches on follower				2	4	4	
BC	Blows cases							
BHR	Bolt hits receiver				***************************************			
BHS	Bolt plug hits safety switch							7444
BLOP	Bar lock or disconnector out of position							
BLSO	Barrel lug shot off							
BPO	Boit pulls out				-	1		
BSSM	Bolt stems shell in magazine							
BWCD	Boit won't carn down			1	-			
BWCFM	Boit won't close over full magazine	1		4	1			
CD	Case dented							

CODE	MALFUNCTION INDEX	700 SPS	700 SPS SS	700 BDL & ADL & ADL	700 SS	700 CDL	700 POLICE	MODEL 7
CH	Closes hard		2	4	5	6		1
CLM	Can't load magazine		2	1	1			
co	Cut-off	************************************						
CR	Cutsrim							
cs	Cases swell							
стов	Chamber torn or gouged							
СТР	Creepy trigger pull	· · · · //						
CWSB	Cams wrong side of action bar				80			
DBB	Doesn't blow back							
DCS	Double click in safety switch	*****			***************************************	28		
DCT	Double click in trigger							
DCU	Doesn't close-up				***			1
DE	Doesn't eject	5	1	***************************************				. 1
DEL	Doesn't eject live round	2		1	25			<i>i</i>
DFB	Doesn't feed back				3000			
DFU	Doesn't feed up							J.
DLO	Doesn't lock open (after last shell)					.,		
DLU	Doesn't lock-up					Ą		
DS	Dead safe			1		1	48	53
DX	Doesn't extract	1		3	1	3		2
DXL	Doesn't extract live round							
EDS	Extractor drops shell	1	2	3	12	2	11	1
ESB	Ejector sticks back		4		2	10		19
ESCR	Empty shell catches receiver							
ESS	Extractor stems shell							_
FA	Fires automatically							
FB	Follower binds							

H	ł
_	i
Ļ	:
	1
C)
C)
F	1
H	1
_	1
F	1
_	
u)
α ()

***************************************	0000000	_		_	_		_	
CODE	MALFUNCTION INDEX	700 SPS	700 SPS SS	700 BDL & ADL & ADL	700 SS	700 CDL	700 POLICE	MODEL 7
FC	Fails to connect				-			
FCB	Fore-end cracked or broken							
FD	Fallows-down							
FF	Falls to fire							
FFP	Flat firing pin							
FOS	Fires on safe			·.				
FPHB	Firing pin hits bbl							
FPHI	Firing pin hits inside rim				ć			
FPO	Floor plate opens	27	1	8	11.		1	1
FPOH	Floor plate opens hard	****				*		
FSR	Fires when safe is released							
FT	Follower tips	2	,,	2	6////			19
GCSO	Gas cyl shot off							v.
HBL	Heavy bolt lift	1		8	4			<i>‱7</i>
HMSC	Heading mismatch-steps on case							
HPA	High pressure ammo							
HUR	Hard under rail				4	,		9 🐰
JCS	Jumps cartridge					Ÿ		
JM	Jumps magazine			9	***************************************	2	444	
JO	Jars off							
LB	Light blow				-			
MAH	Magazine assembles hard							
MCW	Magazine capacity wrong			4	***************************************			
MFA	Misfires (ammo)							
MFOP	Magazine follower out of position							
ML	Magazine loose							
MLH	Magazine loads hard							

۲	
t	ł
ŀ	1
C)
C)
۲	1
H	1
-	J
۲	1
U)
C)_

	//////////////////////////////////////				_			
CODE	MALFUNCTION INDEX	700 SPS	700 SPS SS	700 BDL & ADL & ADL	700 SS	700 CDL	700 POLICE	MODEL 7
MARH	Magazine removes hard							
ОН	Opens hard	2						3
OR	Over-rides	1	2		2			50
PH	Pulls hard				-			
PSI	Proof stamp:#legible				***			
PSM	Proof stamp missing							
RBOC	Rings and bulges on case	777			37 FARRAMAN			3
RDW	(Action) release doesn't work				doc.			
RIC	Rings in chamber	/4/			40	4		12
RIS	Ring in sholder				13	· 2		24
RS	Rim srem			/////				
SBC	Stems bottom chambers							22
SBE	Stems bbl extension			***///				is.
SCB	Stock cracked or broken			7.4			////	<i>2</i>
scx	Shell catches							
SHI	Short indent				***			
SI	Stems incline	5		5	2	,,		12
SIC	Stems in chamber				4	÷		1
SL	shaves lead				TARRAGA PARAGA			
SLC	Stems left side of chamber				-			****
SMOC	Stretch marks on case	9			-			
SOR	Stem over-ride	2	8		***********			22
SP	Stems port				***************************************			
SR	Shoulder rough				***************************************			
SRC	Stems right side of chamber							
SRIC	Specific rings in chamber							
ssoc	Surface scratches on case							

	///00000/ 							
CODE	MALFUNCTION INDEX	700 SPS	700 SPS SS	700 BDL & ADL & ADL	700 SS	700 CDL	700 POLICE	MODEL 7
STC	Stems top chamber							1
SWE	Safety switch works too easily			2		2		4
SWH	Salety switch works loo hard	2	4					4
sww	Safety ewitxh won't work							
TD	Tips down	""	2000					
TU	Tips up			٠.				
TWP	Trigger won't pull							
TWR	Trigger won't retract				Št			
UNCN-T	Uncoded							
XH	Extracts hard	*****		A //	4	₂₀ 13		11
				/////				
Н	High							
LO	Low			***///	###			is.
LEFT	Left			7.4				
RIGHT	Right				****			
DG	Doesn't Group						67	
FSST	Front sight tipped							
RSTT	Rear sight tipped					Ŷ		
RSBR	Rear sight base raised						///	
FSTR	Front sight raised							***//
FSTL	Front sight loose							
RSTL	Rear sight loose							
MGPT-G	Missing parts at target							
UNCN-G	Uncoded nonconformity at target							
AI-P	Assembly incompleye at proof							
BBB	Barrel bracket cracked or broken at proof							

۲	ı
۲	ŧ
	1
L	•
C	•
H	1
H	1
_	J
H	1
Ľ)
Ī	_

CODE	MALFUNCTION INDEX	700 SPS	700 SPS SS	700 BDL & ADL & ADL	700 SS	700 CDL	700 POLICE	MODEL 7
BC-P	Blows cases at proof							
BEB-P	Barrel extension broken at proof							
BLP-P	Blanked primer at proof							
BLSO-P	Barrel lug shot off at proof							
BP-P	Blown primer at proof		200					
BS-P	Barrel split at proof							
DLOS-P	Doesn't lock over shells at proof							
ESB-P	Ejector sticks back at proof				dec.			2
FCB-P	Fore-end cracked at proof							
FESO-P	Fore-end shot off at proof	****		<i>2</i>		Ška		
FF-P	Fails to fire at proof	****		1		1		
GCSO-P	Gas cylinder shot off at proof		,-					
MSI-P	Magnaflux stamp illegible on bbl				###			· ·
MSM-P	Magnaflux stamp missing on bbl			****	<i>2.</i> /////			1 11000
PP-P	Pierced primer at proof							
SCB-P	Stock cracked or broken at proof							/////
UNCM-P	Uncoded proof malfunctions	1	3	_	12		2	21

Н
H
H
0
0
H
H
J
H
Ø
W

<u> </u>						totals	700 totals	New Gen totals
2527	1386	51	612	813	120	15321	12339	2862
13 0.5	23	0	46	0	0	124	57	67
0.5	15	0.0	7.5	0.0	0.0	0.8	0.5	2.3
2643	1475		620	352	120	14929	28230	2447
156	79	0	20	32	1	1045	913	131
5.9	5.4		3.2	91	0.8	7.0	3.2	5.4
2312	50		78	743		4134	8131	871
92	0	0	<i>0</i>	45	0	204	159	45
4.0	0.0		0.0	6.1		4.9	2.0	5.2
XR-100	7400	7500	7600	7615	Rimfire	totals	totals	totals
							2000	.,.
	1		3	10	reserving a	15		14
					*			
2			1			40	39	1

XR-100	7400	7500	7600	7615	Rimnre	totals	totals	totals
						200000000000000000000000000000000000000	2000	
	1		3	10	ľ	15		14
2			4			40	39	1

31						123	123	
					-		***	
						6	6	
1						2	2	
,				*			_	
						1	1	
				#		6	6	

												e e e e e e e e e e e e e e e e e e e		otišš	2000					
totals							**			20			5	15		13	1	1		
totais	105	4			***		.8.8.		•		87				92	10	42	36		
totals	105	7			-		н.		2	12	- \$Z		5	15	99	23	43	37		
Rimfire				ă.																
7615							ine ine			o										
7600						*							4	****						
7500																				
7400									***	âun.			4	14		13	1	-		
XR-16B	200				+												10			

XR-160	7400	7500	7600	7615	Rimfire	totals	totals	totals
	****	9000 2000000						
V 20000000	1		226ca.		***	1		1
1						1	1	
	1			1		2		2

						49	49	
								2000
						29	29	
					***	· · · · · · · · · · · · · · · · · · ·		
						21	21	
					7			
					4			
	¥ 04140				A 100	13	13	
					*			
	2		9			22	11	11
	***************************************				***************************************			
1						1	1	
	<u> </u>						1	

			2			2	1	2
	<u> </u>				<u> </u>			-

	2/00 000 00/							
XR-160	7400	7500	7600	7615	Rimfire	totals	totals	totals
	2					2		2
1					-	6	6	
****			2	3		60	55	5
					60a.			
	100					1	***************************************	1
		****				3	3	
14	5		1			77	71	6
				3		42	39	3
					, ,	22	22	


	1					1		1


	***			5		29	24	5
	***************************************					1	1	3,000


						9	9	
	10					42	32	10
				*				


XR-160	7400	7500	7600	7615	Rimfire	totals	totals	totals
						1	1	
						8	8	
3				v		13	13	


					/////		****	
3						38	38	
								2000
	<u> </u>			6	<i>#</i>	6		6
	***************************************			5	****	5		5
				14		14		14
				4		4		4
92						159	159	
	*			2		2		2
				1		1		1
				12		12		12
				1		1		1

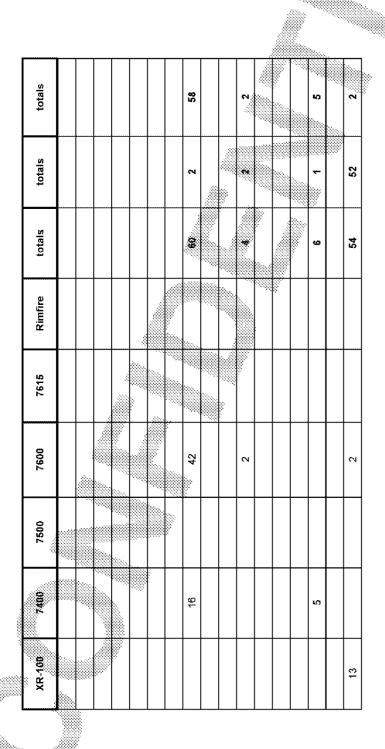

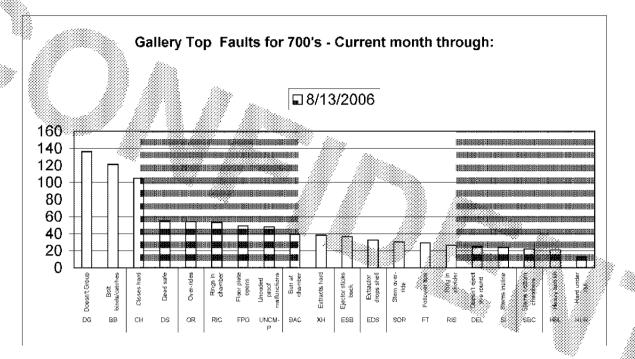


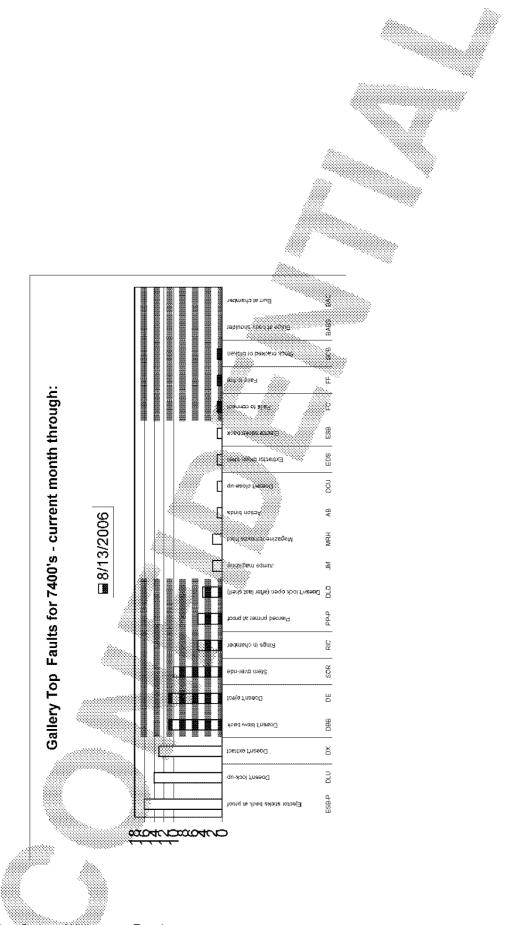

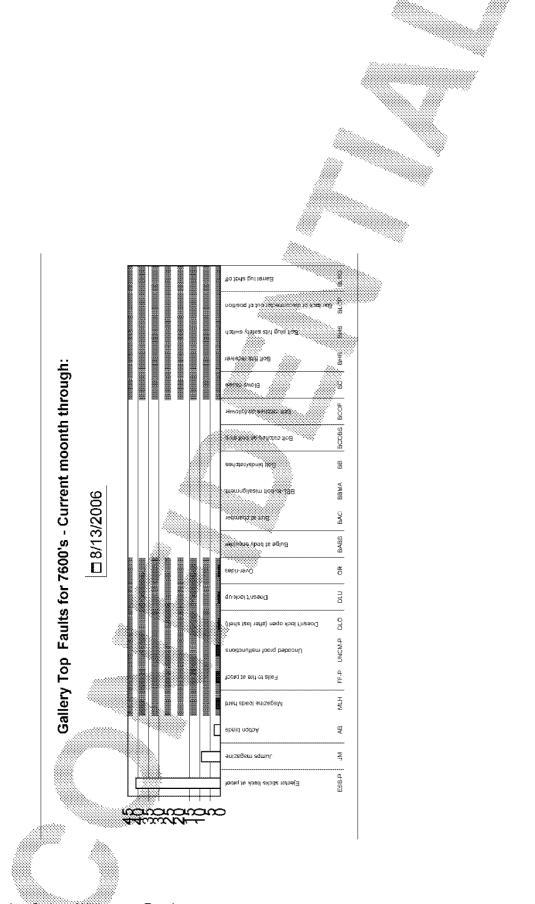

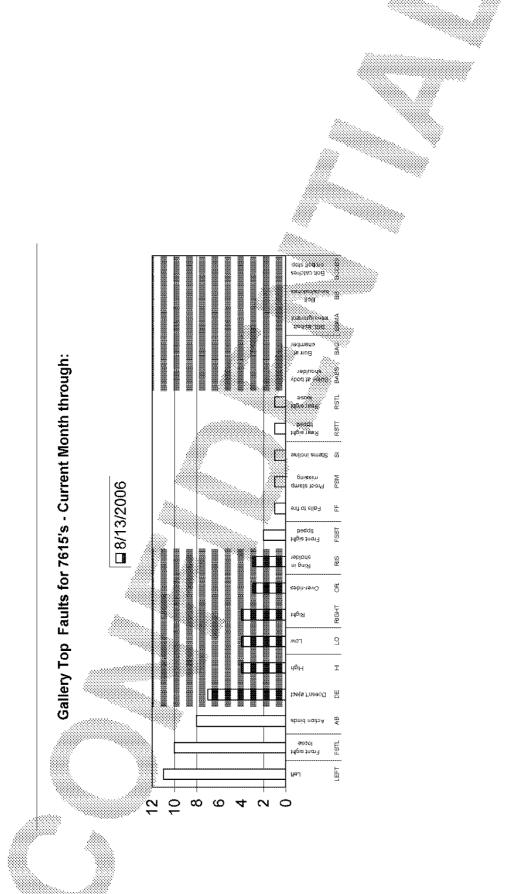

DG	Doesn't Group
BB	Bolt binds/catches
CH	Closes hard
DS	Dead safe
OR	
**********************************	Over-rides
RIC	Rings in chamber
FPO	Floor plate opens
UNCM-P	Uncoded proof malfunctions
BAC	Burr at chamber
XH	Extracts hard
ESB	Ejector sticks back
EDS	Extractor drops shell
SOR	Stem over-ride
FT	Follower tips
RIS	Ring in sholder
DEL	Doesn't eject live round
SI	Stems incline
SBC	Stems bottom chambers
HBL	Heavy bolt lift
HUR	Hard under rail
JM	Jumps magazine
SWH	Safety switch works too hard
DX	Doesn't extract
SMOC	Stretch marks on case
SWE	- CHILLICH CONTROL
	Safety switch works too easily
BWCFM	Bolt won't close over full magazine
DE	Doesn't eject
OH .	Opens hard
CLM	Can't load magazine
RBOC	Rings and bulges on case
BCOF	Bolt catches on follower
BPO	Bolt pulls out
ESB-P	Ejector sticks back at proof
FF-P	Fails to fire at proof
CTOG	Chamber torn or gouged
DCU	Doesn't close-up
FD	Follows-down
LB	Light blow
SIC	Stems in chamber
STC	Stems top chamber
PP-P	Pierced primer at proof
AB	Action leaves
BABS	Bulge at body shoulder
BBMA 3	BRI to bott medianout
BCOBS	BSL-to-bolt misalignment
	Bolt catches on bolt stop
BC BUB	Blows cases
BHR	Bolt hits receiver
BHS	Boll plug hits safety switch
BLOP	Bar lack or disconnector out of position
BLSO BSSM	Barrel lug shot off
	Bolt stems shell in magazine




[But on	
BWCD	Bolt won't cam down
CD	Case dented
CO	Cut-off
CR	Cuts rim
cs	Cases swell
CTP	Creepy trigger pull
CWSB	Cams wrong side of action bar
DBB	Doesn't blow back
DCS	Double click in safety switch
DCT	Double click in trigger
DFB	Doesn't feed back
DFU	Doesn't feed up
DLO	Doesn't lock open (after last shell)
DLU	Doesn't lock-up
DXL	Doesn't extract live round
ESCR	Empty shell catches receiver
ESS	Extractor stems shell
FA	Fires automatically
FB	Follower binds
FC	Fails to connect
FCB	Fore-end cracked or broken
IFF	Fails to fire
FFP	Flat firing pin
FOS	Fires on safe
FPHB	Firing pin hits bbl
FPHI	Firing pin hits inside aim
FPOH	
FSR	Floor plate opens hard
	Fires when safe is released
GCSO	Gas cyl shot off
HMSC	Heading mismatch-steps on case
HPA	High pressure ammo
JCS	Jumps cartridge
JO	Jars off
MAH	Magazine assembles hard
MCW	Magazine capacity wrong
MFA	Misfires (ammo)
MFOP	Magazine follower put of position
ML	Magazine toose
MLH	Magazine loads hard
MRH	Magazine removes hard
PH	Pulls hard
PSI	Proof stamp illegible
PSM	Proof stamp missing
RDW	(Action) release doesn't work
RS	Rim siem
SBE	Stems bbl extension
SCB	Stock cracked or broken
SCX	Shell catches
SHI	Short indent
SL	shaves lead
SLC	Stems left side of chamber
YLY NOW	Lorenta telesina oi citampei



,	
SP	Stems port
SR	Shoulder rough
SRC	Stems right side of chamber
SRIC	Specific rings in chamber
SSOC	Surface scratches on case
SWW	Safety ewitxh won't work
TD	Tips down
TU	Tips up
TWP	Trigger won't pull
TWR	Trigger won't retract
UNCN-T	Uncoded
н	High
LO	Low
LEFT	Left
RIGHT	Right
FSST	Front sight tipped
RSTT	Rear sight tipped
RSBR	Rear sight base raised
FSTR	Front sight raised
FSTL	Front sight loose
RSTL	Rear sight loose
MGPT-G	
UNCN-G	Missing parts at target Uncoded nonconformity at target
UNCIN-G	Uncoded nonconformity at larger
AI-P	Assembly incompleye at proof
BBB	Barrel bracket cracked or broken at proof
BC-P	Blows cases at proof
BEB-P	Barrel extension broken at proof
BLP-P	Blanked primer at proof
BLSO-P	Barrel lug shot off at proof
BP-P	Blown primer at proof
BS-P	Barrel split at proof
DLOS-P	Doesn't lock over shells at proof
FCB-P	Fore-end cracked at proof
FESO-P	Fore-end shot off at proof
GCSO-P	Gas cylinder shot off at proof
MSI-P	Magnattux stamp illegible on bbl
MSM-P	Magnaflux stamp missing on bbl
SCB-P	Stock cracked or broken at proof
GOD"F	Lender et acken outer attende binon



8/13/2006

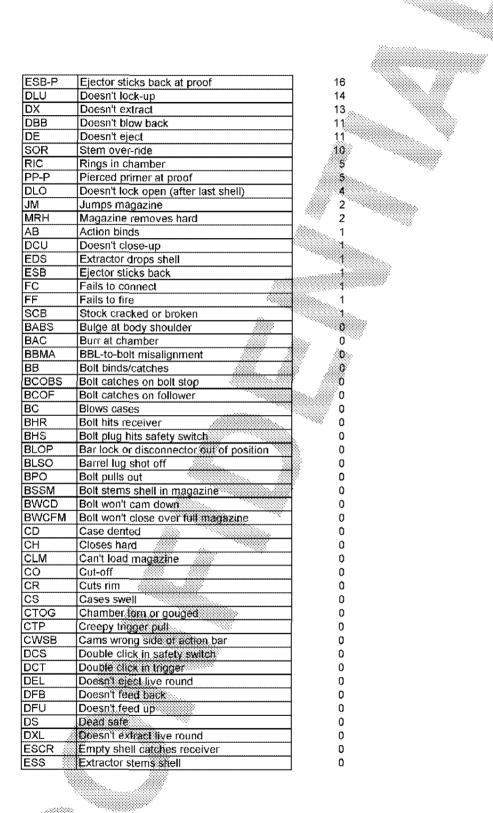


FA	Fires automatically	
FB	Follower binds	
FCB	Fore-end cracked or broken	
FD	Follows-down	
FFP	Flat firing pin	
FOS	Fires on safe	
FPHB	Firing pin hits bbl	
FPHI	Firing pin hits inside rim	
FPO	Floor plate opens	
FPOH		
FSR	Floor plate opens hard	:
FT	Fires when safe is released	de
	Follower tips	
GCSO	Gas cyl shot off	. seedle
HBL	Heavy bolt lift	
HMSC	Heading mismatch-steps on case	55555
HPA	High pressure ammo	
HUR	Hard under rail	
JCS	Jumps cartridge	46
JO	Jars off	
LB	Light blow	
MAH	Magazine assembles hard	
MCW	Magazine capacity wrong	
MFA	Misfires (ammo)	3
MFOP	Magazine follower out of position	
ML	Magazine loose	
MLH	Magazine loads hard	10
ОН	Opens hard	·.
OR	Over-rides	
PH	Pulls hard	
PSI	Proof stamp illegible	8
PSM	Proof stamp missing	9
RBOC	Rings and bulges on case	
RDW	(Action) release doesn't work	
RIS	Ring in sholder	
RS	Rim srem	
SBC	Stems bottom chambers	
SBE	Stems bbl extension	
SCX	Shell catches	
SHI	Short indent	
SI	Stems incline	
SIC	Stems in chamber	
SL	shaves lead	
SLC		
	Sterns left side of chamber	
SMOC	Stretch marks on case	
SP	Stems port	
SR	Shoulder rough	
SRC	Stems right side of chamber	
SRIC	Specific rings in chamber	
SSOC	Surface scratches on case	
STC	Stems top chamber	
SWE 🛞	Safety switch works too easily	
183	000000. 000000°	

71 5 D 4 4		
SWW	Safety ewitxh won't work	l
TD	Tips down	l
TU	Tips up	l
TWP	Trigger won't pull	l
TWR	Trigger won't retract	
UNCN-T	Uncoded	
XH	Extracts hard	
HI	High	
LO	Low	
LEFT	Left	
RIGHT	Right	8
DG	Doesn't Group	l
FSST	Front sight tipped	l
RSTT	Rear sight tipped	
RSBR	Rear sight base raised	
FSTR	Front sight raised	R
FSTL	Front sight loose	
RSTL	Rear sight loose	
MGPT-G	Missing parts at target	
UNCN-G	Uncoded nonconformity at target	l
		ľ
Al-P	Assembly incompleye at proof	ŀ
BBB	Barrel bracket cracked or broken at proof	ŀ
BC-P	Blows cases at proof	
BEB-P	Barrel extension broken at proof	ļ
BLP-P	Blanked primer at proof	ŀ
BLSO-P	Barrel lug shot off at proof	
BP-P	Blown primer at proof	ŀ
BS-P	Barrel split at proof	ľ
DLOS-P	Doesn't lock over shells at proof]
FCB-P	Fore-end cracked at proof	l
FESO-P	Fore-end shot off at proof	
FF-P	Fails to fire at proof	
GCSO-P	Gas cylinder shot off at proof	l
MSI-P	Magnaflux stamp illegible on bbl	
MSM-P	Magnaflux stamp missing on bbl	l
		1
SCB-P	Stock cracked or broken at proof	l




ESB-P	Ejector sticks back at proof	i
JM	Jumps magazine	l
AB	Action binds	l
MLH	Magazine loads hard	l
FF-P	Fails to fire at proof	ı
UNCM-P	Uncoded proof malfunctions	
DLO	Doesn't lock open (after last shell)	
DLU	Doesn't lock-up	
OR	Over-rides	
BABS	Bulge at body shoulder	
BAC	Burr at chamber	
BBMA	BBL-to-bolt misalignment	ś
вв	Bolt binds/catches	S.
BCOBS	Bolt catches on bolt stop	
BCOF	Bolt catches on follower	١.
BC	Blows cases	300
BHR	Bolt hits receiver	
BHS	Bolt plug hits safety switch	8
BLOP	Bar lock or disconnector out of position	
BLSO	Barrel lug shot off	33
BPO	Bolt pulls out	
BSSM	Bolt stems shell in magazine	200
BWCD	Bolt won't cam down	ř
BWCFM	Bolt won't close over full magazine	
CD	Case dented	
CH	Closes hard	
CLM	Can't load magazine	l
CO	Cut-off	
CR	Cuts rim	
cs	Cases swell	
CTOG	Chamber torn or gouged	1
CTP	Creepy trigger pull	
CWSB	Cams wrong side of action bar	
DBB	Doesn't blow back	
DCS	Double click in safety switch	
DCT	Double click in trigger	
DCU	Doesn't close-up	
DE	Doesn't ejeat	
DEL	Doesn't eject live round	
DFB	Doesn't feed back	
DFU	Doesn't feed up	ł
DS	Dead safe	i
DX	Doesn't extract	1
DXL	Doesn't extract live round	l
EDS	Extractor drops shell	1
ESB	Ejector sticks back	1
ESCR	Empty shell catches receiver	l
ESS	Extractor stems shell	ł
	Fires automatically	ł
FB	Follower binds	ł
FC S	Fails to connect	ł
10 00		Į




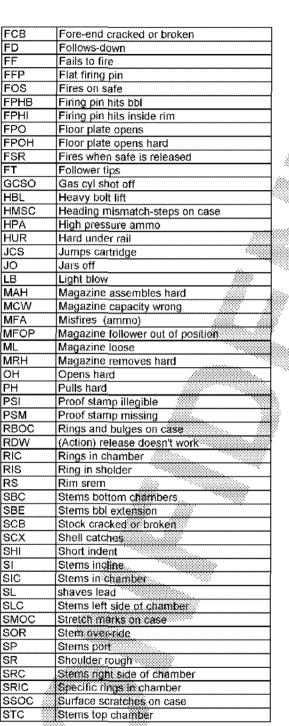

SWE	Safety switch works too easily	1
SWH	Safety switch works too hard	1
sww	Safety ewitxh won't work	1
TD	Tips down	1
TU	Tips up	1
TWP	Trigger won't pull	1
TWR	Trigger won't retract	١
UNCN-T	Uncoded	1
XH	Extracts hard	1
		1
Н	High	1
LO	Low	
LEFT	Left	
RIGHT	Right	1
DG	Doesn't Group	1
FSST	Front sight tipped	1
RSTT	Rear sight tipped	
RSBR	Rear sight base raised	î
FSTR	Front sight raised	1
FSTL	Front sight loose	à
RSTL	Rear sight loose	ľ
MGPT-G	Missing parts at target	1
UNCN-G	Uncoded nonconformity at target	ľ
		ŀ
Al-P	Assembly incompleye at proof	
BBB	Barrel bracket cracked or broken at proof]
BC-P	Blows cases at proof]
BEB-P	Barrel extension broken at proof]
BLP-P	Blanked primer at proof	l
BLSO-P	Barrel lug shot off at proof	ľ
BP-P	Blown primer at proof	ľ
BS-P	Barrel split at proof	
DLOS-P	Doesn't lock over shells at proof	
FCB-P	Fore-end cracked at proof	
FESO-P	Fore-end shot off at proof	
GCSO-P	Gas cylinder shot off at proof	
MSI-P	Magnaflux stamp illegible on bbl	
MSM-P	Magnaflux stamp missing on bbl	
PP-P	Pierced primer at proof	
SCB-P	Stock cracked or broken at proof	1



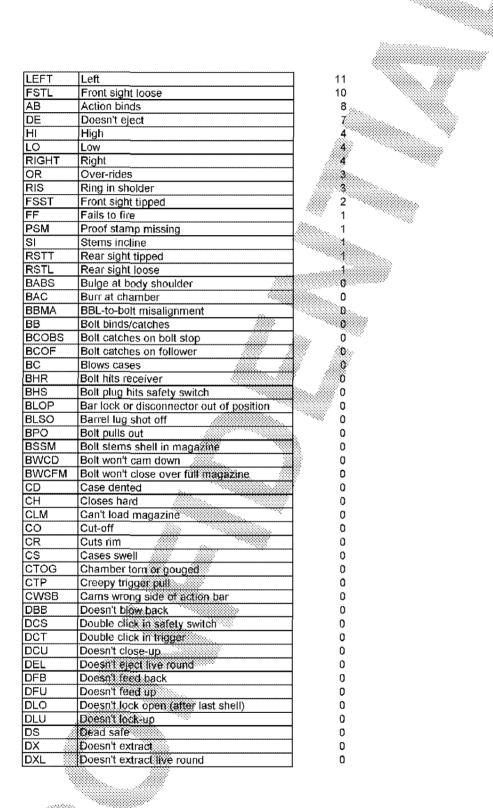

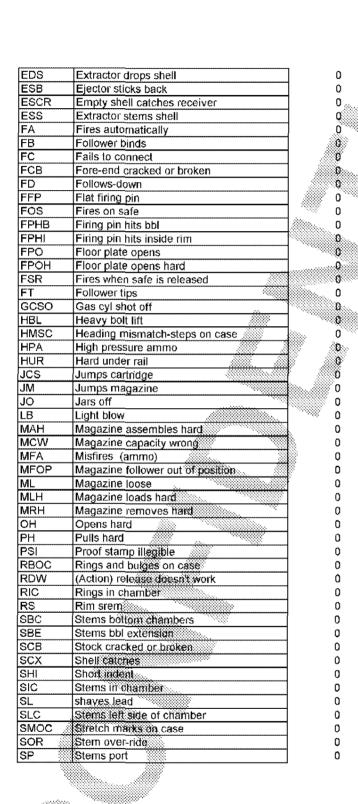

SR	Shoulder rough	
SRC	Stems right side of chamber	
SRIC	Specific rings in chamber	
SSOC	Surface scratches on case	l
STC	Sterns top chamber	l
SWE	Safety switch works too easily	
SWH	Safety switch works too hard	
sww	Safety ewitxh won't work	
TD	Tips down	
TU	Tips up	
TWP	Trigger won't pull	
TWR	Trigger won't retract	0.00
UNCN-T	Uncoded	2
XH	Extracts hard	
DG	Doesn't Group	
RSBR	Rear sight base raised	
FSTR	Front sight raised	
MGPT-G	Missing parts at target	
UNCN-G	Uncoded nonconformity at target	à
Al-P	Assembly incompleye at proof	
BBB	Barrel bracket cracked or broken at proof	ľ
BC-P	Blows cases at proof	ŀ
BEB-P	Barrel extension broken at proof	
BLP-P	Blanked primer at proof	
BLSO-P	Barrel lug shot off at proof	ļ
BP-P	Blown primer at proof	
BS-P	Barrel split at proof	
DLOS-P	Doesn't lock over shells at proof	
ESB-P	Ejector sticks back at proof	ľ
FCB-P	Fore-end cracked at proof	
FESO-P	Fore-end shot off at prepf	
FF-P	Fails to fire at proof	
GCSO-P	Gas cylinder shot off at proof	
MSI-P	Magnaflux stamp illegible on bbl	
MSM-P	Magnaflux stamp missing on bbl	
PP-P	Pierced primer at proof	
SCB-P	Stock cracked or broken at proof	
UNCM-P	Uncoded proof malfunctions	
	<u> </u>	•



	(199999)	33 33 33.									
Summa	ary			roof Failures	981						
			To	tal Rejected:	47						
			Overall	Reject Rate:	4.79						
		Proof		Shot: Rejected:	295	59	3	272	156	10	
	********* I	Proof		Rejected:	a	0	0	0	0	0	0
				Percent: Shot.	0.0	O.O	0.0	0.0	0.0	0.0	
			*	Shot.	249	123	56	171	226		
	•	Test		Shot. Reje cted :	6.	5	Soc. 1	12	10	Đ	0
				Percent: Shot:	6 2.4	4,1	1 1.8	7.0	4.4		
				Shot:	16	10	°‱5	13	6		
	-	Target		Rejected:	0 333	30	 Ø	0 0.0	0	0	0
	•	3		Percent:	0.0	0.0	0.0	0.0	0.0		

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$S	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			********		1 ************************************		X	
AB	Action binds			<i></i>				
BABS	Bulge at body shoulder		vening the same of					
BAC	Burr at chamber		***************************************					
BBMA	BBL-to-bolt misalignment				77.00		2000	
ВВ	Bolt binds/catches	2	3	1	2	- 5		
BCOBS	Bolt catches on bolt stop							
BCOF	Bolt catches on follower						3700	
ВС	Blows cases						8	
BHR	Bolt hits receiver							*****
BHS	Bolt plug hits safety switch							
BLOP	Bar lock or disconnector out of position		-					
BLSO	Barrel lug shot off		***					
BPO	Bolt pulls out		1					
BSSM	Bolt stems shell in magazine		-					
BWCD	Bolt won't cam down							


BWCFM	Bolt won't close over full magazine							
CD	Case dented							
СН	Closes hard		***************************************			3		
CLM	Can't load magazine		***************************************					
со	Cut-off		\$40.					
CR	Cuts rim							
cs	Cases swell							
CTOG	Chamber tom or gouged	···						
CTP	Creepy trigger pull							
CWSB	Cams wrong side of action bar							
DBB	Doesn't blow back	1.400			***			
DCS	Double click in safety switch							
DCT	Double click in trigger							
DCU	Doesn't close-up		***************************************					*** *********************************
DE	Doesn't eject		-	**				
DEL	Doesn't eject live round				******			
DFB	Doesn't feed back							
DFU	Doesn't feed up		historia.					
DLO	Doesn't lock open (after last shell)						2008	
DLU	Doesn't lock-up		***************************************				;	
DS	Dead safe							***//
DX	Doesn't extract				1			
DXL	Doesn't extract live round							
EDS	Extractor drops shell		2		4	1		
ESB	Ejector sticks back							
ESCR	Empty shell catches receiver							
ESS	Extractor stems shell		-					


FA	Fires automatically							
FB	Follower binds							
FC	Fails to comect	,.						
FCB	Fore-end gracked or broken							
FD	Follows-down		\$to.					
FF	Fails to fire		<i>-</i>					
FFP	Flat firing pin							
FOS	Fires on safe							
FPHB	Firing pin hits bbl				800. 800////2000			
FPHI	Firing pin hits inside rim							
FPO	Floor plate opens	3			1	<i>200</i>		
FPOH	Floor plate opens hard						Seo.	
FSR	Fires when safe is released							
FT	Follower tips							
GCSO	Gas cyl shot off			****				
HBL	Heavy bolt lift							
HMSC	Heading mismatch-steps on case							
HPA	High pressure ammo							
HUR	Hard under rail				1		*****	
JCS	Jumps cartridge						ž.	
JM	Jumps magazin e							
JO	Jars off							
LB	Light blow							
MAH	Magazine assembles hard							
MCW	Magazine capacity wrong							
MFA	Misfires (ammo)							
MFOP	Magazine follower out of position							


2000000							
Magazine loose							
Magazine loads hard							
Magazine removes hard							
Opens hard	1						
Over-indes		što.		1			
Pulls hard							
Proof stamp illegible							
Proof stamp missing							
Rings and bulges on case							
(Action) release doesn't work							
Rings in chamber	***			2			
Ring in sholder					1	Sec.	
Rim srem						<i>I</i>	
Stems bottom chambers							
Stems bbl extension			***				
Stock cracked or broken				*****			
Shell catches							
Short indent							
Stems incline						200 B	
Stems in chamber						į.	
shaves lead							*****
Stems left side of chamber							
Stretch marks on case							
Stem over-ride							
Stems port							
Shoulder rough							
Stems right side of chamber					_		
	Magazine loads hard Magazine removes hard Opens hard Over-rides Pulls hard Proof stamp illegible Proof stamp missing Rings and bulges on case (Action) release doesn't work Rings in chamber Ring in sholder Rim srem Stems bottom chambers Stems bot extension Stock cracked or broken Shell catches Short indent Stems in chamber stems in chamber stems in chamber Stems left side of chamber Stretch marks on case Stems port Shoulder rough	Magazine loads hard Magazine removes hard Opens hard Over-indes Pulls hard Proof stamp illegible Proof stamp missing Rings and bulges on case (Action) release doesn't work Rings in chamber Ring in sholder Rim srem Stems bottom chambers Stems bot extension Stock cracked or broken Shell catches Short indent Stems in chamber shaves lead Stems left side of chamber Stems port Stems port Stems port Stems port	Magazine loads hard Magazine tempoves hard Opens hard Over-indes Pulls hard Proof stamp illegible Proof stamp missing Rings and bulges on case (Action) release doesn't work Rings in chamber Ring in sholder Rim srem Stems bottom chambers Stems bbl extension Stock cracked or broken Shell catches Short indent Stems in chamber stams in chamber Stems lead Stems left side of chamber Stems port Stems port Stems port Stems port Stems port	Magazine leads hard Magazine removes hard Opens hard Opens hard Proof stamp illegible Proof stamp missing Rings and bulges on case (Action) release doesn't work Rings in chamber Ring in sholder Rim srem Stems bottom chambers Stems bbl extension Stock cracked or broken Shell catches Short indent Stems in chamber Stems lead Stems left side of chamber Stretch marks on case Stem over-ride Stems port Shoulder rough	Magazine Jeginoves hard Magazine Jeginoves hard Over-indes 1 Pulls hard Proof stamp litegible Proof stamp missing Rings and bulges on case (Action) release doesn't work Rings in chamber Rim srem Stems bottom chambers Stems bott extension Stock cracked or broken Shell catches Short indent Stems in chamber Stems on case Stems left side of chamber Stems port Shoulder rough	Magazine loads hard Magazine femoves fraid Opens hard Over-rides 1 Discording 1 Proof stamp illegible Proof stamp missing Rings and bulges on case (Action) release doesn't work Rings in chamber Ring in sholder Rins bottom chambers Stems bottom chambers Stems bot extension Stock cracked or broken Short indent Stems in chamber Stems left side of chamber Stretch marks on case Stem over-ride Stems port Shoulder rough	Magazine loads hard Magazine ferroves hard Opens hard Over-rides 1 Pulls hard Proof stamp illegible Proof stamp missing Rings and bulges on case (Action) release doesn't work Rings in chamber Ring in sholder Rin srem Stems bottom chambers Stems bott extension Stock cracked or broken Short indent Stems in chamber Stems in chamber Stems in chamber Stems lead Stems lead of stamp missing Rin stems on case Stems left side of chamber Stems left side of chamber Stems left side of chamber Stems port Stem sport Stems port Stems port


994555555							
Specific rin gs in chamber		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1					
Surface scratches on case							
Stems top.chamber							
Safety switch works too easily		***************************************					
Safety switch works too hard		dus.					
Safety ewitxh work		- A.					
Tips down							
Tips up							
Trigger won't pull				*			
Trigger won't retract							
Uncoded	***			***	11/11		
Extracts hard						Sec.	
			<i>200</i>				
High			**********	.			
Low		***************************************	***				
Left							
Right		***************************************					
Doesn't Group							
Front sight tipped							
Rear sight tipped		y a a a a a a a a a a a a a a a a a a a				,	
Rear sight base raised							
Front sight raised		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1					
Front sight loose							
Rear sight loose		***					
Missing parts at target							
Uncoded nonconformity at target							
	Surface scratches on case Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewitxh work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scratches on tase Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewitxh work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scratches on case Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewitxh work work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scratches on asse Stems top etiamber Safety switch works too easily Safety switch works too hard Safety ewitch work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight base raised Front sight loose Missing parts at target	Surface scraticities on case Stems top shamber Safety switch works too easily Safety switch works foo hard Safety switch work Tips down Tips up Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scratches on case Stems top etiamber Safety switch works too easily Safety switch works foo haid Safety ewitch work foo haid Safety ewitch work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scratches on dase Stems top chamber Safety switch works too easily Safety switch works too bard Safety ewitch works Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight toose Rear sight loose Missing parts at target

1	::::::::::::::::::::::::::::::::::::::						
AI-P	Assembly incompleye at proof						
868	Barrel bracket gracked or broken at proof						
BC-P	Blows cases at proof		***************************************				
BEB-P	Barrel extension broken at proof		***************************************				
BLP-P	Blanked primer at proof		áto.				
BLSO-P	Barrel lug shot off at proof		***				
BP-P	Blown primer at proof						
BS-P	Barrel split at proof						
DLOS-P	Doesn't lock over shells at proof						
ESB-P	Ejector sticks back at proof						
FCB-P	Fore-end cracked at proof	1.400					
FESO-P	Fore-end shot off at proof					ito.	
FF-P	Fails to fire at proof						
GCSO-P	Gas cylinder shot off at proof						
MSI-P	Magnaflux stamp illegible on bbl			1.0			
MSM-P	Magnaflux stamp missing on bbl				*****		
PP-P	Pierced primer at proof		***************************************				
SCB-P	Stock cracked or broken at proof		***************************************				
UNCM-P	Uncoded proof malfunctions		***************************************			3333	

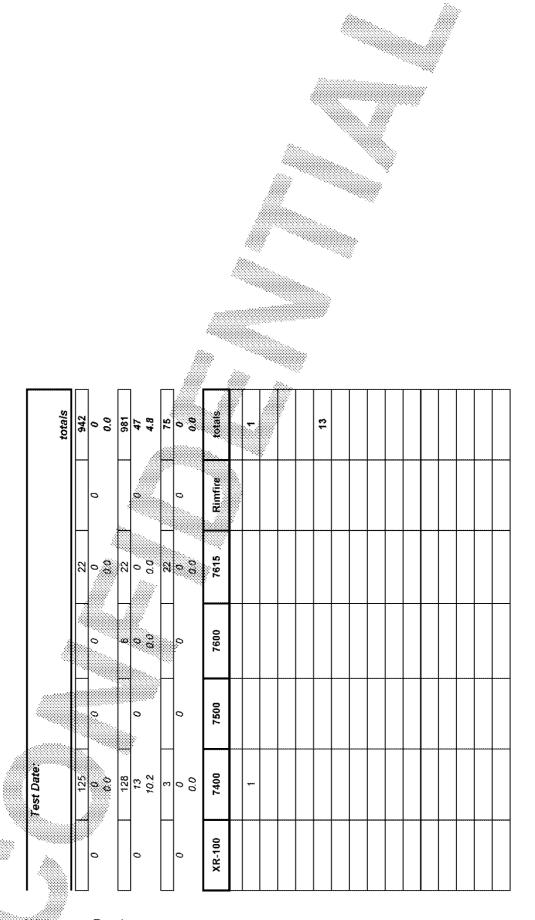


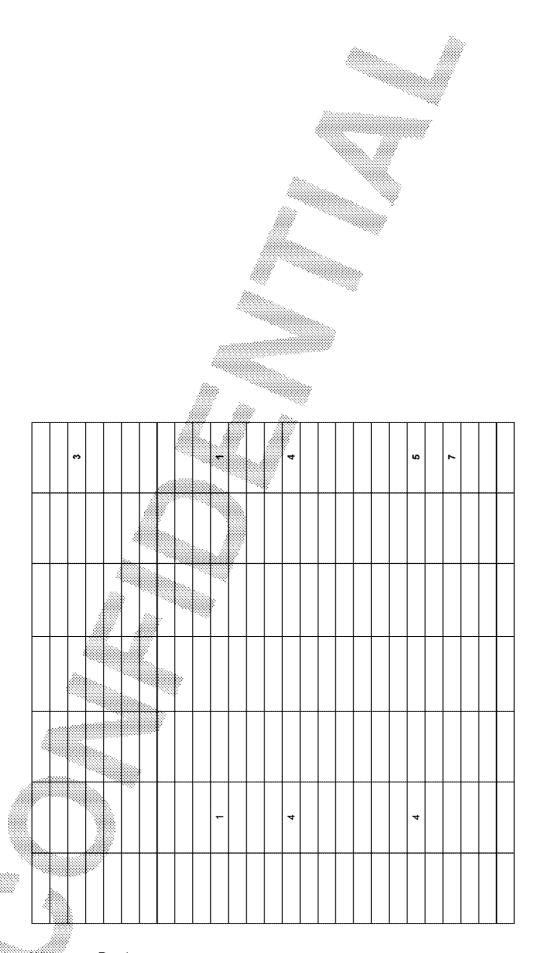

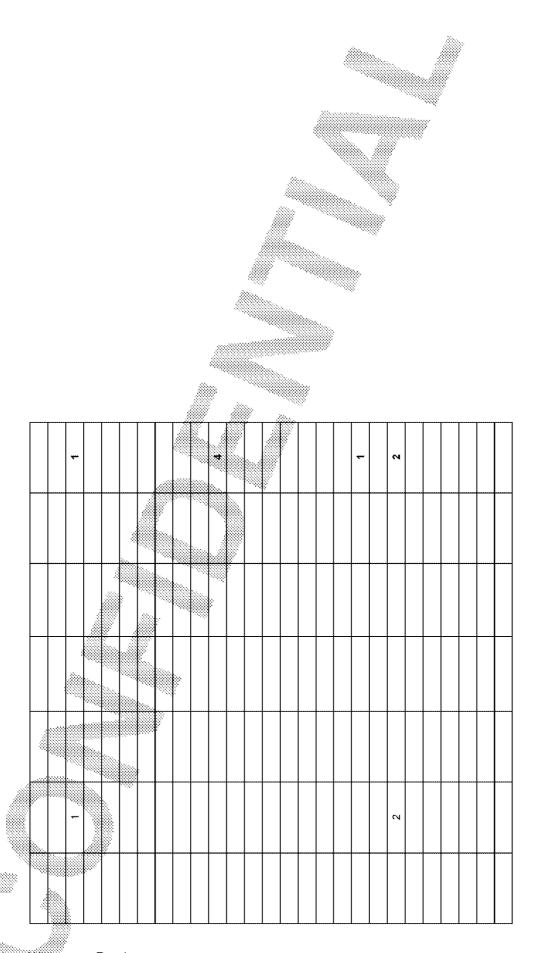

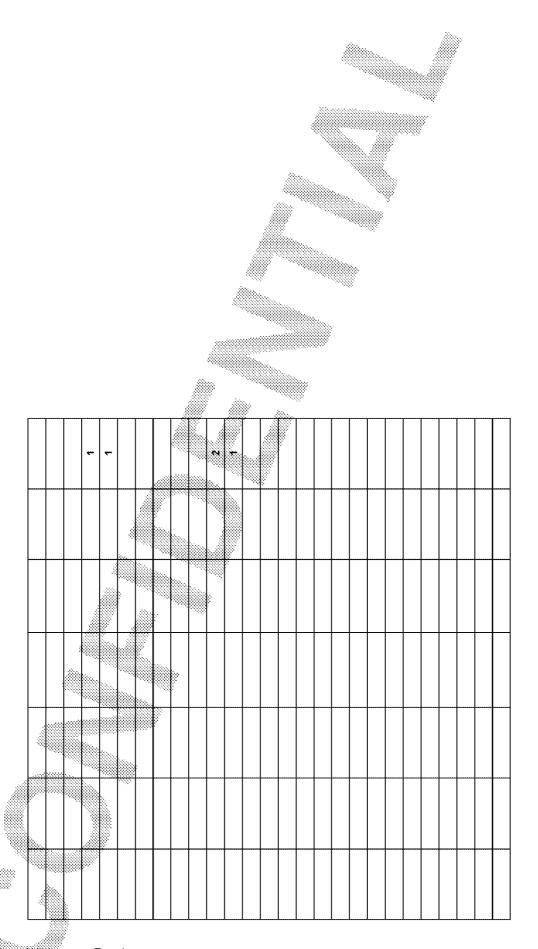



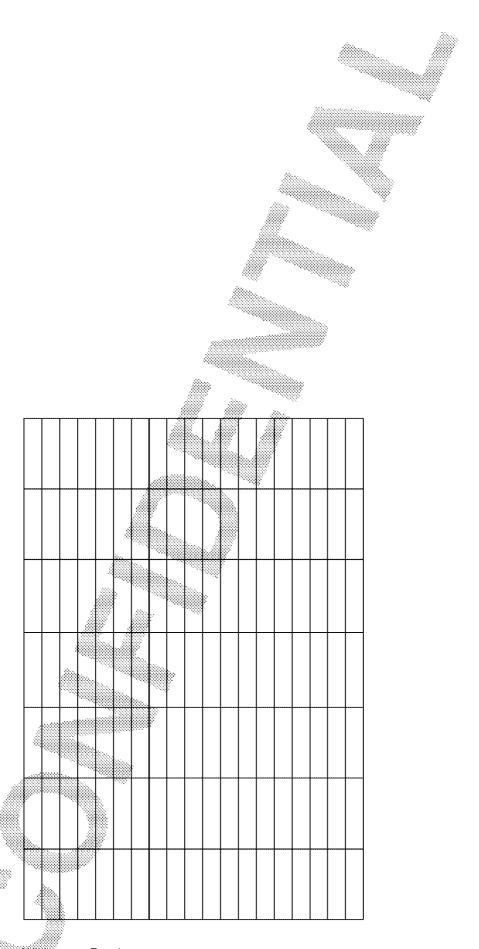

Subject to Protective Order - Williams v. Remington

-	1
	1
Þ	1
C)
C)
۲	1
H	1
-	J
٨)
١)
_	J_

	100000000										
Summ	any	Total	Test + Proc		93	11					
			Total	Rejected:	8	80					
			Overall Re	ject Rate:	8.8	i9					
		Proof .		Shot: Rejected:		18	63	147	372	36	
	***************************************	Proof		Rejected.	0	0	1	0	0	0	0
				Percent. Shot.	0.0	0.0	1.6	0.0	0.0	0.0	
				Shot.	172	41	224	72	278		
		Test	* ****	Rejected:	2.	7	44	2	7	Ð	0
				Shot. Reje sted Percent:	1.2	17.1	.19.6	2.8	2.5		
				Shot		₩ <i></i>	17	7	14		
		Target		Rejected:	0 🐰	// // 9 //	Ø	0	0	0	0
				Percent:	0.0	9	0.0	0 9.0	0.0		

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	700 CDL	700 POLICE	MODEL 7

AB	Action binds		***************************************	1///				
BABS	Bulge at body shoulder		***************************************					
BAC	Burr at chamber		1					
BBMA	BBL-to-bolt misalignment		1100		****		1000	
ВВ	Bolt binds/catches		2	13				
BCOBS	Bolt catches on bolt stop		-			.,		
BCOF	Bolt catches on follower		***************************************				3000	
вс	Blows cases		-					
BHR	Bolt hits receiver							
BHS	Bolt plug hits safety switch		***************************************					
BLOP	Bar lock or disconnector out of position		2112					
BLSO	Barrel lug shot off		***************************************					
BPO	Bolt pulls out		4400			1		
BSSM	Bolt stems shell in magazine		***************************************					
BWCD	Bolt won't cam down		-					

BWCFM	Bolt won't close over full magazine			4				
CD	Case dented		**************************************					
СН	Closes hard		***************************************	1				
CLM	Can't laod magazine		**************************************					
со	Cut-off		244.					
CR	Cuts rim							
CS	Cases swell							
CTOG	Chamber tom or gouged	· · · · //						
CTP	Creepy trigger pull							
CWSB	Cams wrong side of action bar							
DBB	Doesn't blow back	***				<i>11/1</i> /11		
DCS	Double click in safety switch						00v.	
DCT	Double click in trigger		***************************************		****			
DCU	Doesn't close-up		*************					
DE	Doesn't eject		***************************************	/**				
DEL	Doesn't eject live round		SATISFACE OF THE PARTY OF THE P		1918			
DFB	Doesn't feed back							
DFU	Doesn't feed up							
DLO	Doesn't lock open (after last shell)		11000 T				*****	
DLU	Doesn't lock-up						;	
DS	Dead safe			1				***************************************
DX	Doesn't extract			1		2		
DXL	Doesn't extract live round							
EDS	Extractor drops shell		***************************************	3		1		
ESB	Ejector sticks back		4			2		
ESCR	Empty shell catches receiver							
ESS	Extractor stems shell							


FA	Fires automatically							
FB	Follower bin ds							
FC	Fails to connect							
FCB	Fore-end cracked or broken							
FD	Follows-down		žto.					
FF	Fails to fire							
FFP	Flat firing pin							
FOS	Fires on safe							
FPHB	Firing pin hits bbl				800. 800.			
FPHI	Firing pin hits inside rim							
FPO	Floor plate opens	1		5		<i>**</i>		
FPOH	Floor plate opens hard						Sec.	
FSR	Fires when safe is released				***			
FT	Follower tips			2				
GCSO	Gas cyl shot off			***				
HBL	Heavy bolt lift			3	******			
HMSC	Heading mismatch-steps on case							
HPA	High pressure ammo							
HUR	Hard under rail				2		**************************************	
JCS	Jumps cartridge						18	
JM	Jumps magazin e			4				
JO	Jars off							
LB	Light blow							
MAH	Magazine assembles hard							
MCW	Magazine capacity wrong							
MFA	Misfires (ammo)							
MFOP	Magazine follower out of position							


2001 100000000							
Magazine logse							
Magazine loads hard							
Magazine removes hard							
Spens hard	1						
Over-indes		\$to.					
Pulls hard							
Proof stamp missing							
Rings and bulges on case							
(Action) release doesn't work							
Rings in chamber	***	//////		***	<i>11/1</i> 0		
Ring in sholder						Sec.	
Rim srem			11/11/16	***			
Stems bottom chambers				.			
Stems bbl extension			***				
Stock cracked or broken				******			
Shell catches					******		
Short indent						67677777	
Stems incline						**************************************	
Stems in chamber						á	
shaves lead							
Stems left side of chamber							
Stretch marks on case							
Stem over-ride							
Stems port							
Shoulder rough							
Stems right side of chamber						_	
	Magazine removes hard Depens hard Depens hard Proof stamp illegible Proof stamp missing Rings and bulges on case Action) release doesn't work Rings in chamber Ring in sholder Rim srem Stems bottom chambers Stems bbl extension Stock cracked or broken Shell catches Short indent Stems in chamber Stems in chamber Stems in chamber Stems in chamber Stems left side of chamber Stretch marks on case Stems port Shoulder rough	Magazine removes hard Depens hard Proof stamp illegible Proof stamp missing Rings and bulges on case Action) release doesn't work Rings in chamber Ring in sholder Rim srem Stems bottom chambers Stems bbl extension Stock cracked or broken Shell catches Short indent Stems in chamber Stems in chamber Stems in chamber Stems left side of chamber Stretch marks on case Stems port Shoulder rough	Magazine removes hard Depensitant Depensitant Proof stamp illegible Proof stamp missing Rings and bulges on case Action) release doesn't work Rings in chamber Ring in sholder Rim srem Stems bottom chambers Stems bottom chambers Stems bottom chambers Stems leatches Short indent Stems in chamber Stems in chamber Stems in chamber Stems in chamber Stems leat side of chamber Stems left side of chamber Stems port Stems port Stems port Stems port Shoulder rough	Magazine removes hard Depens h	Magazine femoves hard Deens h	Magazine femoves hard Opens hard Depens hard Proof stamp illegible Proof stamp missing Rings and bulges on case Action) release doesn't work Rings in chamber Ring in sholder Rim srem Stems bottom chambers Stems bbl extension Stock cracked or broken Shell catches Short indent Stems in chamber Stems in chamb	Aggazine femoves hard Deens hard

SRIC


Specific rings in chamber


	30000000000000000000000000000000000000						
AI-P	Assembly incompleye at proof						
868	Barrel bracket gracked or broken at proof		**************************************				
BC-P	Blows cases at proof		440044100				
BEB-P	Barrel extension broken at proof		**************************************				
BLP-P	Blanked primer at proof						
BLSO-P	Barrel lug shot off at proof						
BP-P	Blown primer at proof						
BS-P	Barrel split at proof						
DLOS-P	Doesn't lock over shells at proof						
ESB-P	Ejector sticks back at proof						
FCB-P	Fore-end cracked at proof	100					
FESO-P	Fore-end shot off at proof					500.	
FF-P	Fails to fire at proof		***************************************	N//			
GCSO-P	Gas cylinder shot off at proof		************				
MSI-P	Magnaflux stamp illegible on bbl		450445044	***			
MSM-P	Magnaflux stamp missing on bbl		***************************************		**************************************		
PP-P	Pierced primer at proof						
SCB-P	Stock cracked or broken at proof		-				
UNCM-P	Uncoded proof malfunctions		**************************************			*****	
<u> </u>	_					ž.	

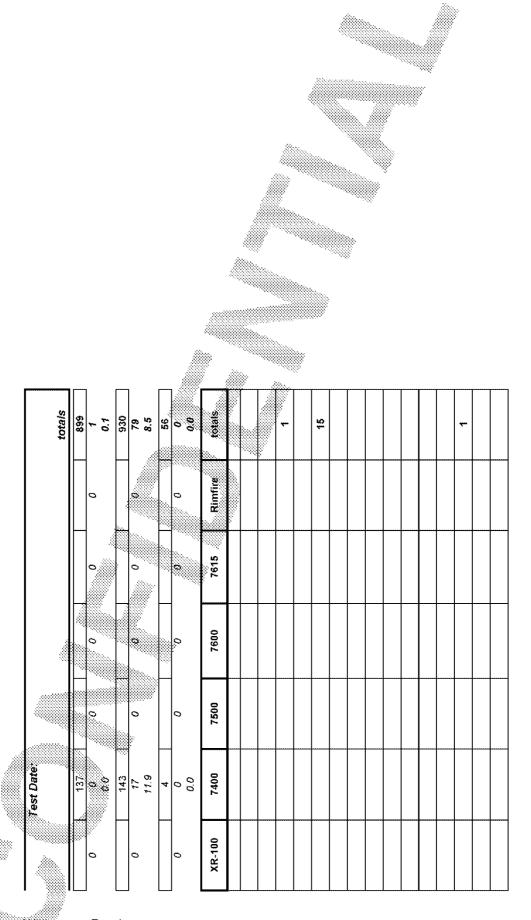


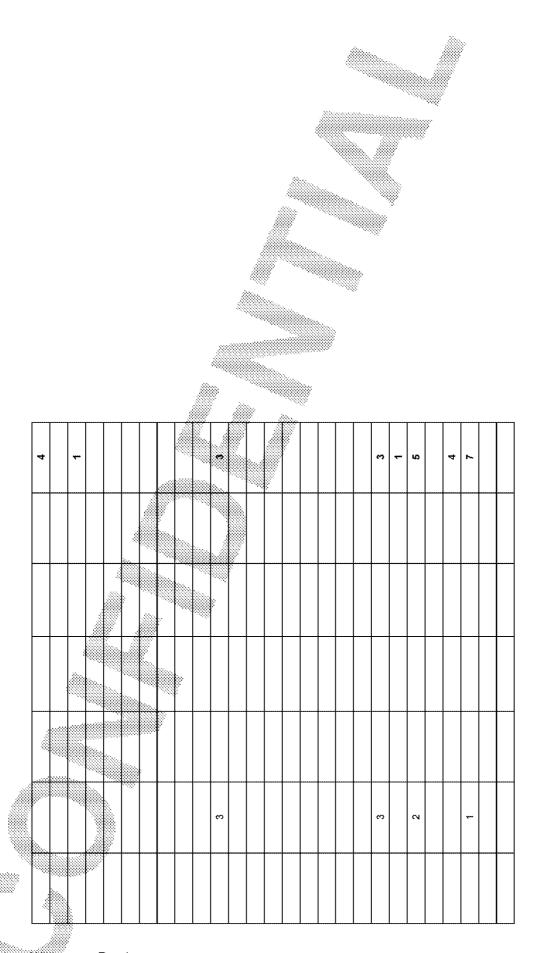


Subject to Protective Order - Williams v. Remington

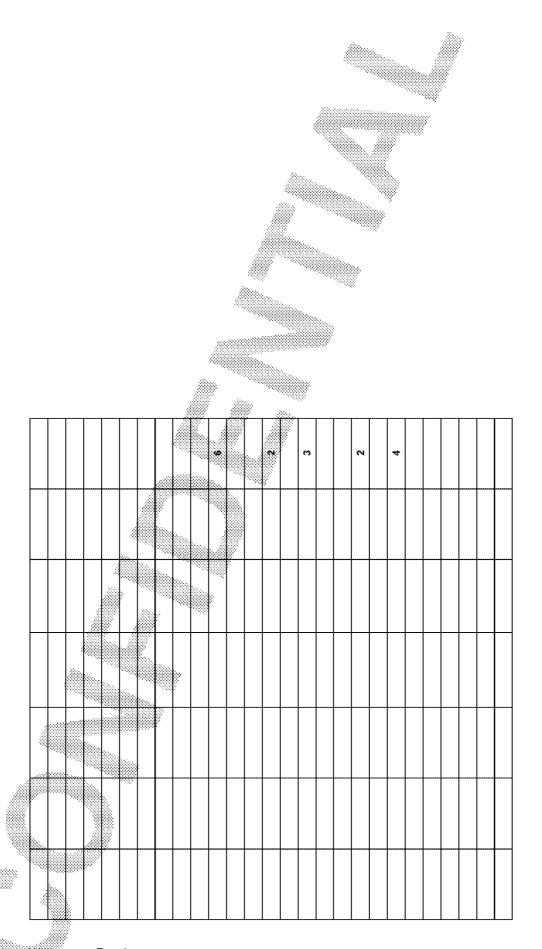

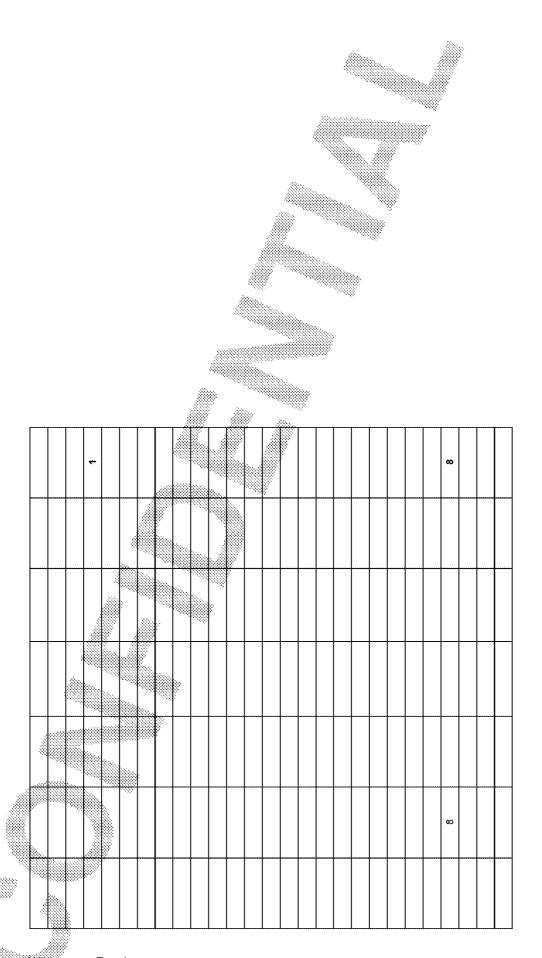

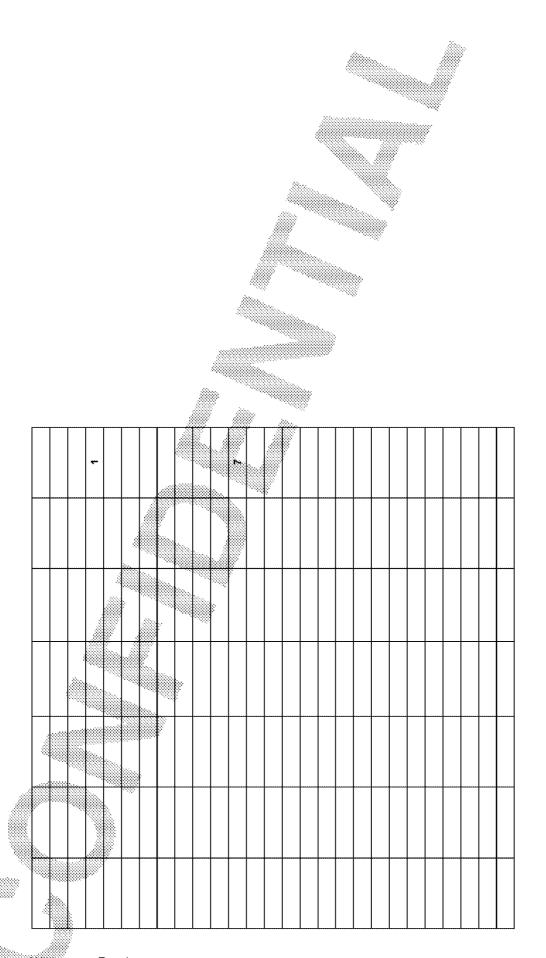

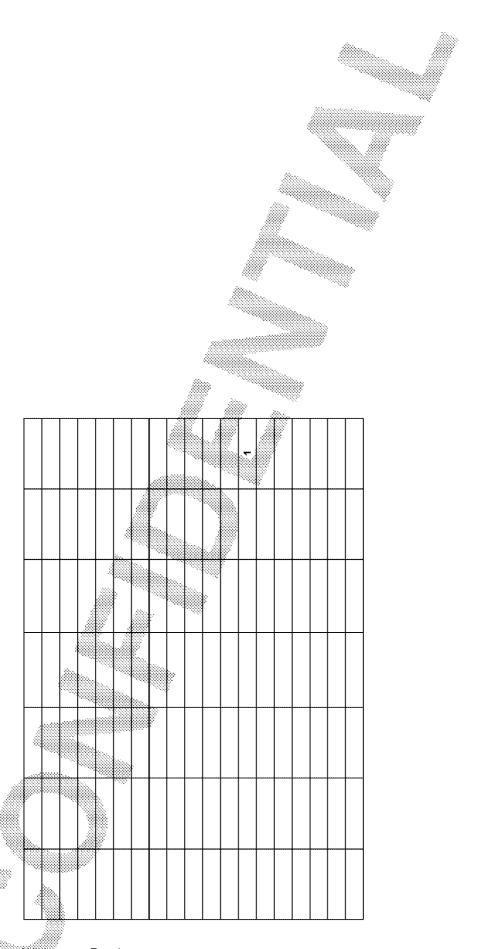

Subject to Protective Order - Williams v. Remington

	//////////////////////////////////////								
Summ	ary Tot	al Test + Proof Failures	0						
		Total Rejected:	0						
		Total Rejected: Overall Reject Rate:							
	Proo	Shot. Rejected: Percent: Shot. Rejected: Percent:							
	<i>Pr</i> oo	f Rejected	0	0	0	0	0	0	0
		Percent;	<i>o</i>	door.					
		Shot:	.	<i>1000</i> 7					
	Test	Reje cted .	Q	0	. O	0	0	O O	0
		Percent:		0					
		Stjot: et Rejected:	.8883	<i>7 - 30000</i>	700000	4.			
	Targe		0 333	9	ŧ,	0	0	0	0
	· ·	Percent:	0	0	O	0			
_	7			222222		*****			_

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			***********				X	
AB	Action binds		***************************************	<i></i>	9996			
BABS	Bulge at body shoulder		***************************************	***************************************				
BAC	Burr at chamber		***************************************					
BBMA	BBL-to-bolt misalignment				***			
ВВ	Bolt binds/catches		***************************************				***	
BCOBS	Bolt catches on bolt stop							
BCOF	Bolt catches on follower						3700	
ВС	Blows cases		-					
BHR	Bolt hits receiver							****
BHS	Bolt plug hits safety switch		***************************************					
BLOP	Bar lock or disconnector out of position		311					
BLSO	Barrel lug shot off							
BPO	Bolt pulls out							
BSSM	Bolt stems shell in magazine		- Control of the Cont					
BWCD	Bolt won't cam down							


BWCFM	Bolt won't close over full magazine						
CD	Case dented						
CH	Closes hard						
CLM	Can't laod magazine						
co	Cut-off		des.				
CR	Cuts rim						
CS	Cases swell						
CTOG	Chamber tom or gouged						
CTP	Creepy trigger pull						
CWSB	Cams wrong side of action bar						
DBB	Doesn't blow back	****					
DCS	Double click in safety switch					Sec.	
DCT	Double click in trigger				***		
DCU	Doesn't close-up			***************************************			<u>``</u>
DE	Doesn't eject			1995			
DEL	Doesn't eject live round				×20000		
DFB	Doesn't feed back						
DFU	Doesn't feed up						
DLO	Doesn't lock open (after last shell)					***************************************	
DLU	Doesn't lock-up					3	
DS	Dead safe						
DX	Doesn't extract						
DXL	Doesn't extract live round						
EDS	Extractor drops shell						
ESB	Ejector sticks back						
ESCR	Empty shell catches receiver						
ESS	Extractor stems shell						

FA	Fires automatically		A					
FB	Follower binds							
FC	Fails to comect	,.						
FCB	Fore-end gracked or broken							
FD	Follows-down		\$20.					
FF	Fails to fire		- XX					
FFP	Flat firing pin							
FOS	Fires on safe							
FPHB	Firing pin hits bbl							
FPHI	Firing pin hits inside rim							
FPO	Floor plate opens					<i>#</i>		
FPOH	Floor plate opens hard						Seo.	
FSR	Fires when safe is released		***************************************		**** //			
FT	Follower tips		***************************************					
GCSO	Gas cyl shot off		***************************************	1%				
HBL	Heavy bolt lift				**************************************			
HMSC	Heading mismatch-steps on case		***************************************					
HPA	High pressure ammo							
HUR	Hard under rail							
JCS	Jumps cartridge		y a a a a a a a a a a a a a a a a a a a				×	
JM	Jumps magazin e							
10	Jars off		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1					
LB	Light blow							
MAH	Magazine assembles hard		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1					
MCW	Magazine capacity wrong							
MFA	Misfires (ammo)							
MFOP	Magazine follower out of position		-					

ML	Magazine lööse		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1					
MLH	Magazine loads hard							
MRH	Magazine removes hard	a.	***************************************					
ОН	Opens hard							
OR	Over-ndes		\$45.					
PH	Pulls hard							
PSI	Proof stamp illegible							
PSM	Proof stamp missing							
RBOC	Rings and bulges on case							
RDW	(Action) release doesn't work							
RIC	Rings in chamber	***			***	11/1/11		
RIS	Ring in sholder						Sax.	
RS	Rim srem							
SBC	Stems bottom chambers		***************************************					
SBE	Stems bbl extension		***************************************	***				
SCB	Stock cracked or broken				**************************************			
SCX	Shell catches							
SHI	Short indent							
SI	Stems incline						*****	
SIC	Stems in chamber						ž.	
SL	shaves lead							******
SLC	Stems left side of chamber		A					
SMOC	Stretch marks on case		***************************************					
SOR	Stem over-ride		***************************************					
SP	Stems port		Name of the last o					
SR	Shoulder rough							
SRC	Stems right side of chamber							

	200000000000000000000000000000000000000	 						_
SRIC	Specific rings in chamber							
SSOC	Surface scratches on case							
STC	Stems top chamber							
SWE	Safety switch works too easily							
SWH	Safety switch works too hard	den.						
sww	Safety ewitxh won't work							
TD	Tips down							
TU	Tips up							
TWP	Trigger won't pull							
TWR	Trigger won't retract							
UNCN-T	Uncoded				11/1/1			
хн	Extracts hard					Sec.		
				- "W //		<i>I</i>		
HI	High		*******					
LO	Low		2.3				WW 1////	
LEFT	Left			*****				
RIGHT	Right							
DG	Doesn't Group							
FSST	Front sight tipped					****		
RSTT	Rear sight tipped					į.		
RSBR	Rear sight base raised						***///	100
FSTR	Front sight raised							
FSTL	Front sight loose							
RSTL	Rear sight loose							
MGPT-G	Missing parts at target							
UNCN-G	Uncoded nonconformity at target							

AI-P	Assembly incompleye at proof		***************************************					
868	Barrel bracket gracked or broken at proof		Maria					
BC-P	Blows cases at proof		***************************************					
BEB-P	Barrel extension broken at proof		***************************************					
BLP-P	Blanked primer at proof		200					
BLSO-P	Barrel lug shot off at proof							
BP-P	Blown primer at proof							
BS-P	Barrel split at proof	···						
DLOS-P	Doesn't lock over shells at proof	100			**************************************			
ESB-P	Ejector sticks back at proof							
FCB-P	Fore-end cracked at proof	****				<i>1</i> ////////////////////////////////////		
FESO-P	Fore-end shot off at proof						5ec.	
FF-P	Fails to fire at proof		***************************************					
GCSO-P	Gas cylinder shot off at proof	Anna	***************************************					
MSI-P	Magnaflux stamp illegible on bbl		***************************************	***				
MSM-P	Magnaflux stamp missing on bbl		-					
PP-P	Pierced primer at proof		-					
SCB-P	Stock cracked or broken at proof		***************************************					
UNCM-P	Uncoded proof malfunctions						*****	

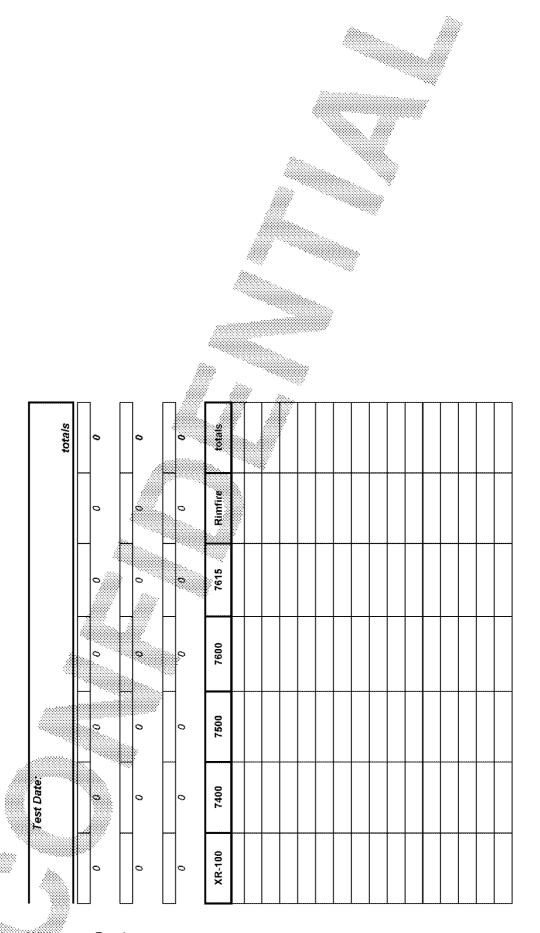


Subject to Protective Order - Williams v. Remington









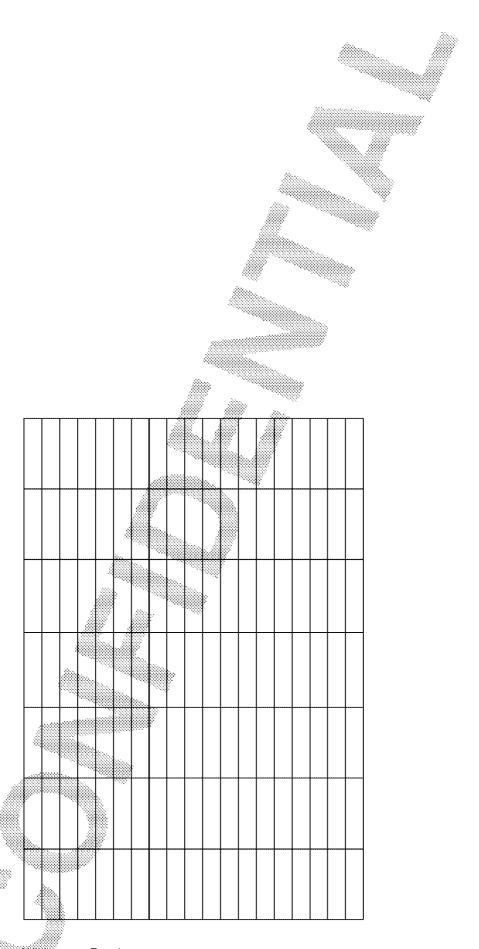

Subject to Protective Order - Williams v. Remington

	///999////	9888.								
Summa	any		Test + Proof Failures	0						
			Total Rejected:	0						
			Total Rejected: Overall Reject Rate:							
	,	Proof	Shot: Rejected: Percent: Shot: Rejected: Percent:	<i>o</i>						
	ı	Proof	Rejected	0	0	0	0	0	0	0
		25	Percent		to.					
			Shot.	la la						
	7	Test	Reje cted :	Q	0	O	0	0	0	0
			Shot. Rejedfød: Peicent Shot. Reječted:	G.	0					
			Shot:		#####	700000	<i>b</i> .			
	7	Target	Rejected:	0 /////	9	Ø	0	0	0	0
		-	Percent:	0	9	O	0			

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			*******		1 ************************************		X	
AB	Action binds							
BABS	Bulge at body shoulder		***************************************	******				.
BAC	Burr at chamber		***************************************					
BBMA	BBL-to-bolt misalignment		***************************************		***			
ВВ	Bolt binds/catches							
BCOBS	Bolt catches on bolt stop		***************************************				3.00	
BCOF	Bolt catches on follower		200				****	
ВС	Blows cases						;	
BHR	Bolt hits receiver		110					****
BHS	Bolt plug hits safety switch		1111					
BLOP	Bar lock or disconnector out of position		***					
BLSO	Barrel lug shot off							
BPO	Bolt pulls out		****					
BSSM	Bolt stems shell in magazine		**************************************					
BWCD	Bolt won't cam down							

-	
⊣	
<u> </u>	
Ŧ	
0	
=	
O	
_	
1.100117	
J	
J	
J	
117252	


DIAMES 88						
BWCFM	Bolt won't close over full magazine					
CD	Case dented					
СН	Closes hard					
CLM	Can't laod magazine					
со	Cut-off	desc.				
CR	Cuts rim	***				
cs	Cases swell					
CTOG	Chamber tom or gouged					
CTP	Creepy trigger pull			***		
CWSB	Cams wrong side of action bar					
DBB	Doesn't blow back					
DCS	Double click in safety switch				Stv.	
DCT	Double click in trigger					
DCU	Doesn't close-up			.		
DE	Doesn't eject		/**			
DEL	Doesn't eject live round					
DFB	Doesn't feed back					
DFU	Doesn't feed up					
DLO	Doesn't lock open (after last shell)				**************************************	
DLU	Doesn't lock-up				ž.	
DS	Dead safe					
DX	Doesn't extract					
DXL	Doesn't extract live round					
EDS	Extractor drops shell					
ESB	Ejector sticks back					
ESCR	Empty shell catches receiver					
ESS	Extractor stems shell					

FA	Fires automatically							
FB	Follower binds		**************************************					
FC	Fails to connect		***************************************					
FCB	Fore-end gracked of broken		**************************************					
FD	Follows-down		244.					
FF	Fails to fire		W					
FFP	Flat firing pin	V. (1000)						
FOS	Fires on safe							
FPHB	Firing pin hits bbl				*			
FPHI	Firing pin hits inside rim							
FPO	Floor plate opens					<i>)</i>		
FPOH	Floor plate opens hard						Sec.	
FSR	Fires when safe is released		***************************************		****			
FT	Follower tips							
GCSO	Gas cyl shot off		*******	1189				
HBL	Heavy bolt lift				*****			
HMSC	Heading mismatch-steps on case		-					
HPA	High pressure ammo							
HUR	Hard under rail		***************************************					
JCS	Jumps cartridge						ž.	
JM	Jumps magazine		naantinaante					
JO	Jars off		ann					
LB	Light blow							
MAH	Magazine assembles hard		***************************************					
MCW	Magazine capacity wrong		**************************************					
MFA	Misfires (ammo)							
MFOP	Magazine follower out of position		-					

agazine lööse							
agazine loads hard							
agazine <i>t</i> emoves hard							
gens hard							
ver-ndes		šta.					
ılls hard							
oof stamp missing							
ngs and bulges on case							
ction) release doesn't work							
ngs in chamber	***			***	*		
ng in sholder						Sec.	
m srem			11/11/4	***			
ems bottom chambers							*** *******
ems bbl extension			***				
ock cracked or broken				*****			
nell catches							
nort indent						67677777	
ems incline						**************************************	
ems in chamber						á	
aves lead							
ems left side of chamber							
retch marks on case							
em over-ride							
ems port							
noulder rough							
ems right side of chamber						_	
	ens.hard erandes Ils hard of stamp illegible of stamp missing igs and bulges on case ction) release doesn't work igs in chamber ig in sholder in srem ems bottom chambers ems bbl extension ock cracked or broken ell catches ort indent ems incline ems in chamber aves lead ems left side of chamber etch marks on case em over-ride ems port oulder rough	ens-hard er-ndes Ils hard of stamp illegible of stamp missing igs and bulges on case stion) release doesn't work igs in chamber ig in sholder in srem oms bottom chambers ems bbl extension ock cracked or broken ell catches ort indent ems incline ems in chamber aves lead ems left side of chamber etch marks on case em over-ride ems port oulder rough	ens-hard er-ndes Ils hard of stamp illegible of stamp missing igs and bulges on case stion) release doesn't work igs in chamber ig in sholder in srem oms bottom chambers ems bbl extension ock cracked or broken ell catches ort indent ems incline ems in chamber aves lead ems left side of chamber etch marks on case em over-ride ems port oulder rough	ers hand ers	ens.hard er-rides Ils hard of stamp illegible of stamp missing igs and bulges on case stion) release doesn't work igs in chamber ig in sholder in srem ons bottom chambers ems bbl extension ock cracked or broken ell catches ort indent ems incline ems in chamber aves lead oms left side of chamber etch marks on case em over-ride ems port oulder rough	ens.hard enrides Ils hard of stamp filegible of stamp missing gas and bulges on case cition) release doesn't work gas in chamber ga in sholder no serm ens bottom chambers ens bottom chamber ens bottom chamber ens bottom chamber ens bottom chamber ens sort chamber ens in chamber ens in chamber etch marks on case end over-ride ens port outder rough	ens hard ens hard lis hard lor stamp illegible lor stamp missing ligs and bulges on case lotion) release doesn't work ligs in chamber lig in sholder lin seem lims bottom chambers lens bottom chambers lens bottom chambers lens bottom chambers lock cracked or broken lel catches lort indent lens in chamber lort indent lens in chamber loves lead lore is left side of chamber letch marks on case len over-ride lens port louder rough

SRIC	Specific rin gs in chamber		ACT TO SERVICE AND ADDRESS OF THE SERVICE AND AD				
850C	Surface scratches on case		***************************************				
STC	Stems top chamber		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1				
SWE	Safety switch works too easily		VARIABLE				
SWH	Safety switch works too hard		\$20.				
sww	Safety ewitxh work		- XX				
TD	Tips down						
TU	Tips up						
TWP	Trigger won't pull						
TWR	Trigger won't retract						
UNCN-T	Uncoded	1 ***			1000		
хн	Extracts hard					Sec.	
			44440444	****			
HI	High						
LO	Low		***************************************				
LEFT	Left			**************************************			
RIGHT	Right		***************************************				
DG	Doesn't Group						
FSST	Front sight tipped					*****	
RSTT	Rear sight tipped		1			į	
RSBR	Rear sight base raised						
FSTR	Front sight raised						
FSTL	Front sight loose						
RSTL	Rear sight loose		***				
MGPT-G	Missing parts at target						
UNCN-G	Uncoded nonconformity at target						
			-				

AI-P	Assembly incompleye at proof						
868	Barrel bracket gracked or broken at proof		***************************************				
BC-P	Blows cases at proof		Antonia				
BEB-P	Barrel extension broken at proof		Managara anaka				
BLP-P	Blanked primer at proof		áva.				
BLSO-P	Barrel lug shot off at proof						
BP-P	Blown primer at proof						
BS-P	Barrel split at proof	· · · · //					
DLOS-P	Doesn't lock over shells at proof						
ESB-P	Ejector sticks back at proof						
FCB-P	Fore-end cracked at proof	***					
FESO-P	Fore-end shot off at proof					Seo.	
FF-P	Fails to fire at proof		***************************************				
GCSO-P	Gas cylinder shot off at proof		************				
MSI-P	Magnaflux stamp illegible on bbl		-	***			
MSM-P	Magnaflux stamp missing on bbl		-		**************************************		
PP-P	Pierced primer at proof						
SCB-P	Stock cracked or broken at proof						
UNCM-P	Uncoded proof malfunctions		***************************************			200 B	
						 - 2	

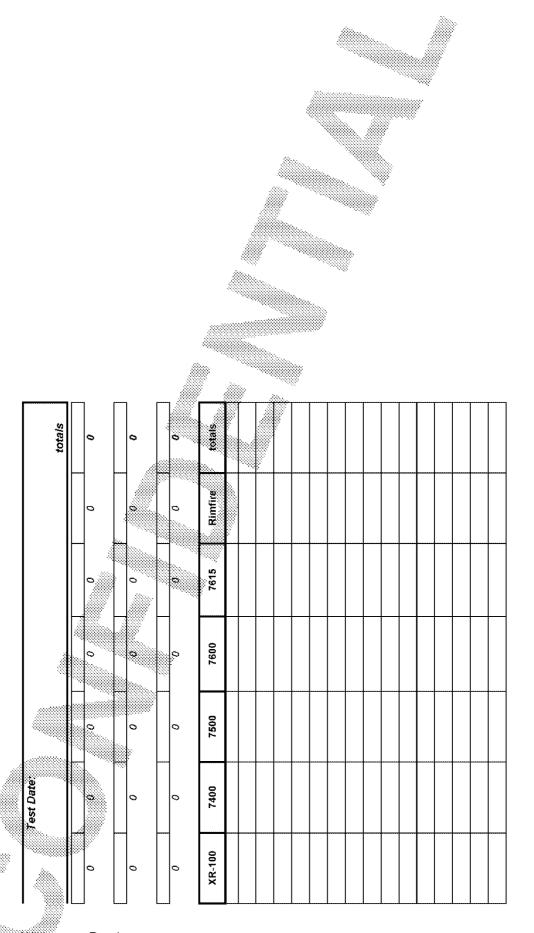


Subject to Protective Order - Williams v. Remington









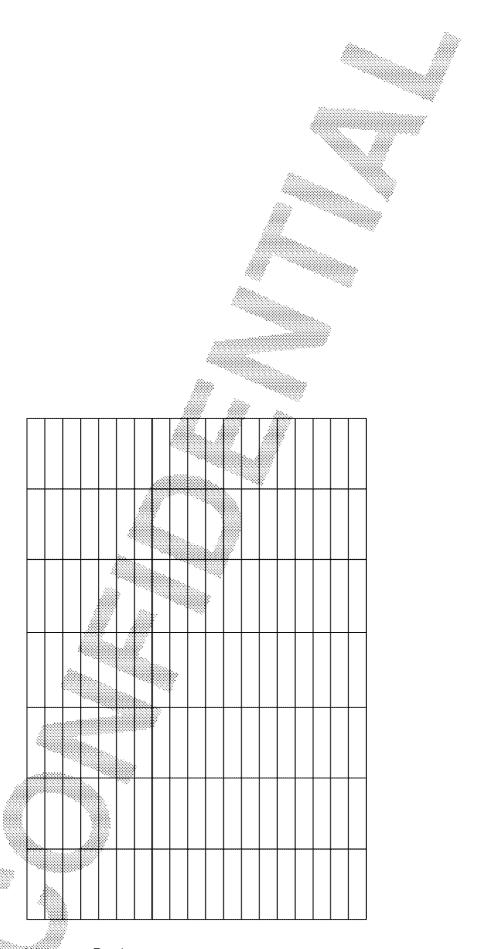

Subject to Protective Order - Williams v. Remington

	77799777994										
Summa	any	Total	Test + Pro	of Failures		0					
			Tota	Rejected:		0					
			Overall R	of Failures I Rejected: eject Rate:							
				Shot: Rejected: Percent: Shot: Rejected: Percent:							
		Proof		Rejected.	0	. 0	0	0	0	0	0
				Percent;	0						
				Shot	**************************************	1 888889					
		Test	*	Rejected:	Q.	0	, O	0	0	Đ	0
				Shot Rejepted: Percent: Shot: Rejected:		0	0				
			*	Shot:		₩	1000000	Δ.			
		Target		Rejected:	0 🐰	9	, O	0	0	0	0
		J		Percent:	0	9	Ů,	0			

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			***********				X	
AB	Action binds		***************************************	1///				
BABS	Bulge at body shoulder		***************************************					
BAC	Burr at chamber		***************************************					
BBMA	BBL-to-bolt misalignment				****			
ВВ	Bolt binds/catches		***************************************					
BCOBS	Bolt catches on bolt stop							
BCOF	Bolt catches on follower						****	
ВС	Blows cases		-				8	
BHR	Bolt hits receiver							*****
BHS	Bolt plug hits safety switch		***************************************					
BLOP	Bar lock or disconnector out of position		***************************************					
BLSO	Barrel lug shot off							
BPO	Bolt pulls out		State of the state					
BSSM	Bolt stems shell in magazine		- Control Control					
BWCD	Bolt won't cam down							

BWCFM

CD

Bolt won't close over full magazine


Case dented

FA	Fires automatically						
FB	Follower binds	***************************************					
FC	Fails to connect	A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1					
FCB	Fore-end cracked of broken	 V					
FD	Follows-down	\$20.					
FF	Fails to fire	<i>*************************************</i>					
FFP	Flat firing pin						
FOS	Fires on safe						
FPHB	Firing pin hits bbl						
FPHI	Firing pin hits inside rim						
FP0	Floor plate opens	//////////////////////////////////////		***	<i>11/1</i> 0		
FPOH	Floor plate opens hard					Sec.	
FSR	Fires when safe is released		11/11/16	***			
FT	Follower tips	***************************************					
GCSO	Gas cyl shot off	*******	****				
HBL	Heavy bolt lift			*******			
HMSC	Heading mismatch-steps on case				******		
HPA	High pressure ammo						
HUR	Hard under rail	***************************************				**************************************	
JCS	Jumps cartridge	A.				8	
JM	Jumps magazin e						
10	Jars off						
LB	Light blow	***************************************					
MAH	Magazine assembles hard						
MCW	Magazine capacity wrong						
MFA	Misfires (ammo)						
MFOP	Magazine follower out of position						
MCW MFA	Magazine capacity wrong Misfires (ammo)						

ML	Magazine logse							
MALH	Magazine loads hard							
MRH	Magazine removes hard							
ОН	Opens hard							
OR	Over-indes		što.					
PH	Pulls hard							
PSI	Proof stamp illegible							
PSM	Proof stamp missing	· · · · ///						
RBOC	Rings and bulges on case							
RDW	(Action) release doesn't work							
RIC	Rings in chamber	***				<i>**</i>		
RIS	Ring in sholder					***	Sec.	
RS	Rim srem			11/11/1	*** //			
SBC	Stems bottom chambers							
SBE	Stems bbl extension							
SCB	Stock cracked or broken				*******			
SCX	Shell catches							
SHI	Short indent							
SI	Stems incline						*****	
SIC	Stems in chamber						18	
SL	shaves lead							******
SLC	Stems left side of chamber							
SMOC	Stretch marks on case							
SOR	Stem over-ride							
SP	Stems port							
SR	Shoulder rough							
SRC	Stems right side of chamber							


Specific rings in chamber							
Surface scratches on case		Per la constante de la constan					
Stems top chamber		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1					
Safety switch works too easily		VARIABLE					
Safety switch works too hard		\$45.					
Safety ewitxh work							
Tips down							
t the rth							
Trigger won't pull							
Trigger won't retract							
Uncoded	****						
Extracts hard						5ec.	
		***************************************		883			
High		***************************************					
Low		***************************************	***				
Left				19.000 m			
Right							
Doesn't Group							
Front sight tipped						**************************************	
Rear sight tipped	-	***************************************				;	
Rear sight base raised							
Front sight raised		A					
Front sight loose		***************************************					
Rear sight loose							
Missing parts at target		***************************************					
Uncoded nonconformity at target							
		-					
	Surface scratches on case Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewitxh work work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight toose Rear sight loose Missing parts at target	Surface scrattches on gase Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewitxh work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scrattches on base Sterns top chamber Safety switch works too easily Safety switch works too hard Safety ewitxh work! work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scratches on gase Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewitxh work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight base raised Front sight loose Missing parts at target	Surface scratches on base Stems top shapeher Safety switch works too easily Safety switch works foo easily Safety switch works foo hard Safety ewitch work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scrattches on asse Stems top chamber Safety switch works too easily Safety switch works foo hard Safety ewitch work foo hard Safety ewitch work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scratches on dase Stems top chamber Safety switch works too easily Safety switch works too easily Safety switch works too hard Safety ewitxh weat work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight toped Rear sight tose Rear sight loose Rear sight loose Missing parts at target

AI-P	Assembly incompleye at proof							
868	Barrel bracket gracked or broken at proof							
BC-P	Blows cases at proof		***************************************					
BEB-P	Barrel extension broken at proof							
BLP-P	Blanked primer at proof		\$45.					
BLSO-P	Barrel lug shot off at proof							
BP-P	Blown primer at proof							
BS-P	Barrel split at proof	···						
DLOS-P	Doesn't lock over shells at proof							
ESB-P	Ejector sticks back at proof							
FCB-P	Fore-end cracked at proof					<i>#</i>		
FESO-P	Fore-end shot off at proof						5ec.	
FF-P	Fails to fire at proof			1///	*** //			
GCSO-P	Gas cylinder shot off at proof							
MSI-P	Magnaflux stamp illegible on bbl		*******	***				
MSM-P	Magnaflux stamp missing on bbl				4444			
PP-P	Pierced primer at proof							
SCB-P	Stock cracked or broken at proof							
UNCM-P	Uncoded proof malfunctions						2006	
•	•	•		•	•		;	

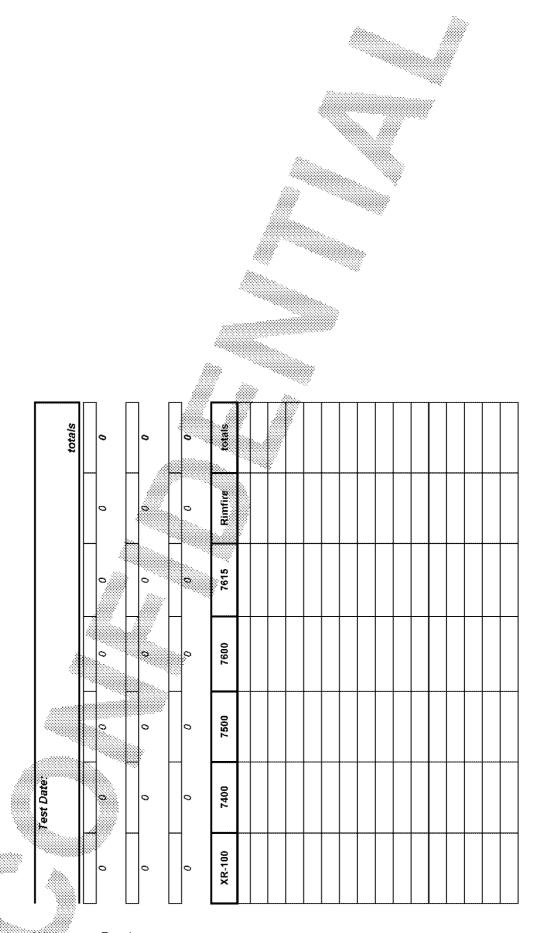


Subject to Protective Order - Williams v. Remington



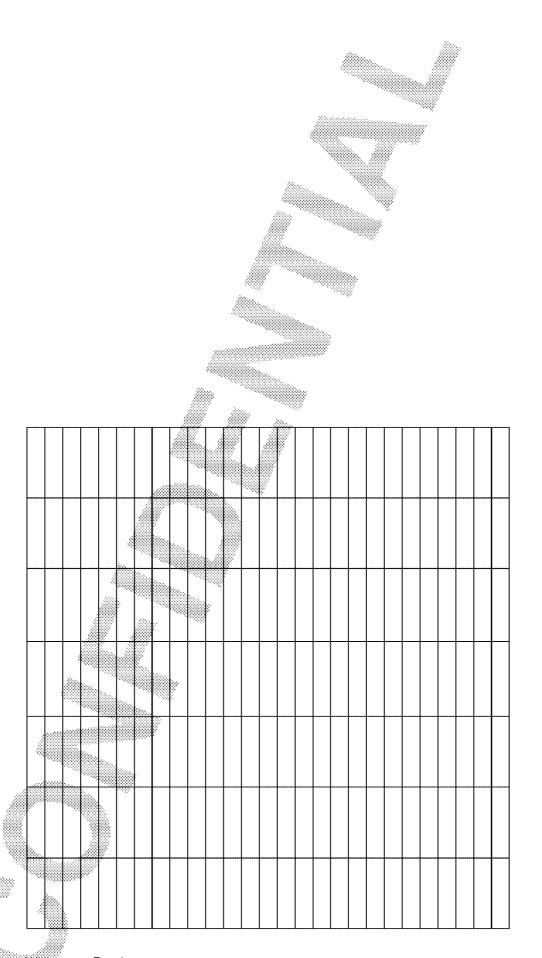





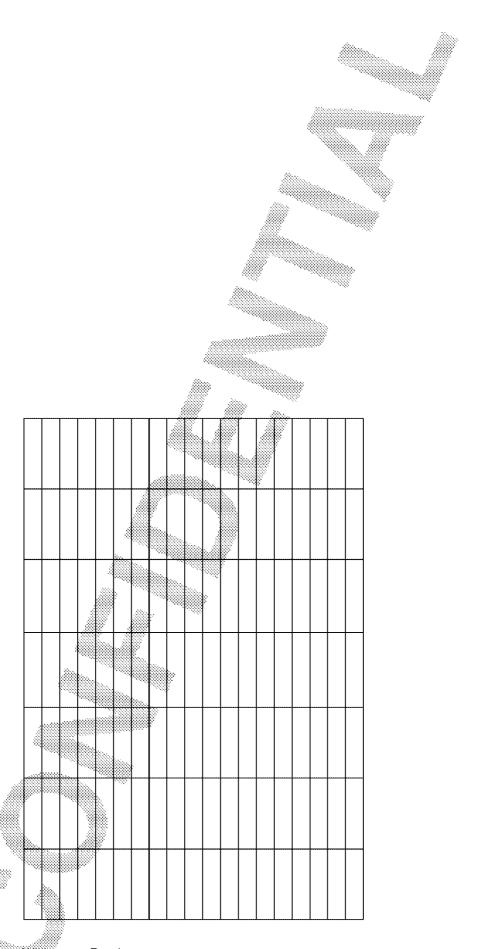

Subject to Protective Order - Williams v. Remington

۰	1	
t	-i	
ŀ	1	
C)	
C)	
	-	
H		
	J	
N	J	
	J	
Ľ	П	

	100000000										
Summ	any			Proof Failures		9					
			T,	otal Rejected: Il Reject Rate:	4	2					
			Overal	l Reject Rate:	4.8	9					
				Shot:	74	20	14	102	279		229
	*******	Proof	### B	Rejected	80000000 $m{a}_{c}$	0	0	0	0	0	0
				Percent. Shot.	0.0	0.0	0.0	0.0	0.0		0.0
		_		Shot.	65	33	131	151	187		260
		Test	<i>.</i>	Reje pled	2.	0	6	6	10	Ð	18
				Shot Rejicted: Percent Shot Rejected: Percent	3.1	0 0.0	4.6	4.0	5.3		6.9
				SHOT.	7 🐰		333	12	18		27
		Target		Rejected:	0 💥		Q.	0	0	Đ	0
		9 - 1		Percent:	0.Q	0.0	0 0 .0	0 0.0	0.0		0.0

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$S	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			*******				X	
AB	Action binds		***************************************	11/18	- 4			
BABS	Bulge at body shoulder		***************************************					.
BAC	Burr at chamber		***************************************			6		
BBMA	BBL-to-bolt misalignment		Market 144		****			
ВВ	Bolt binds/catches		***************************************	1	3			
BCOBS	Bolt catches on bolt stop		***			.,		
BCOF	Bolt catches on follower		100				*****	
ВС	Blows cases		-				;	
BHR	Bolt hits receiver		1					****
BHS	Bolt plug hits safety switch		***					
BLOP	Bar lock or disconnector out of position		***************************************					
BLSO	Barrel lug shot off		***************************************					
BPO	Bolt pulis out		***************************************					
BSSM	Bolt stems shell in magazine							
BWCD	Bolt won't cam down							

Polt won't does over full magazine							
700000 - 20000000 7000000 - 20000000							
			1		1		

Cut-off							
Cuts rim							
Chamber torn or gouged							
Creepy trigger pull				800 800 800			
Cams wrong side of action bar							
Doesn't blow back	***						
Double click in safety switch						550.	
Double click in trigger				****			
Doesn't close-up							3880
Doesn't eject			***				
Doesn't eject live round				**************************************			
Doesn't feed back							
Doesn't feed up							
Doesn't lock open (after last shell)						*****	
Doesn't lock-up						ž.	
Dead safe							12
Doesn't extract					1		1
Doesn't extract live round							
Extractor drops shell	1			2			
Ejector sticks back					2		
Empty shell catches receiver							
Extractor stems shell							
	Cases swell Chamber tom or gouged Creepy trigger pull Cams wrong side of action bar Coesn't blow back Couble click in safety switch Couble click in trigger Coesn't close-up Coesn't eject Coesn't eject live round Coesn't feed back Coesn't feed up Coesn't lock open (after last shell) Coesn't lock-up Coesn't extract Coesn't extract Coesn't extract Coesn't extract live round Extractor drops shell Ejector sticks back Empty shell catches receiver	Case dented Closes hard Can't ladd magazine Cut-off Cuts rim Cases swell Chamber tom or geuged Creepy trigger pull Carns wrong side of action bar Coesn't blow back Couble click in safety switch Couble click in trigger Coesn't eject Coesn't eject Coesn't eject live round Coesn't feed back Coesn't feed up Coesn't lock-up Coesn't lock-up Coesn't lock-up Coesn't extract Coesn't extract Coesn't extract Coesn't extract Coesn't extract Coesn't extract live round Coesn't extract live round	Case dented Closes hap Can't lacd magazine Cuts rim Cases swell Chamber tom or gouged Creepy trigger pull Cams wrong side of action bar Coesn't blow back Couble click in safety switch Coesn't close-up Coesn't eject Coesn't eject live round Coesn't feed back Coesn't feed back Coesn't feed up Coesn't lock-up Coesn't lock-up Coesn't lock-up Coesn't eject live round Coesn't took open (after last shell) Coesn't etract Coesn't extract Coesn't extract Coesn't extract live round Extractor drops shell Ejector sticks back Empty shell catches receiver	Case dented Closes hard Can't laed magazine Cut-off Cuts rim Cases swell Chamber tom or gouged Creepy trigger pull Cams wrong side of action bar Coesn't blow back Couble click in safety switch Coesn't close-up Coesn't eject Coesn't eject live round Coesn't feed back Coesn't feed up Coesn't lock-up Coesn't lock-up Coesn't lock-up Coesn't lock-up Coesn't evtract Coesn't extract Coesn't extract Coesn't extract Coesn't extract Coesn't extract live round Extractor drops shell Ejector sticks back Empty shell catches receiver	Case dented Closes hard Closes hard Closes hard Closes hard Closes hard Closes swell Closes swell Close by trigger pull Closes wrong side of action bar Closes to blow back Closes hard Closes hard Closes to blow back Closes to	Case dented Closes hard 1 1 1 Can't lack magazine Cut-off Cuts rim Cases swell Chamber tom or gouged Creepy trigger pull Carms wrong side of action bar Coesn't blow back Couble click in safety switch Coesn't close-up Coesn't lose-up Coesn't leject Coesn't feed back Coesn't feed up Coesn't lock-up Coesn't server Coesn't stract Coesn't extract Coesn't extrac	Case dented Closes hard Closes

FA.


Fires automatically


ML	Magazine loose						
MLH	Magazine loads hard						
MRH	Magazine removes hard	.c.					
ОН	Opens hard						
OR	Over-rides		žito.				1
PH	Pulls hard						
PSI	Proof stamp illegible						
PSM	Proof stamp missing	***					
RBOC	Rings and bulges on case				Militar.		
RDW	(Action) release doesn't work						
RIC	Rings in chamber	. 449					
RIS	Ring in sholder					5a.	
RS	Rim srem						
SBC	Stems bottom chambers			***			2
SBE	Stems bbl extension			1995			
SCB	Stock cracked or broken						
SCX	Shell catches						
SHI	Short indent						
SI	Stems incline					***************************************	
SIC	Stems in chamber					á	
SL	shaves lead						
SLC	Stems left side of chamber						
SMOC	Stretch marks on case						
SOR	Stem over-ride						1
SP	Stems port						
SR	Shoulder rough						
SRC	Stems right side of chamber	_					


SRIC	Specific rings in chamber						
8500	Surface scratches on case		**************************************				
STC	Stems top.chamber		***************************************				
SWE	Safety switch works too easily		***************************************	1			
SWH	Safety switch works too hard		âsa.				
sww	Safety ewitxh work						
TD	Tips down						
TU	Tips up						
TWP	Trigger won't pull						
TWR	Trigger won't retract						
UNCN-T	Uncoded	***	// Was				
XH	Extracts hard					Sax.	


HI	High		***************************************				
LO	Low		***************************************	/%			
LEFT	Left		***************************************		**************************************		
RIGHT	Right						
DG	Doesn't Group						
FSST	Front sight tipped					*****	
RSTT	Rear sight tipped					ž.	
RSBR	Rear sight base raised						
FSTR	Front sight raised						
FSTL	Front sight loose		***************************************				
RSTL	Rear sight loose		*******				
MGPT-G	Missing parts at target		-				
UNCN-G	Uncoded nonconformity at target						


AI-P	Assembly incompleye at proof							
868	Barrel bracket gracked or broken at proof							
BC-P	Blows cases at proof		Antonia					
BEB-P	Barrel extension broken at proof		Managara anaka					
BLP-P	Blanked primer at proof		áva.					
BLSO-P	Barrel lug shot off at proof							
BP-P	Blown primer at proof							
BS-P	Barrel split at proof	···						
DLOS-P	Doesn't lock over shells at proof				**************************************			
ESB-P	Ejector sticks back at proof							
FCB-P	Fore-end cracked at proof					11/1/11		
FESO-P	Fore-end shot off at proof						Sec.	
FF-P	Fails to fire at proof		-					
GCSO-P	Gas cylinder shot off at proof	Anna	************					
MSI-P	Magnaflux stamp illegible on bbl		4.00	***				
MSM-P	Magnaflux stamp missing on bbl		-		× × × × × × × × × × × × × × × × × × ×			
PP-P	Pierced primer at proof		***************************************					
SCB-P	Stock cracked or broken at proof		***************************************					
UNCM-P	Uncoded proof malfunctions		-				2000	

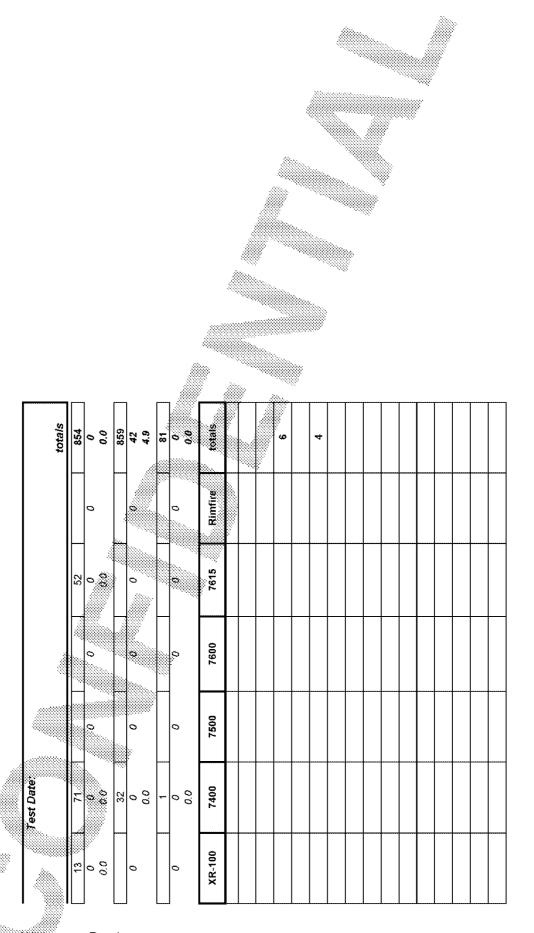


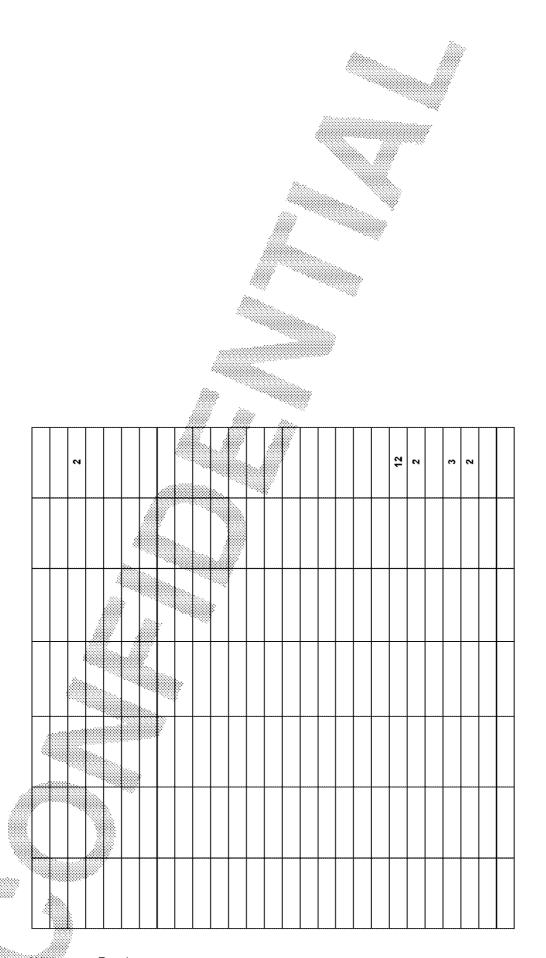

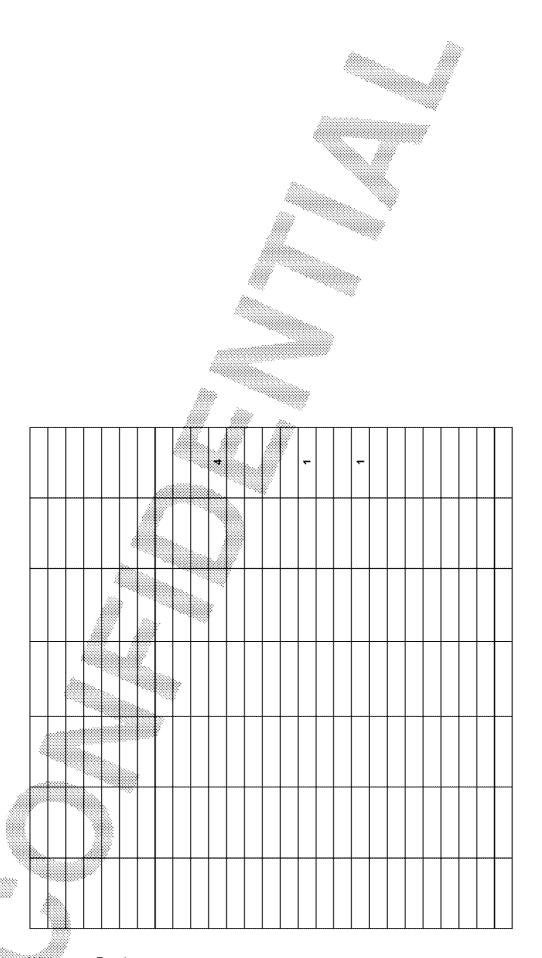

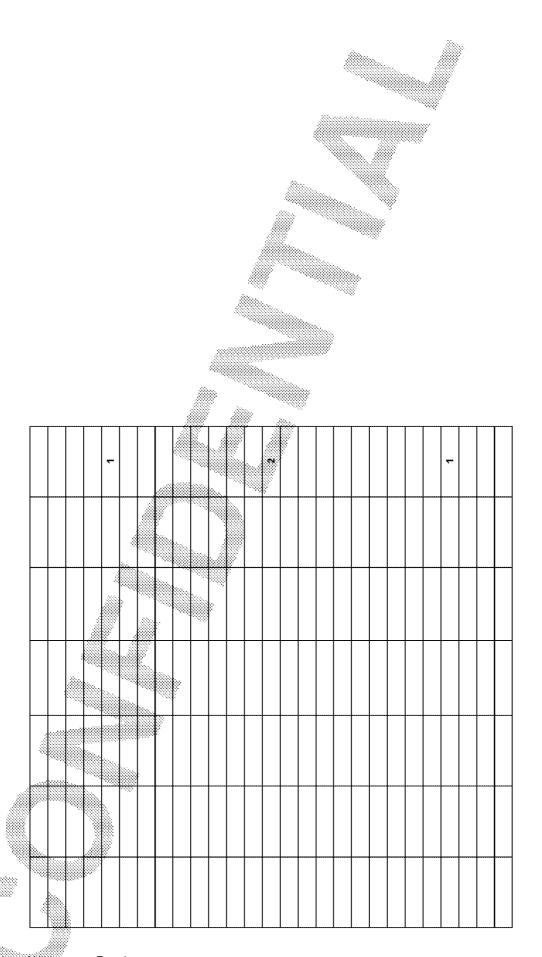

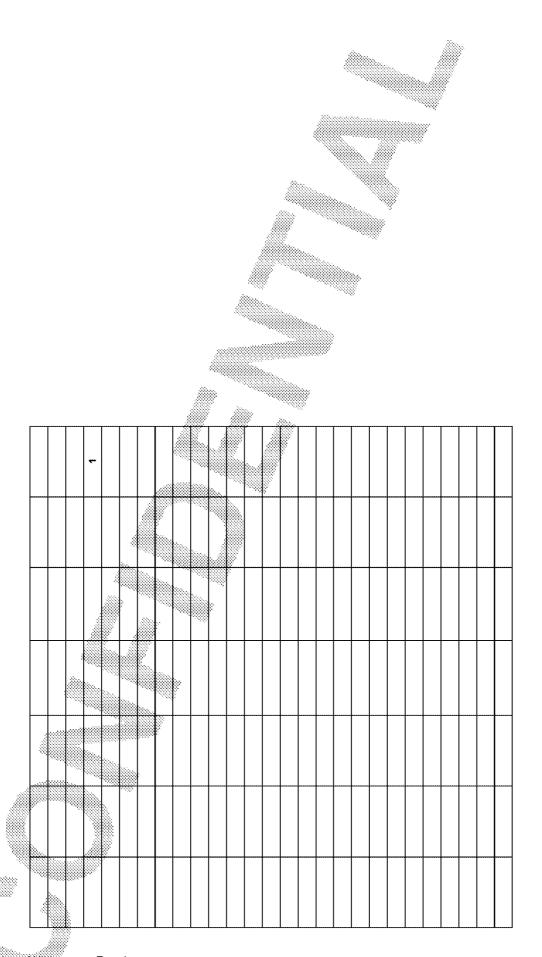

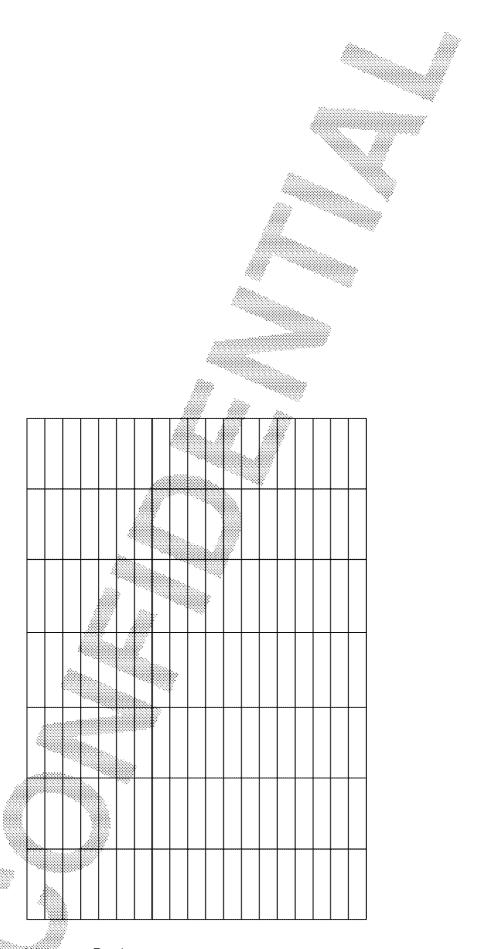

Subject to Protective Order - Williams v. Remington

	2000000000	***************************************									
Summa	ary			oof Failures	693						
			Tota	al Rejected:	103						
			Overall F	al Rejected: Reject Rate:	14.86						
				\$hot:	14	59	15	50	53		295
	***************************************	Proof		Rejected:	0	1	0	0	0	0	0
				Percent	0.0	200	0.0	0.0	0.0		0.0
		<i>#</i> #		Shot	. 11	22	2	68	46		303
		Test	¥ (##	Rejected:	2	1	O	17	1	0	38
				Percent:	2 18,2	4.5	0.0	25.0	2.2		12.5
				Shot:				6	3		25
		Target		Rejected:	0 3333	## #	O)	0	0	0	0
		3		Percent:	0		O	0	0.0		0.0

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$S	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7

AB	Action binds		***************************************	<i>200</i> 2				
BABS	Bulge at body shoulder		rendere andre					
BAC	Burr at chamber	2	***************************************	1.55	5			
BBMA	BBL-to-bolt misalignment		and the same of th		****			
ВВ	Bolt binds/catches		1		7			2
BCOBS	Bolt catches on bolt stop		**************************************					
BCOF	Bolt catches on follower		***************************************				3,000	
ВС	Blows cases		Panarata and a same a				,	
BHR	Bolt hits receiver		- Anna Anna Anna Anna Anna Anna Anna Ann					
BHS	Bolt plug hits safety switch		***************************************					
BLOP	Bar lock or disconnector out of position		***************************************					
BLSO	Barrel lug shot off		***					
BPO	Bolt pulls out		***************************************					
BSSM	Bolt stems shell in magazine		Antonia de la compania del compania del compania de la compania del la compania de la compania del la compania de la compania de la compania del la compania de la compania del la compania					
BWCD	Bolt won't cam down							

BWCFM


Bolt won't close over full magazine


20000000 11 12 00000000.							
Fires automatically							
Follower binds		Part of the Control o					
Fails to cognect		***************************************					
Fore-end gracked or broken							
Follows-down		\$vv.					
Fails to fire							
Flat firing pin							
Fires on safe	· · ·						
Firing pin hits bbl				* ***********************************			
Firing pin hits inside rim							
Floor plate opens	***	//////////////////////////////////////		***	11/1/1		
Floor plate opens hard						Sec.	
Fires when safe is released				*** //			
Follower tips			***************************************				5
Gas cyl shot off			***				W// /////
Heavy bolt lift				*****			
Heading mismatch-steps on case							
High pressure ammo							
Hard under rail		***************************************		1		2000 B	
Jumps cartridge						,	
Jumps magazine							***///
Jars off		A THE STATE OF THE					
Light blow							
Magazine assembles hard							
Magazine capacity wrong		-					
Misfires (ammo)							
Magazine follower out of position							
	Follower binds Fails to connect Fore-end cracked or proken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong	Follower binds Fails to coanect Fore-end pracked or broken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (ammo)	Follower binds Fails to connect Fore-end cracked or proken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (ammo)	Follower binds Fails to connect Fore-end gracked or broken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (ammo)	Follower bings Fails to conflect Fore- end cracked: or broken Follows-ctown Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (armo)	Follower binds Fails to connect Fore-end dracked or broken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (armmo)	Follower birids Fails to cognect Fore-end cracked or broken Follower-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bott lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine capacity wrong Misfires (ammo) Misfires (ammo)


ML	Magazine lögse							
MLH	Magazine lo ad s hard							
MRH	Magazine removes hard							
ОН	Opens hard							
OR	Over-rides		\$40.					2
PH	Pulls hard							
PSI	Proof stamp illegible							
PSM	Proof stamp missing	· · · · //						
RBOC	Rings and bulges on case							2
RDW	(Action) release doesn't work							
RIC	Rings in chamber	****			3	<i>‱</i> 1		
RIS	Ring in sholder						Sec.	
RS	Rim srem							
SBC	Stems bottom chambers							13
SBE	Stems bbl extension			176				
SCB	Stock cracked or broken				*****			
SCX	Shell catches							
SHI	Short indent							
SI	Stems incline						*****	1
SIC	Stems in chamber						ž.	
SL	shaves lead							******
SLC	Stems left side of chamber							
SMOC	Stretch marks on case							
SOR	Stem over-ride							5
SP	Stems port							
SR	Shoulder rough							
SRC	Stems right side of chamber							


	2
2004	
	1
	,

AI-P	Assembly incompleye at proof							
868	Barrel bracket gracked or broken at proof		**************************************					
BC-P	Blows cases at proof		Antonia					
BEB-P	Barrel extension broken at proof		**************************************					
BLP-P	Blanked primer at proof		- 3000.					
BLSO-P	Barrel lug shot off at proof							
BP-P	Blown primer at proof							
BS-P	Barrel split at proof	· · · //						
DLOS-P	Doesn't lock over shells at proof				**************************************			
ESB-P	Ejector sticks back at proof							
FCB-P	Fore-end cracked at proof	***			***	<i>M</i> ////		
FESO-P	Fore-end shot off at proof						5to.	
FF-P	Fails to fire at proof		***************************************		***			
GCSO-P	Gas cylinder shot off at proof		***					
MSI-P	Magnaflux stamp illegible on bbl		-	***				WW 1////
MSM-P	Magnaflux stamp missing on bbl		-		· · · · · · · · · · · · · · · · · · ·			
PP-P	Pierced primer at proof		-					
SCB-P	Stock cracked or broken at proof		***************************************					
UNCM-P	Uncoded proof malfunctions		1				****	

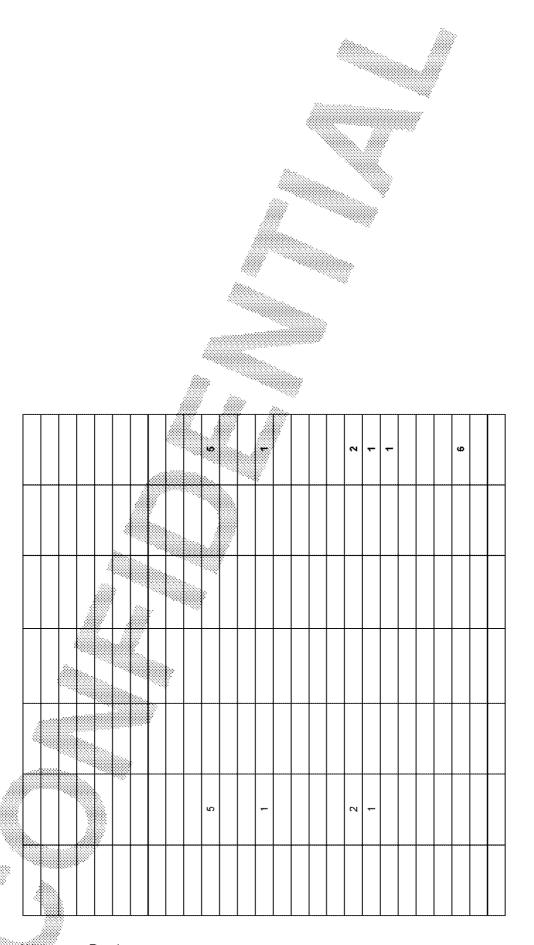


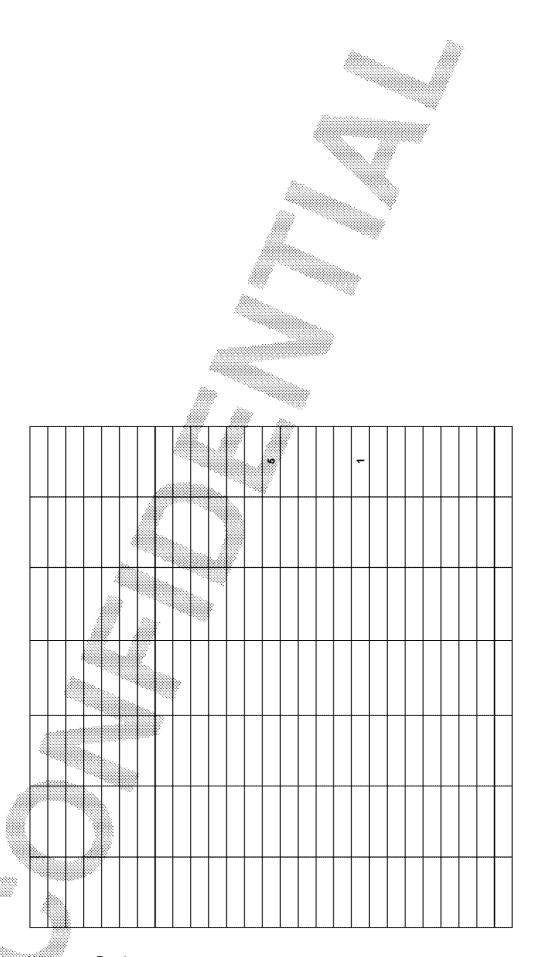

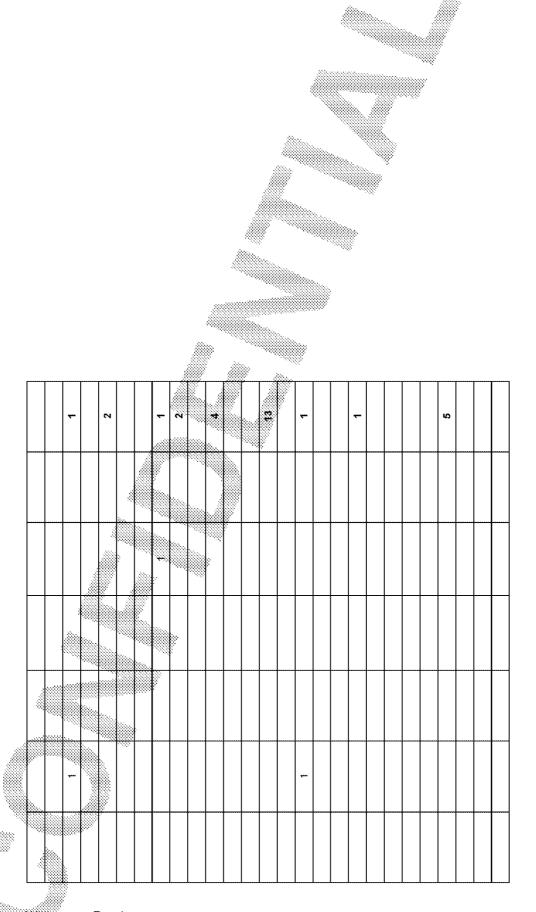

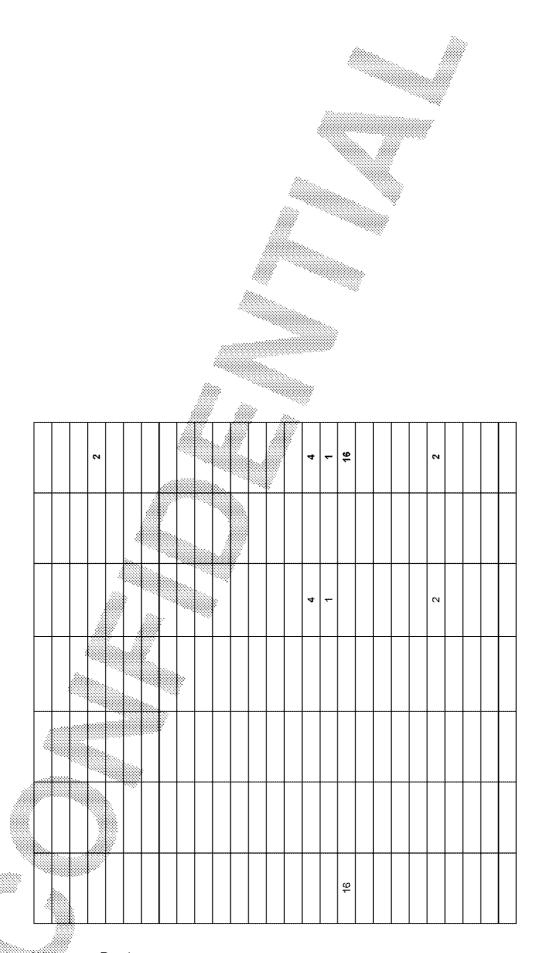

Subject to Protective Order - Williams v. Remington

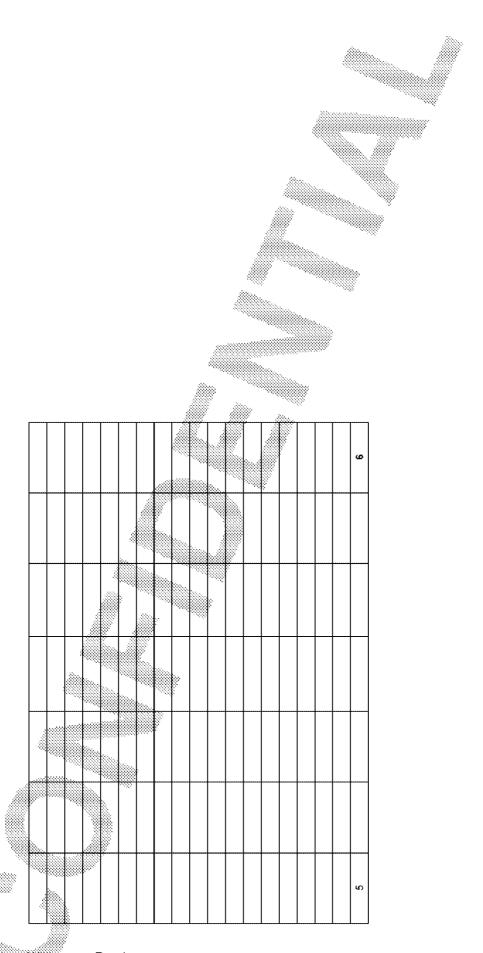

Subject to Protective Order - Williams v. Remington

۲	ł
L	ŧ
L	1
C)
C	
L	1
ŀ	1
-	J
N)
V)
u	

	18000000	*******									
Summ	ary	Total		Proof Failures							
			T	otal Rejected: Il Reject Rate:	122						
			Overa	l Reject Rate:	16.40						
				Shot:	11	41	1	30	52		231
	******	Proof	### 3	Rejected:	o	0	0	0	1	0	1
	***************************************			Percent Shot	0.0	0.0	0.0	0.0	1.9		0.4
				Shot.	9	###		43	28		315
		Test	8	Rejeptød:	Q.	0	O 0	6	1	0	55
				Shot. Rejected: Percent: Shot. Rejected: Percent:	0.0	0	0	14.0	3.6		17.5
				~\$390 <i>t</i> :	l ###	7 - 2000	100000	2	3		23
		Target		Rejected:	0 8888	9/	Ø	0 0.0	0	0	0
				Percent:	0	Q	O	0.0	0.0		0.0

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			*********				3300-	
AB	Action binds		**********	1///				
BABS	Bulge at body shoulder		***************************************	***************************************				
BAC	Burr at chamber		***************************************		1			
BBMA	BBL-to-bolt misalignment		***************************************		*****			
вв	Bolt binds/catches		***************************************		2	1		2
BCOBS	Bolt catches on bolt stop		The services			.,		
BCOF	Bolt catches on follower		***************************************				****	
ВС	Blows cases						8	
BHR	Bolt hits receiver		- Control of the Cont					
BHS	Bolt plug hits safety switch		-					
BLOP	Bar lock or disconnector out of position		***************************************					
BLSO	Barrel lug shot off		***************************************					
BPO	Bolt pulls out		***************************************					
BSSM	Bolt stems shell in magazine							
BWCD	Bolt won't cam down							

	ı
۲	ŧ
-	
C)
C)
Ē	1
L	1
	1
)
Ĉ)
_)

BWCFM	Bolt won't close over full magazine							
CD	Case dented		***************************************					
СН	Closes hard		***************************************					
CLM	Can't laod magazine							
со	Cut-off		- Sec.					
CR	Cuts rim							
CS	Cases swell							
CTOG	Chamber tom or gouged							
CTP	Creepy trigger pull							
CWSB	Cams wrong side of action bar							
DBB	Doesn't blow back	***				<i>11/1</i> /11		
DCS	Double click in safety switch						Stor.	
DCT	Double click in trigger				****			
DCU	Doesn't close-up		***************************************					
DE	Doesn't eject		-	100				
DEL	Doesn't eject live round				*******			
DFB	Doesn't feed back		****					
DFU	Doesn't feed up		haddan and a said a					
DLO	Doesn't lock open (after last shell)						*****	
DLU	Doesn't lock-up		***************************************					
DS	Dead safe							12
DX	Doesn't extract							
DXL	Doesn't extract live round							
EDS	Extractor drops shell		***************************************					
ESB	Ejector sticks back		-					4
ESCR	Empty shell catches receiver							
ESS	Extractor stems shell							

FA	Fires automatically						
FB	Follower binds						
FC	Fails to comect						
FCB	Fore-end cracked or broken						
FD	Follows-down		žec.				
FF	Fails to fire						
FFP	Flat firing pin						
FOS	Fires on safe						
FPHB	Firing pin hits bbl				ites. ##/////www.		
FPHI	Firing pin hits inside rim						
FPO	Floor plate opens	. 443					1
FPOH	Floor plate opens hard					Sec.	
FSR	Fires when safe is released						
FT	Follower tips						11
GCSO	Gas cyl shot off			****			
HBL	Heavy bolt lift				1		
HMSC	Heading mismatch-steps on case						
HPA	High pressure ammo						
HUR	Hard under rail					******	4
JCS	Jumps cartridge					ž.	
JM	Jumps magazin e						
JO	Jars off						
LB	Light blow						
MAH	Magazine assembles hard						
MCW	Magazine capacity wrong						
MFA	Misfires (ammo)						
MFOP	Magazine follower out of position						

ML


Magazine loose


Magazine loads hard


Specific rings in chamber							
Surface scratches on case							
Stems top chamber		***************************************					
Safety switch works too easily		-					
Safety switch works too hard		ása.					
Safety ewitxh wein't work							
Tips down							
Tips up							
Trigger won't pull							
Trigger won't retract							
Uncoded					100		
Extracts hard						5ec.	


High		***************************************	**********				
Low			***				
Left		-		**************************************			
Right		-					
Doesn't Group							
Front sight tipped		***************************************				200 4	
Rear sight tipped		***************************************				ž.	
Rear sight base raised							******
Front sight raised							
Front sight loose							
Rear sight loose		***************************************					
Missing parts at target		· ·					
Uncoded nonconformity at target		-					
		-					
	Surface scratches on pase Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewitxh work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scratches on dase Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewilxh won't work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scratches on base Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewitxh work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight loose Rear sight loose Missing parts at target	Surface scratches on base Stems top enamber Safety switch works too easily Safety switch works too hard Safety ewitxh work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight base raised Front sight roised Front sight loose Rear sight loose Missing parts at target	Surface scratches on gase Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewitch work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight tose Front sight loose Rear sight loose Missing parts at target	Surface scratches on case Stems top chamber Safety switch works too easily Safety switch works too easily Safety switch works too hard Safety ewitxh work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight toose Rear sight loose Missing parts at target	Surface scratches on saise Stems top chainber Safety switch works too easily Safety switch works too hard Safety ewitch works too hard Safety ewitch works Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight tipped Front sight loose Rear sight loose Missing parts at target


AI-P	Assembly incompleye at proof							
868	Barrel bracket cracked or broken at proof							
BC-P	Blows cases at proof		***************************************					
BEB-P	Barrel extension broken at proof							
BLP-P	Blanked primer at proof		\$20.					
BLSO-P	Barrel lug shot off at proof							
BP-P	Blown primer at proof							
BS-P	Barrel split at proof							
DLOS-P	Doesn't lock over shells at proof							
ESB-P	Ejector sticks back at proof							
FCB-P	Fore-end cracked at proof	***			***)		
FESO-P	Fore-end shot off at proof						560.	
FF-P	Fails to fire at proof				***	1		
GCSO-P	Gas cylinder shot off at proof							
MSI-P	Magnaflux stamp illegible on bbl		***************************************	***				
MSM-P	Magnaflux stamp missing on bbl				******			
PP-P	Pierced primer at proof					******		
SCB-P	Stock cracked or broken at proof		***************************************					
UNCM-P	Uncoded proof malfunctions						****	1
	•	•		•	-		;	

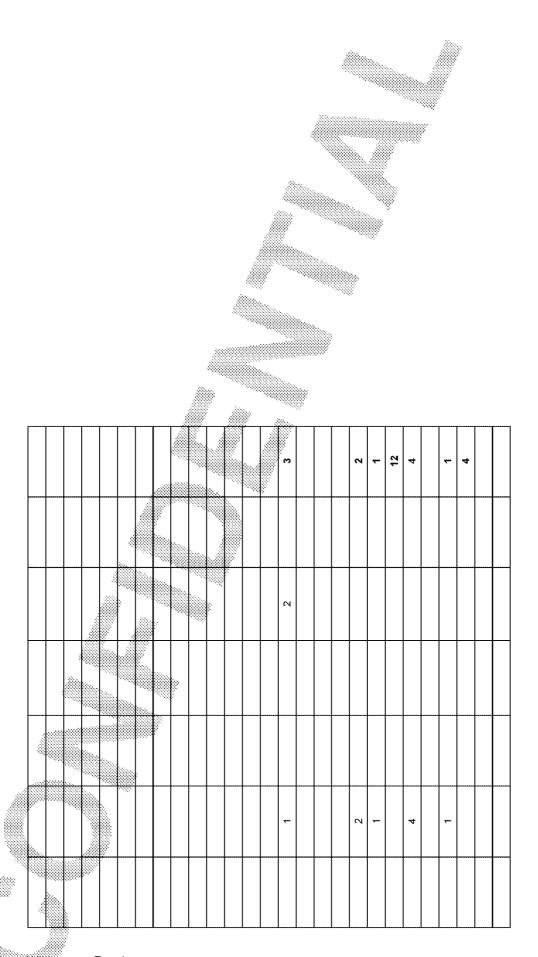

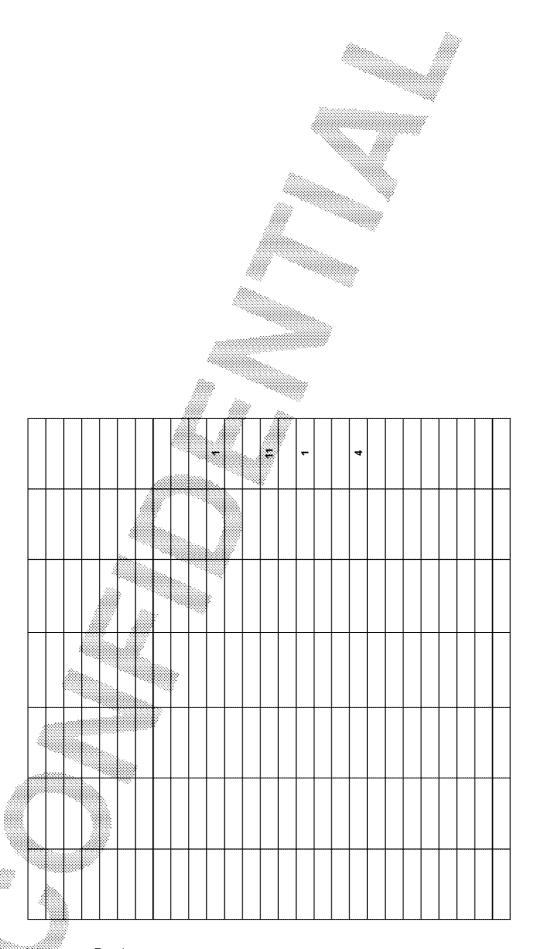

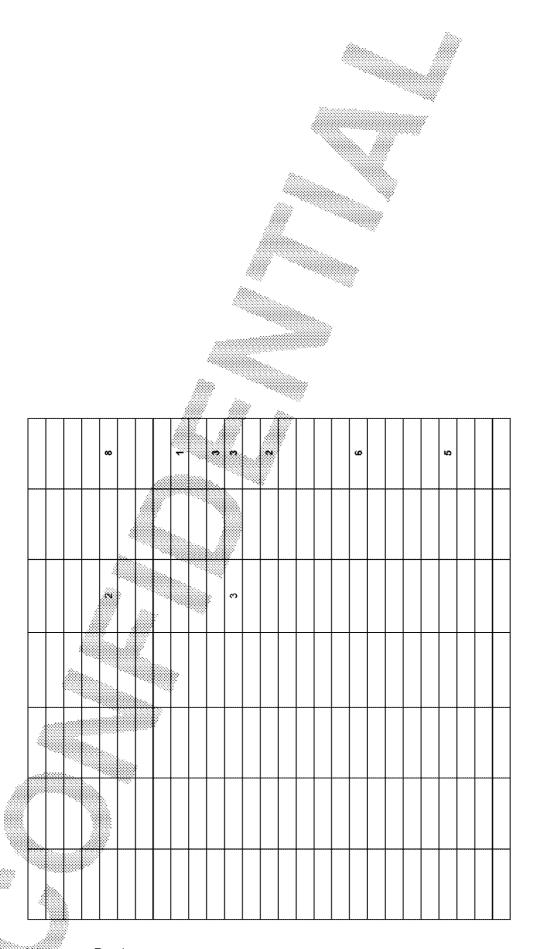

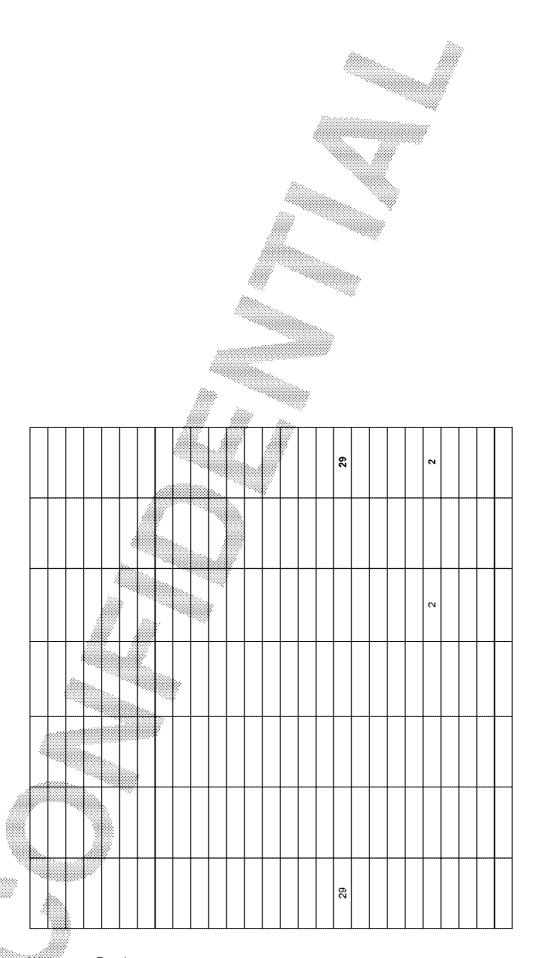

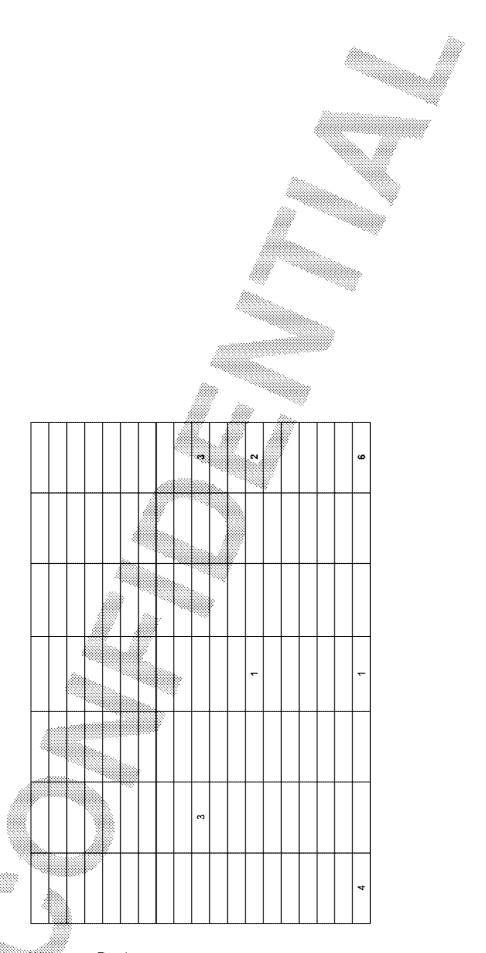

Subject to Protective Order - Williams v. Remington

	193999999999										
Summa	ary	Total		roof Failures	6	04					
			To	tal Rejected:		29					
				Reject Rate:	4,	80					
				\$hot:	25	59	9	23	168		78
	***************************************	Proof	### ##	Rejected:	• • • • • • • • • • • • • • • • • • •	0	0	0	0	0	0
				Percent:	0 0.0	0.0	0.0	0.0	0.0		0.0
				Shot.	1 0000	19		13	153		31
	-	Test	ř i	Reje cted :	Q.	2	0	2	3	Đ	3
	,	, 55.	35	Shot Rejected Percent Shot Rejected Percent	0.0	10.5		15.4	2.0		9.7
				Shot:		₩	1988	<i>A</i> .	12		
	•	Target		Rejected:	0 %	/// // //	(0	0	0	0	0
	•	9 - 1		Percent:	0	0	Ü	0	0.0		
						** ********	1271171	******			

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$S	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			*******				X	
AB	Action binds		***************************************	<i></i>	1997			
BABS	Bulge at body shoulder		rendere andre	***************************************				
BAC	Burr at chamber		***************************************	1.55				
BBMA	BBL-to-bolt misalignment		and the same of th		*****		2000	
ВВ	Bolt binds/catches		1			1		
BCOBS	Bolt catches on bolt stop		**************************************			.,		
BCOF	Bolt catches on follower		of the same of the					
ВС	Blows cases		onio e e e e e e e e e e e e e e e e e e e				8	
BHR	Bolt hits receiver		- Anna Anna Anna Anna Anna Anna Anna Ann					
BHS	Bolt plug hits safety switch		The state of the s					
BLOP	Bar lock or disconnector out of position		***************************************					
BLSO	Barrel lug shot off		***					
BPO	Bolt pulls out		***************************************					
BSSM	Bolt stems shell in magazine		- Control of the Cont					
BWCD	Bolt won't cam down		****					


A A							
BWCFM	Bolt won't close over full magazine						
CD	Case dented						
СН	Closes hard				1		
CLM	Can't laod magazine						
со	Cut-off	Sec.					
CR	Cuts rim						
CS	Cases swell						
стос	Chamber torn or gouged						
CTP	Creepy trigger pull						
CWSB	Cams wrong side of action bar						
DBB	Doesn't blow back			***	11/1/11		
DCS	Double click in safety switch					Sec.	
DCT	Double click in trigger			****			
DCU	Doesn't close-up						
DE	Doesn't eject		***				
DEL	Doesn't eject live round			**************************************			
DFB	Doesn't feed back						
DFU	Doesn't feed up						
DLO	Doesn't lock open (after last shell)					2000	
DLU	Doesn't lock-up					,	
DS	Dead safe						74//
DX	Doesn't extract						
DXL	Doesn't extract live round	***************************************					
EDS	Extractor drops shell	1		2			
ESB	Ejector sticks back						
ESCR	Empty shell catches receiver						
ESS	Extractor stems shell						


FA	Fires automatically							
FA FB	Follower binds							
FC	Fails to connect	ė.						
FCB	Fore-end cracked of broken							
FD	Follows-down		žito.					
FF	Fails to fire		<i></i>					
FFP	Flat firing pin							
FOS	Fires on safe							
FPHB	Firing pin hits bbl							
FPHI	Firing pin hits inside rim							
FPO	Floor plate opens							
FPOH	Floor plate opens hard						Sec.	
FSR	Fires when safe is released				****			
FT	Follower tips							1
GCSO	Gas cyl shot off			1980				
HBL	Heavy bolt lift				**************************************			
HMSC	Heading mismatch-steps on case							
HPA	High pressure ammo							
HUR	Hard under rail						**************************************	
JCS	Jumps cartridge						***	
JM	Jumps magazin e					1		
JO	Jars off							
LB	Light blow							
MAH	Magazine assembles hard							
MCW	Magazine capacity wrong							
MFA	Misfires (ammo)							
MFOP	Magazine follower out of position		_					
·			·	·		·		<u> </u>


ML	Magazine lööse						
MALH	Magazine loads hard						
MRH	Magazine removes hard	.,.					
ОН	Opens hard						
OR	Overandes		1 300				
PH	Pulls hard						
PSI	Proof stamp illegible						
PSM	Proof stamp missing						
RBOC	Rings and bulges on case						
RDW	(Action) release doesn't work						
RIC	Rings in chamber	***	//////	***	11/1/11		
RIS	Ring in sholder					Sec.	
RS	Rim srem						
SBC	Stems bottom chambers						
SBE	Stems bbl extension						
SCB	Stock cracked or broken			**************************************			
SCX	Shell catches						
SHI	Short indent						
SI	Stems incline						1
SIC	Stems in chamber					**	
SL	shaves lead						
SLC	Stems left side of chamber						
SMOC	Stretch marks on case						
SOR	Stem over-ride						
SP	Stems port						
SR	Shoulder rough						
SRC	Stems right side of chamber						


SRIC	Specific rings in chamber							
SSOC	Surface scratches on case		***************************************					
STC	Stems top chamber							
SWE	Safety switch works too easily		-					
SWH	Safety switch works too hard		dece.					
sww	Safety ewitxh won't work							
TD	Tips down							
TU	Tips up							
TWP	Trigger won't pull							
TWR	Trigger won't retract							
UNCN-T	Uncoded					<i>M</i> ////		
хн	Extracts hard						Sec.	
							<i>- 1</i>	
HI	High							
LO	Low			**				
LEFT	Left				*****			
RIGHT	Right							
DG	Doesn't Group							
FSST	Front sight tipped		***************************************				200 B	
RSTT	Rear sight tipped						,	
RSBR	Rear sight base raised							
FSTR	Front sight raised							
FSTL	Front sight loose							
RSTL	Rear sight loose							
MGPT-G	Missing parts at target		-					
UNCN-G	Uncoded nonconformity at target							
		•	•	•	•			

AI-P	Assembly incompleye at proof						
868	Barrel bracket gracked or broken at proof						
BC-P	Blows cases at proof	 ***************************************					
BEB-P	Barrel extension broken at proof						
BLP-P	Blanked primer at proof	ása.					
BLSO-P	Barrel lug shot off at proof						
BP-P	Blown primer at proof						
BS-P	Barrel split at proof						
DLOS-P	Doesn't lock over shells at proof						
ESB-P	Ejector sticks back at proof						
FCB-P	Fore-end cracked at proof				<i>**</i>		
FESO-P	Fore-end shot off at proof					5ec.	
FF-P	Fails to fire at proof	***************************************					
GCSO-P	Gas cylinder shot off at proof	***************************************					
MSI-P	Magnaflux stamp illegible on bbl		· **				
MSM-P	Magnaflux stamp missing on bbl	-		× × × × × × × × × × × × × × × × × × ×			
PP-P	Pierced primer at proof	-					
SCB-P	Stock cracked or broken at proof	***************************************					
UNCM-P	Uncoded proof malfunctions					*****	
	_					á	

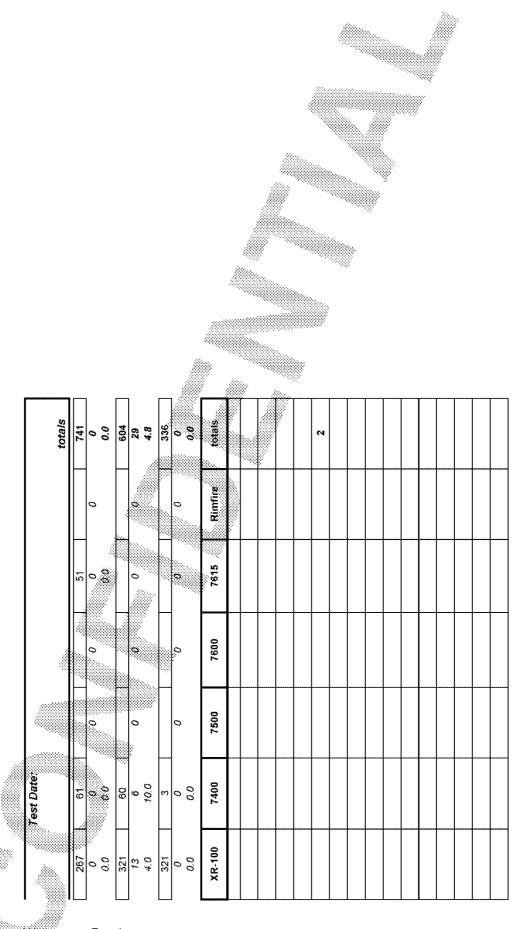


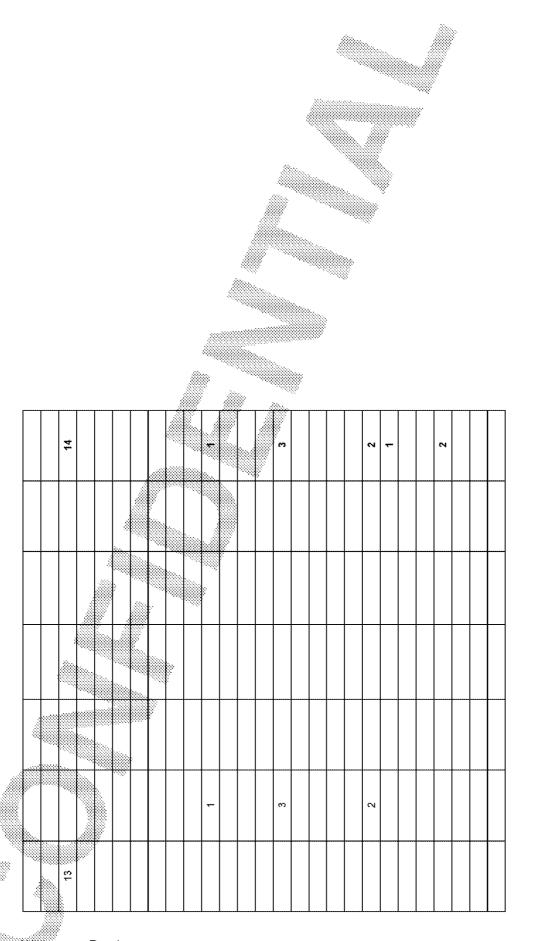

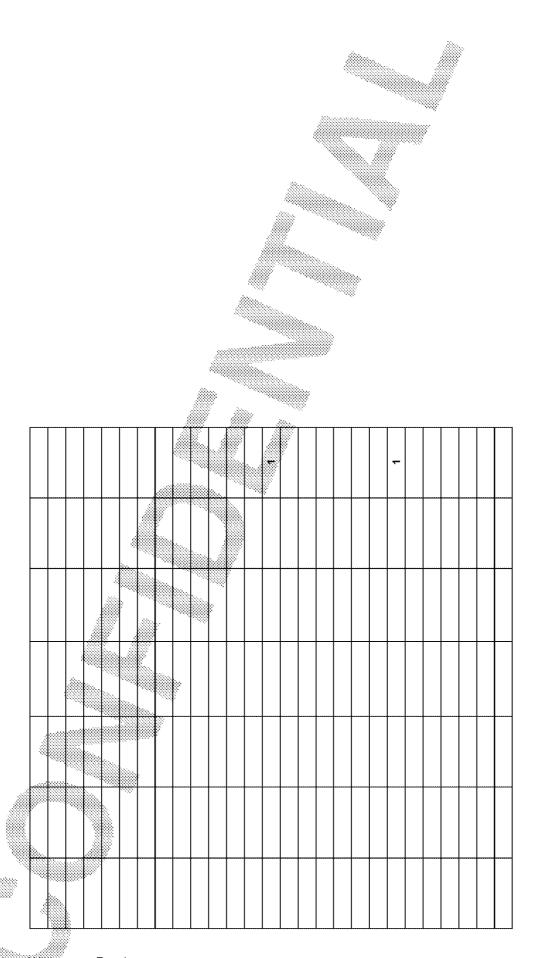

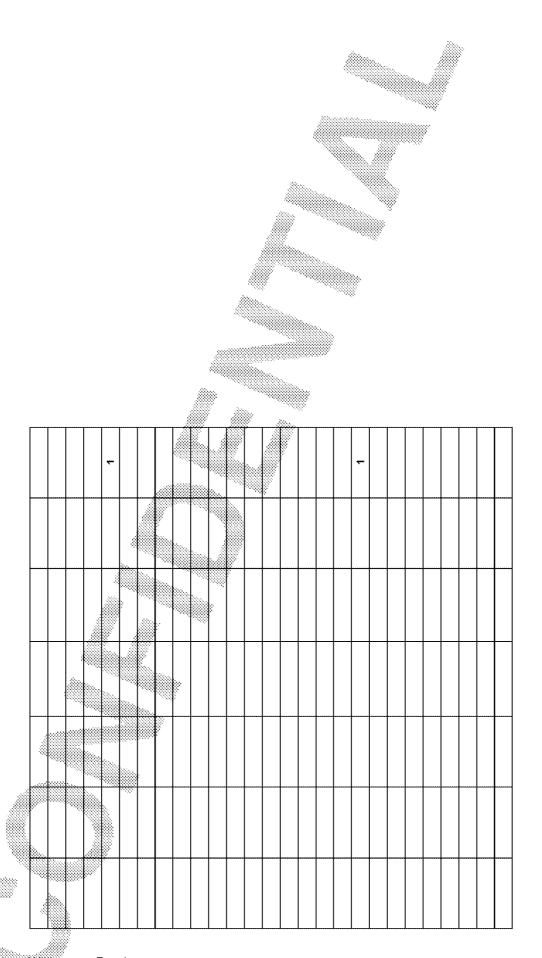



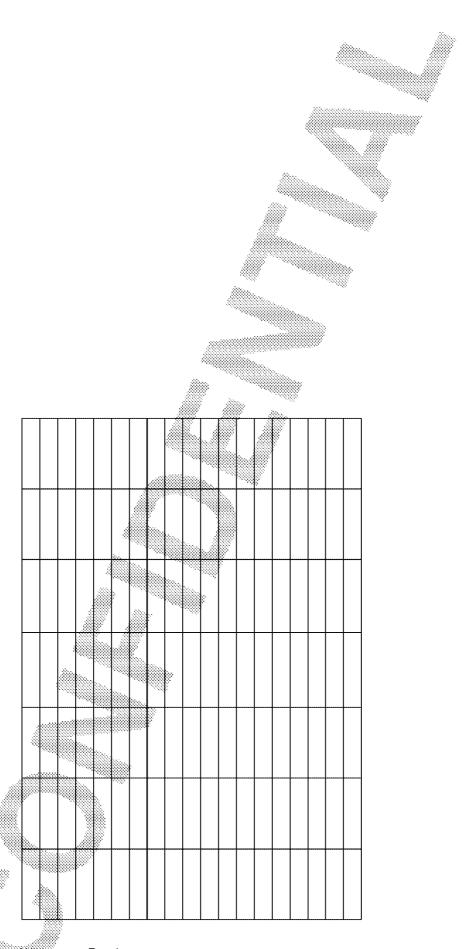

Subject to Protective Order - Williams v. Remington

	200000000000000000000000000000000000000										
Summa	iny	Fotal		oof Failures	126						
			Tot	al Rejected:	10						
				al Rejected: Reject Rate:	7.94						
	Pi	oof		Shot: Rejected: Percent: Shot: Rejected: Percent:	83	40	16	67	26		43
	Pı	oof		Rejected:	0	0	0	0	0	0	0
				Percent;	0 0.0	0.0	0.0	0.0	0.0		0.0
				Shot.	**************************************	₩₩₩					
	Te	st	* ***	Reje șted :	Q	0	O	0	0	Đ	0
				Percent:		0					
				SPOL.	.888	F	100000	b .			
	Ta	rget		Rejected:	0	Ö	, o	0	0	0	0
		_		Percent:	3800	2000/	222	20000000000000000000000000000000000000			

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			************				330.	
AB	Action binds							
BABS	Bulge at body shoulder							
BAC	Burr at chamber							
BBMA	BBL-to-bolt misalignment				****			
ВВ	Bolt binds/catches		1					
BCOBS	Bolt catches on bolt stop							
BCOF	Bolt catches on follower						2000	
вс	Blows cases						;	
BHR	Bolt hits receiver		1					
BHS	Bolt plug hits safety switch							
BLOP	Bar lock or disconnector out of position		1					
BLSO	Barrel lug shot off							
BPO	Bolt pulls out							
BSSM	Bolt stems shell in magazine							
BWCD	Bolt won't cam down							


BWCFM	Bolt won't close over full magazine					l
CD	Case dented					
сн	Closes hard					
CLM	Can't laod magazine					
со	Cut-off		šta.			
CR	Cuts rim					
CS	Cases swell					
CTOG	Chamber torn or gouged					
CTP	Creepy trigger pull					
CWSB	Cams wrong side of action bar					
DBB	Doesn't blow back	***		***		
DCS	Double click in safety switch				Sec.	
DCT	Double click in trigger					
DCU	Doesn't close-up					
DE	Doesn't eject					
DEL	Doesn't eject live round			*******		
DFB	Doesn't feed back					1
DFU	Doesn't feed up					
DLO	Doesn't lock open (after last shell)				*****	
DLU	Doesn't lock-up				8	
DS	Dead safe					
DX	Doesn't extract					
DXL	Doesn't extract live round					
EDS	Extractor drops shell					
ESB	Ejector sticks back					
ESCR	Empty shell catches receiver					
ESS	Extractor stems shell					


	998888691							
FA	Fires automatically							
FB	Follower binds		***************************************					
FC	Fails to connect	,.						
FCB	Fore-end cracked or broken							
FD	Folfows-down		dus.					
FF	Fails to fire		- A.					
FFP	Flat firing pin							
FOS	Fires on safe							
FPHB	Firing pin hits bbl							
FPHI	Firing pin hits inside rim							
FP0	Floor plate opens	***			***	11/1/11		
FPOH	Floor plate opens hard						560.	
FSR	Fires when safe is released			11/11/1	****			
FT	Follower tips							*** ******
GCSO	Gas cyl shot off			7.00				
HBL	Heavy bolt lift				**************************************			
HMSC	Heading mismatch-steps on case							
HPA	High pressure ammo							
HUR	Hard under rail		***************************************				2000	
JCS	Jumps cartridge		1				;	
JM	Jumps magazin e							
JO	Jars off							
LB	Light blow							
MAH	Magazine assembles hard		***					
MCW	Magazine capacity wrong							
MFA	Misfires (ammo)							
MFOP	Magazine follower out of position		-					

ML	Magazine logse							
MALH	Magazine lo ads hard							
MRH	Magazine removes hard							
ОН	Opens hard							
OR	Over-ndes		što.					
PH	Pulls hard							
PSI	Proof stamp illegible							
PSM	Proof stamp missing							
RBOC	Rings and bulges on case							
RDW	(Action) release doesn't work							
RIC	Rings in chamber	***	//////		***	<i>M</i>		
RIS	Ring in sholder						Sec.	
RS	Rim srem			11/11/1	****			
SBC	Stems bottom chambers			***************************************				ilean.
SBE	Stems bbl extension			7.00				
SCB	Stock cracked or broken				**************************************			
SCX	Shell catches							
SHI	Short indent							
SI	Stems incline						****	
SIC	Stems in chamber						į.	
SL	shaves lead							
SLC	Stems left side of chamber							
SMOC	Stretch marks on case							
SOR	Stem over-ride							
SP	Stems port							
SR	Shoulder rough							
SRC	Stems right side of chamber							

	<i></i>			 			
SRIC	Specific rings in chamber						
8800	Surface scratches on case		***************************************				
STC	Stems top chamber		**************************************				
SWE	Safety switch works too easily		**************************************				
SWH	Safety switch works too hard		200				
SWW	Safety ewitxh won't work						
TD	Tips down						
TU	Tips up						
TWP	Trigger won't pull			**************************************			
TWR	Trigger won't retract						
UNCN-T	Uncoded						
XH	Extracts hard				***	500.	
			***************************************	****			
HI	High		100				
LO	Low		-				
LEFT	Left		nath daine	*****			
RIGHT	Right		***************************************				
DG	Doesn't Group		11000				
FSST	Front sight tipped		***************************************			2000	
RSTT	Rear sight tipped		ready				
RSBR	Rear sight base raised						***//
FSTR	Front sight raised		vestelanie				
FSTL	Front sight loose		***************************************				
RSTL	Rear sight loose		1				
MGPT-G	Missing parts at target						
UNCN-G	Uncoded nonconformity at target						
		***************************************	***************************************				


AI-P	Assembly incompleye at proof						
868	Barrel bracket gracked or broken at proof						
BC-P	Blows cases at proof		***************************************				
BEB-P	Barrel extension broken at proof		ranning and a second				
BLP-P	Blanked primer at proof		\$40.				
BLSO-P	Barrel lug shot off at proof						
BP-P	Blown primer at proof						
BS-P	Barrel split at proof	· · · · //					
DLOS-P	Doesn't lock over shells at proof				***		
ESB-P	Ejector sticks back at proof						
FCB-P	Fore-end cracked at proof	***			***		
FESO-P	Fore-end shot off at proof					Sec.	
FF-P	Fails to fire at proof		***************************************		****		
GCSO-P	Gas cylinder shot off at proof		************				
MSI-P	Magnaflux stamp illegible on bbl		-	· **			
MSM-P	Magnaflux stamp missing on bbl		***************************************		· · · · · · · · · · · · · · · · · · ·		
PP-P	Pierced primer at proof		***************************************				
SCB-P	Stock cracked or broken at proof						
UNCM-P	Uncoded proof malfunctions		***************************************			2006	
		·				 - 2	

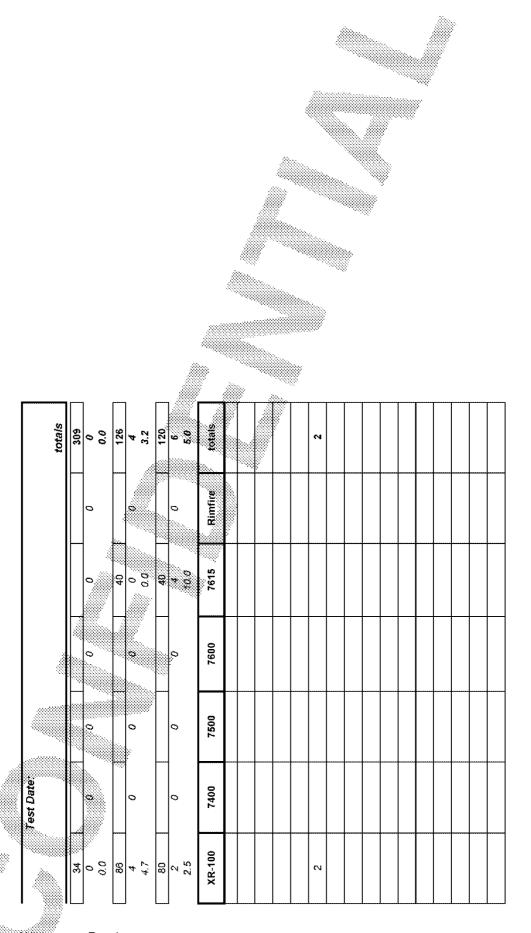


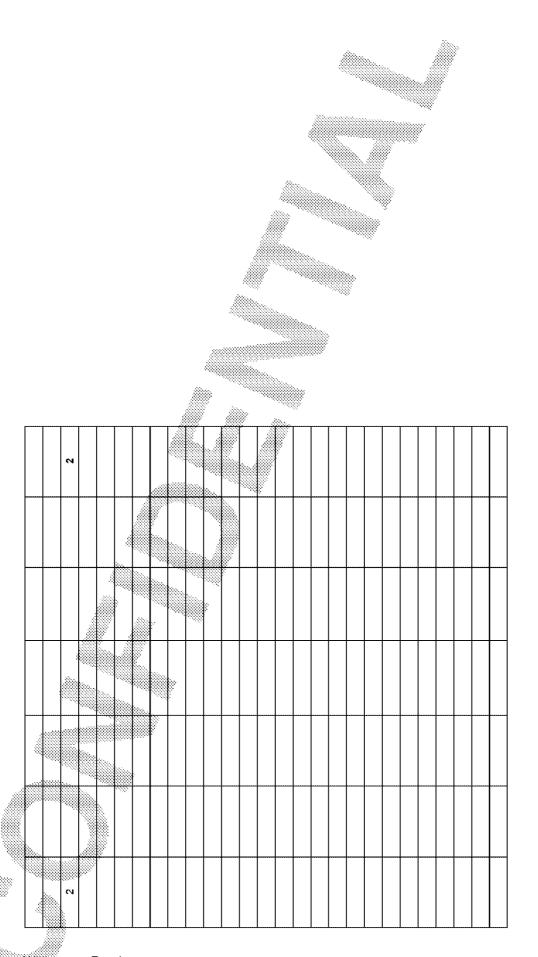





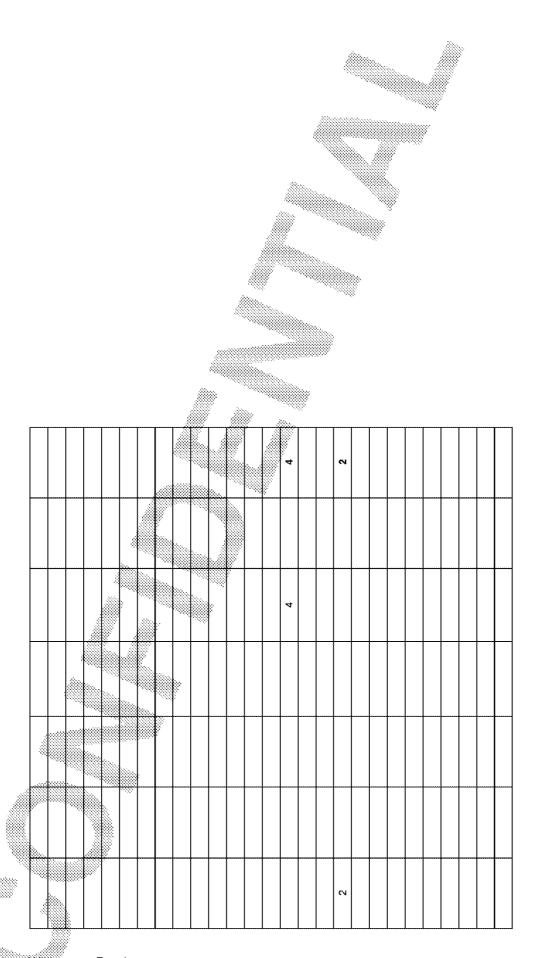

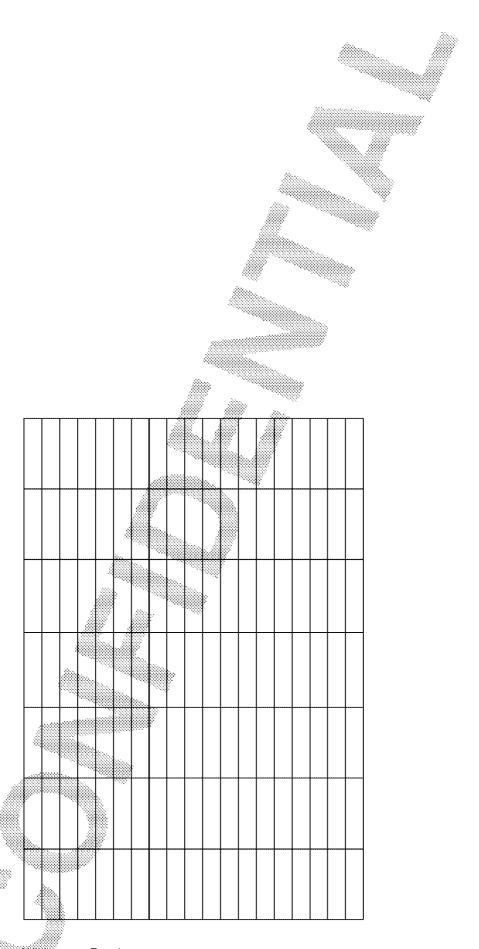

Subject to Protective Order - Williams v. Remington

	///////////////////////////////////////	9880.									
Summa	any	Total	Test + Pro	of Failures		0					
			Tota	Rejected:		0					
Summa			Overall R	l Rejected: eject Rate:							
	i			2000							
	i i	Proof		Rejected.	0	0	0	0	0	0	0
				Percent;	o .						
				Shot.	iliani.	I					
	7	Test "		Reje cted :	Q.	0) o	0	0	O	0
				Reje cted ; Percent: Shot:		0	0				
				SOMOL.			100000				
	7	Target		Rejected:	0	0	Ü	0	0	0	0
		•		Percent:	<i>.</i>		2000				


CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL& ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			***************************************		1 ************************************	***		
AB	Action binds		***************************************					
BABS	Bulge at body shoulder		***************************************					
BAC	Burr at chamber		***************************************					
BBMA	BBL-to-bolt misalignment		-		77.00			
вв	Bolt binds/catches							
BCOBS	Bolt catches on bolt stop						////	
BCOF	Bolt catches on follower						*****	
вс	Blows cases		-				;	
BHR	Bolt hits receiver							
BHS	Bolt plug hits safety switch		***************************************					
BLOP	Bar lock or disconnector out of position		***************************************					
BLSO	Barrel lug shot off							
BPO	Bolt pulls out		400					
BSSM	Bolt stems shell in magazine		-					
BWCD	Bolt won't cam down							

FA	Fires automatically						
FB	Follower binds	***************************************					
FC	Fails to connect	A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1					
FCB	Fore-end cracked of broken	 V					
FD	Follows-down	\$20.					
FF	Fails to fire	<i>*************************************</i>					
FFP	Flat firing pin						
FOS	Fires on safe						
FPHB	Firing pin hits bbl						
FPHI	Firing pin hits inside rim						
FP0	Floor plate opens	//////////////////////////////////////		***	<i>11/1</i> 0		
FPOH	Floor plate opens hard					Sec.	
FSR	Fires when safe is released		11/11/16	***			
FT	Follower tips	***************************************					
GCSO	Gas cyl shot off	*******	****				
HBL	Heavy bolt lift			*******			
HMSC	Heading mismatch-steps on case				******		
HPA	High pressure ammo						
HUR	Hard under rail	***************************************				**************************************	
JCS	Jumps cartridge	A.				8	
JM	Jumps magazin e						
10	Jars off						
LB	Light blow	***************************************					
MAH	Magazine assembles hard						
MCW	Magazine capacity wrong						
MFA	Misfires (ammo)						
MFOP	Magazine follower out of position						
MCW MFA	Magazine capacity wrong Misfires (ammo)						


ML	Magazine loose		ALTERNATION AND ADDRESS OF THE ALTERNATION ADDRESS OF THE ALTE				
BALH	Magazine loads hard						
MRH	Magazine removes hard						
ОН	Opens hard		***************************************				
OR	Over-rides						
PH	Pulls hard						
PSI	Proof stamp illegible						
PSM	Proof stamp missing	· · · · · · · · · · · · · · · · · · ·					
RBOC	Rings and bulges on case						
RDW	(Action) release doesn't work						
RIC	Rings in chamber	***					
RIS	Ring in sholder					50v.	
RS	Rim srem						
SBC	Stems bottom chambers						**************************************
SBE	Stems bbl extension			~~			
SCB	Stock cracked or broken				*****		
SCX	Shell catches						
SHI	Short indent						
SI	Stems incline					2006	
SIC	Stems in chamber					8	***
SL	shaves lead						****
SLC	Stems left side of chamber		****				
SMOC	Stretch marks on case						
SOR	Stem over-ride						
SP	Stems port						
SR	Shoulder rough						
SRC	Stems right side of chamber		***********				

	··········						
SRIC	Specific rings in chamber	ACT TO SERVICE AND ADDRESS OF THE SERVICE AND AD					
850C	Surface scratches on case	***************************************					
STC	Stems top chamber	A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1					
SWE	Safety switch works too easily	VARIABLE					
SWH	Safety switch works too hard	\$20.					
sww	Safety ewitxh wont work	- XX					
TD	Tips down						
TU	Tips up						
TWP	Trigger won't pull						
TWR	Trigger won't retract						
UNCN-T	Uncoded				1000		
хн	Extracts hard					5eo.	
		44440444		****			
HI	High						
LO	Low	***************************************	1%				
LEFT	Left			**************************************			
RIGHT	Right	***************************************					
DG	Doesn't Group						
FSST	Front sight tipped					*****	
RSTT	Rear sight tipped	1				;	
RSBR	Rear sight base raised						
FSTR	Front sight raised						
FSTL	Front sight loose						
RSTL	Rear sight loose	***					
MGPT-G	Missing parts at target						
UNCN-G	Uncoded nonconformity at target						
		-					

AI-P	Assembly incompleye at proof							
868	Barrel bracket stacked or broken at proof							
BC-P	Blows cases at proof		***************************************					
BEB-P	Barrel extension broken at proof		***************************************					
BLP-P	Blanked primer at proof		áte.					
BLSO-P	Barrel lug shot off at proof							
BP-P	Blown primer at proof							
BS-P	Barrel split at proof	··· //						
DLOS-P	Doesn't lock over shells at proof							
ESB-P	Ejector sticks back at proof							
FCB-P	Fore-end cracked at proof	***				<i>**</i>		
FESO-P	Fore-end shot off at proof						Sec.	
FF-P	Fails to fire at proof		***					
GCSO-P	Gas cylinder shot off at proof		***************************************					
MSI-P	Magnaflux stamp illegible on bbl			1%				
MSM-P	Magnaflux stamp missing on bbl		-		**************************************			
PP-P	Pierced primer at proof		-					
SCB-P	Stock cracked or broken at proof		***************************************					
UNCM-P	Uncoded proof malfunctions						2000	
			·	·	·		- 2	

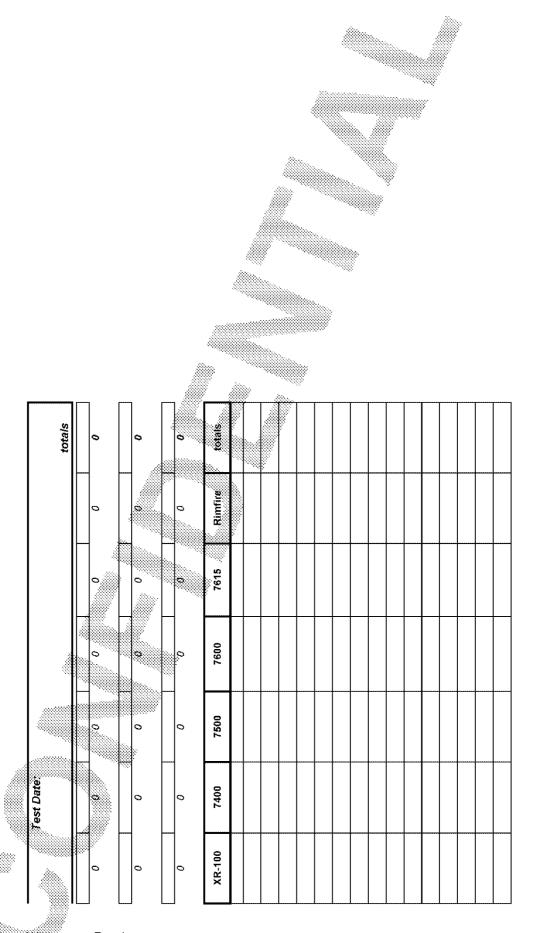


Subject to Protective Order - Williams v. Remington

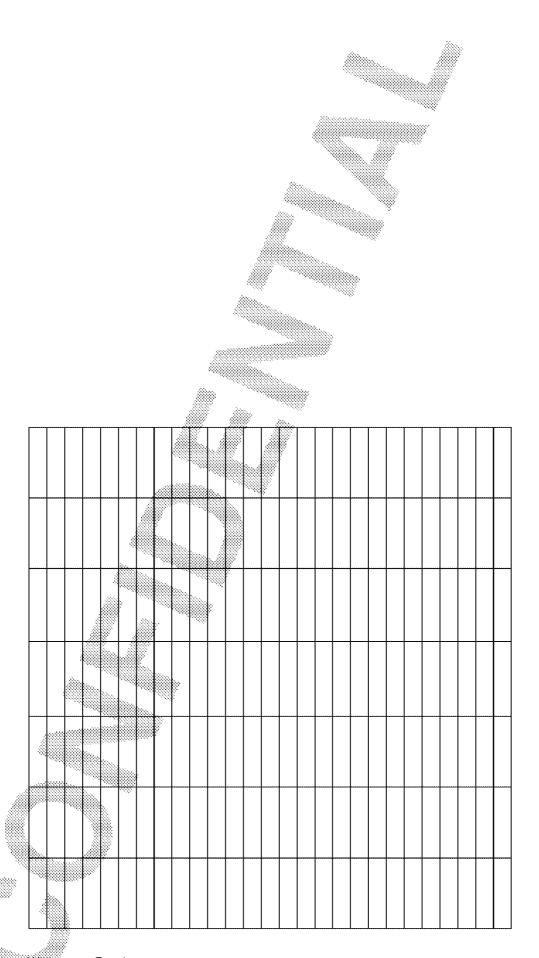








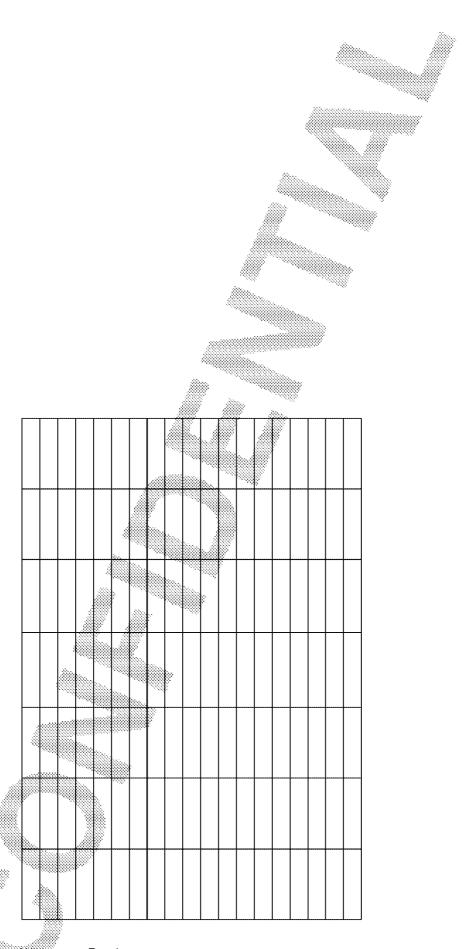

Subject to Protective Order - Williams v. Remington

	7.7.0.4.4.4.4.4.4.4.4.4.4.4.4.4.4.4.4.4.								
Summa	ary Total	Test + Proof Failures							
		Total Rejected: Overall Reject Rate:	163						
		Overall Reject Rate:	13.63						
	Proof	Shot: Rejected:	137	49	23	108	93		298
	Proof	Rejected:	0	0	0	0	0	0	0
		Percent:	0.0	0.0	0.0	0.0	0.0		0.0
		Shot.	77	<i>.</i>	137	164	60		353
	Test	Reje șied :	1	0	14	38	12	0	38
		Shot: Rejected: Percent: Shot: Rejected: Percent:	1 13		14 10.2	23.2	20.0		10.8
		Shot:	8	3000	3834	13	3		14
	Target	Rejected:	0 /////	Q	0 0.0	0 0.0	0	0	0
	1 9	Percent:	0.0		0.0	0.0	0.0		0.0

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$S	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			*******				380.v	
AB	Action binds		**********	1///	- 1			
BABS	Bulge at body shoulder		***************************************					.
BAC	Burr at chamber		***************************************	1	1			1
BBMA	BBL-to-bolt misalignment		***************************************		*****		3////	
ВВ	Bolt binds/catches	1	***************************************	3	3	10		
BCOBS	Bolt catches on bolt stop		***************************************					
BCOF	Bolt catches on follower		***************************************				***	
ВС	Blows cases							
BHR	Bolt hits receiver							*****
BHS	Bolt plug hits safety switch		***************************************					
BLOP	Bar lock or disconnector out of position		***************************************					
BLSO	Barrel lug shot off		***************************************					
BPO	Bolt pulis out		***************************************					
BSSM	Bolt stems shell in magazine		-					
BWCD	Bolt won't cam down							

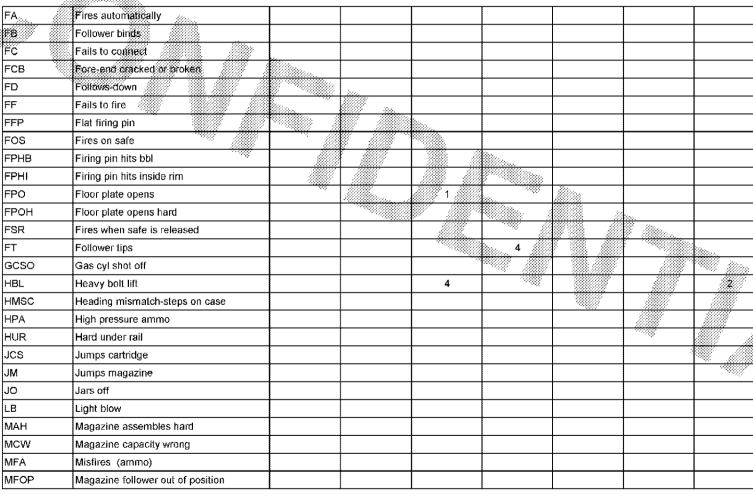

ML

Magazine loose

Magazine loads hard


- 18	200000000 2000000						
SRIC	Specific rin gs in chamber						
SSOC	Surface scratches on case	***************************************					
STC	Stems top chamber	 ***					
SWE	Safety switch works too easily	***************************************					
SWH	Safety switch works too hard	áva.					
sww	Safety ewitxh work						
TD	Tips down						
TU	Tips up						
TWP	Trigger won't pull			**************************************			
TWR	Trigger won't retract						
UNCN-T	Uncoded	// Was		***			
XH	Extracts hard	****			***	55c.	
HI	High	-					*** *********************************
LO	Low	-	178				
LEFT	Left			*******			
RIGHT	Right				1000		
DG	Doesn't Group						
FSST	Front sight tipped					2004	
RSTT	Rear sight tipped	***************************************				*	
RSBR	Rear sight base raised	-					***//
FSTR	Front sight raised						
FSTL	Front sight loose	***************************************					
RSTL	Rear sight loose						
MGPT-G	Missing parts at target	-					
UNCN-G	Uncoded nonconformity at target						


Assembly incompleye at proof							
Barrel bracket gracked or broken at proof							
Blows cases at proof	,.						
Barrel extension broken at proof							
Blanked primer at proof		\$to.					
Barrel lug shot off at proof		<i>-</i>					
Blown primer at proof							
Danci Spiit at provi							
Doesn't lock over shells at proof							
Ejector sticks back at proof							
Fore-end cracked at proof	***						
Fore-end shot off at proof					***	5to.	
Fails to fire at proof			11/11/16	***			
Gas cylinder shot off at proof							
Magnaflux stamp illegible on bbl							
Magnaflux stamp missing on bbl				*****			
Pierced primer at proof							
Stock cracked or broken at proof							
Uncoded proof malfunctions						*****	
	Barrel bracket bracked or broken at proof Blows cases at proof Barrel extension broken at proof Btanked primer at proof Barrel lug shot off at proof Bown primer at proof Barrel split at proof Doesn't lock over shells at proof Ejector sticks back at proof Fore-end cracked at proof Fore-end shot off at proof Fails to fire at proof Gas cylinder shot off at proof Magnaflux stamp illegible on bbl Magnaflux stamp missing on bbl Pierced primer at proof Stock cracked or broken at proof	Barrel bracket gracked or broken at proof Blows cases at proof Barrel extension braken at proof Blanked primer at proof Barrel lug shot off at proof Blown primer at proof Barrel split at proof Doesn't lock over shells at proof Ejector sticks back at proof Fore-end cracked at proof Fore-end shot off at proof Fails to fire at proof Gas cylinder shot off at proof Magnaflux stamp missing on bbl Pierced primer at proof Stock cracked or broken at proof	Barrel bracket gracked or broken at proof Blows cases at proof Barrel extension broken at proof Blanked primer at proof Barrel lug shot off at proof Bown primer at proof Barrel split at proof Doesn't lock over shells at proof Ejector sticks back at proof Fore-end cracked at proof Fore-end shot off at proof Fails to fire at proof Gas cylinder shot off at proof Magnaflux stamp missing on bbl Pierced primer at proof Stock cracked or broken at proof	Barrel bracket stacked or broken at proof Blows cases at proof Barrel extension broken at proof Blanked primer at proof Barrel lug shot off at proof Bown primer at proof Barrel split at proof Doesn't lock over shells at proof Ejector sticks back at proof Fore-end cracked at proof Fore-end shot off at proof Gas cylinder shot off at proof Magnaflux stamp missing on bbl Pierced primer at proof Stock cracked or broken at proof	Barrel bracket gracked or broken at proof Blows cases at proof Barrel extension broken at proof Barrel lug shot off at proof Blown primer at proof Bown primer at proof Barrel split at proof Doesn't lock over shells at proof Ejector sticks back at proof Fore-end cracked at proof Fore-end shot off at proof Gas cylinder shot off at proof Magnaflux stamp illegible on bbl Magnaflux stamp missing on bbl Pierced primer at proof Stock cracked or broken at proof	Barrel bracket gracked or broken at proof Blows cases at proof Barrel extension broken at proof Barrel lug shot off at proof Blown primer at proof Barrel split at proof Doesn't lock over shells at proof Ejector sticks back at proof Fore-end cracked at proof Fore-end shot off at proof Gas cylinder shot off at proof Magnaflux stamp illegible on bbl Magnaflux stamp missing on bbl Pierced primer at proof Stock cracked or broken at proof	Barrel bracket cracked or broken at proof Blows cases at proof Barrel extension broken at proof Barrel lug shot off at proof Barrel split at proof Barrel split at proof Doesn't lock over shells at proof Ejector sticks back at proof Fore-end cracked at proof Fore-end shot off at proof Gas cylinder shot off at proof Magnaflux stamp illegible on bbl Magnaflux stamp missing on bbl Pierced primer at proof Stock cracked or broken at proof


	Test Date:		aliteur.			totais
74	129		68	_{od.} 74	22	1075
0 %	0	0	12	0	0	12
0.0	0.0		17.6	20	0.0	1.1
168	177		26	J ***	22	1184
0	14	0		0	0	122
0.0	7.9		19.2		0.0	10.3
168	4				1000	224
29	0	0	0	.0	o	29
17.3	0.0					12.9
				1430007 3555	1 0000 000000 0	00' 000000000


XR-100	7400	7500	7600	7615	Rimfire	totals


						3
						17

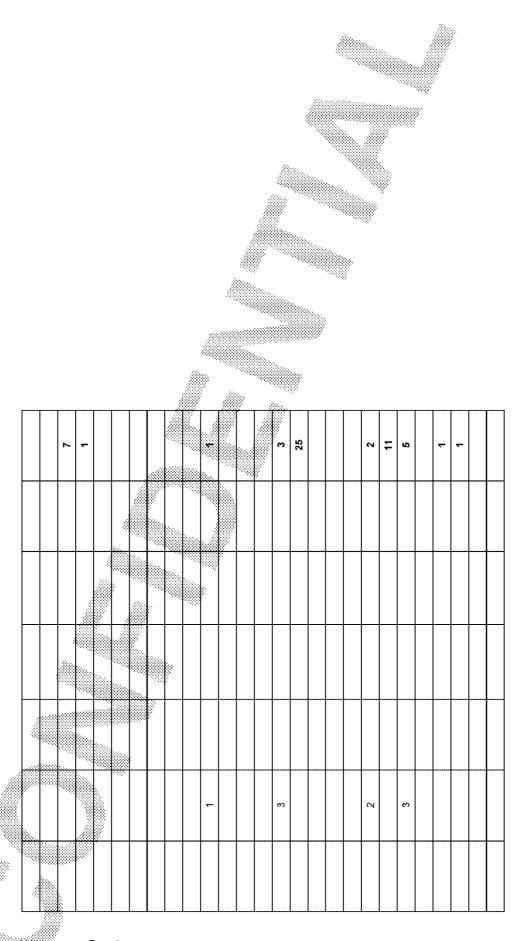

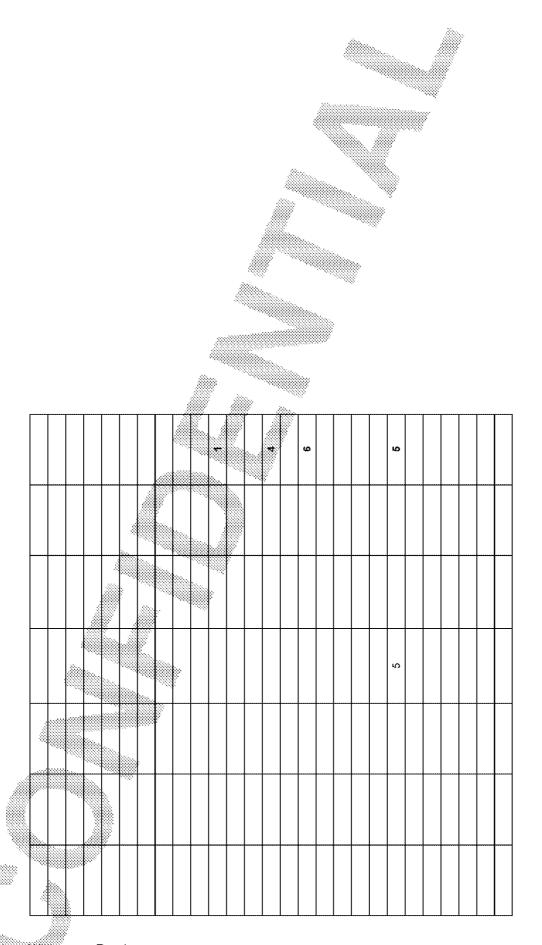

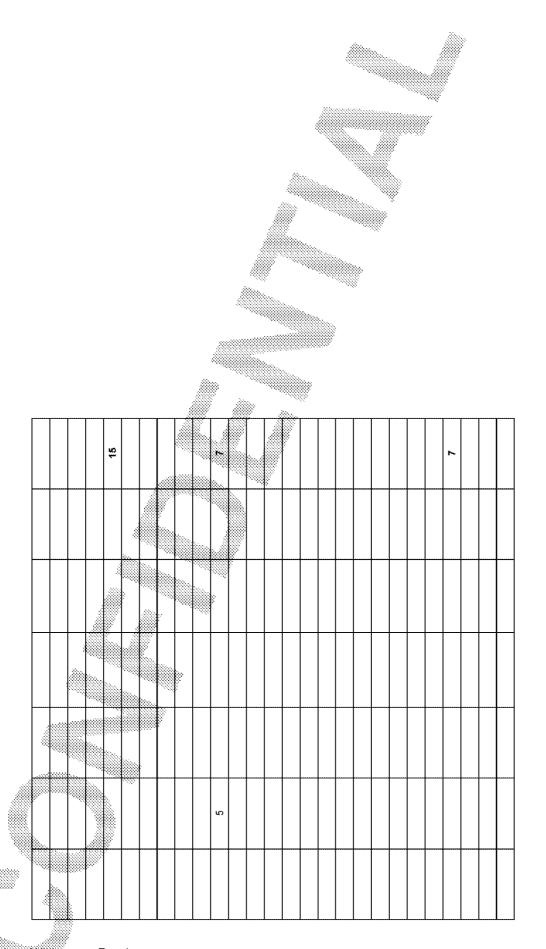

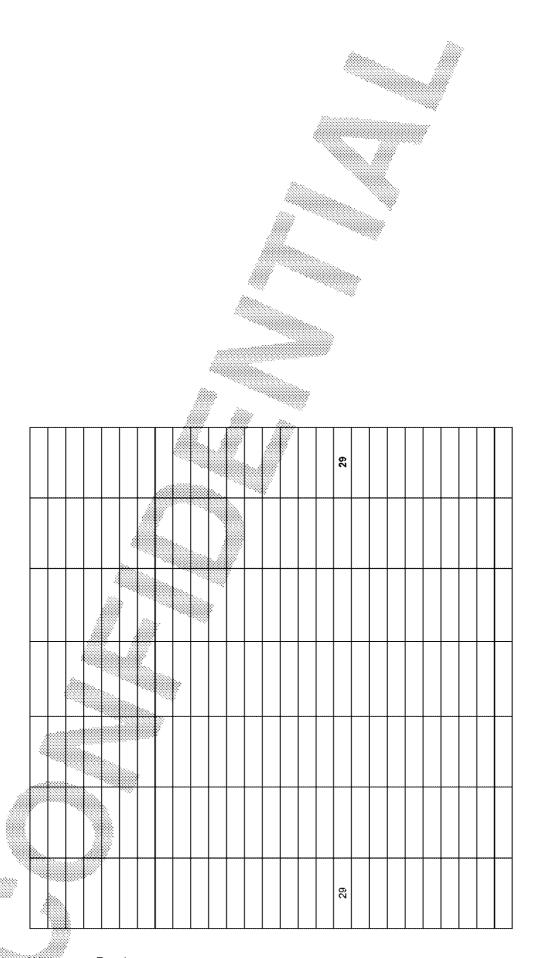

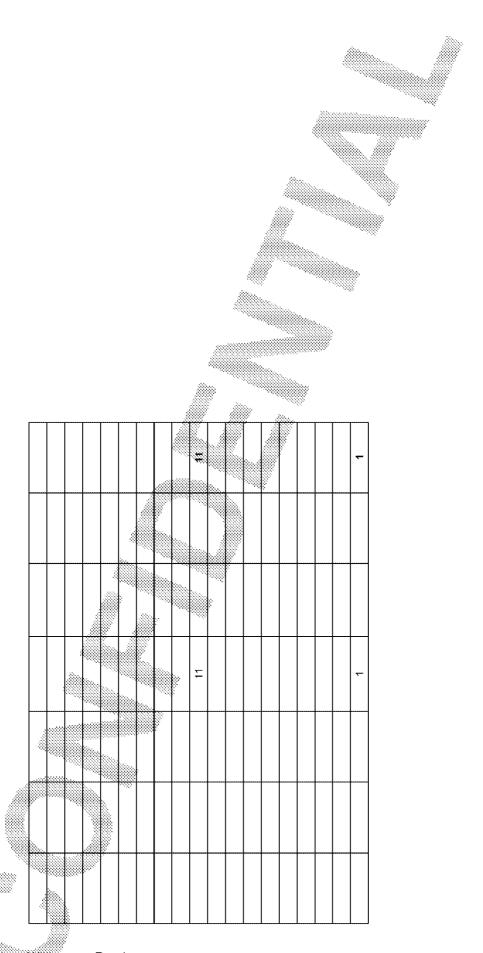

Subject to Protective Order - Williams v. Remington

1 6 7 7 7 7 6 6 7 7 7	***********								
Summary		+ Proof Failures	577						
		Total Rejected:	81						
	Ove	Total Rejected: Fall Reject Rate:	14.04						
	Proof	Shot: E	So. 4	67	1	10	28		232
***********	Proof	Rejected.	o	0	0	0	0	0	8
	7777777	Percent:	0.0	0.0	0.0	0.0	0.0		3.4
		Shot [sa. 4 🔯	<i></i>	1	87	6		231
	Test	Rejected:	Q.	0	. O	14	0	Đ	36
	, 222	Shot:	Q Q,0	0	0.0	16.1	0.0		15.6
		Shot:	###		1888	6			8
	Target	Rejected:	0	<i></i> 9/	Ç	0	0	Đ	0
	300	Percent:		9	ø	0 0 0			0.0

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
							3 80-	
AB	Action binds		***************************************	<i></i>				
BABS	Bulge at body shoulder		***************************************					
BAC	Burr at chamber		***************************************		1			2
BBMA	BBL-to-bolt misalignment		***************************************		*****		2000	
ВВ	Bolt binds/catches		***************************************		3			4
BCOBS	Bolt catches on bolt stop							
BCOF	Bolt catches on follower		***************************************				3700	
ВС	Blows cases		-				8	
BHR	Bolt hits receiver							
BHS	Bolt plug hits safety switch		***************************************					
BLOP	Bar lock or disconnector out of position		200					
BLSO	Barrel lug shot off							
вро	Bolt pulis out		***************************************					
BSSM	Bolt stems shell in magazine		***************************************					
BWCD	Bolt won't cam down							

BWCFM	Bolt won't close over full magazine							
CD	Case dented							
СН	Closes hard	,.						
CLM	Can't laod magazine							
co	Cut-off		\$to.					
CR	Cuts rim		<i>-</i>					
CS	Cases swell							
CTOG	Chamber tom or gouged							
CTP	Creepy trigger pull				300. 300//////			
CWSB	Cams wrong side of action bar							
DBB	Doesn't blow back	. 449			***	<i>#</i>		
DCS	Double click in safety switch						Sec.	
DCT	Double click in trigger				***			
DCU	Doesn't close-up							
DE	Doesn't eject			//20				1///
DEL	Doesn't eject live round				× 4			
DFB	Doesn't feed back							
DFU	Doesn't feed up							
DLO	Doesn't lock open (after last shell)						******	
DLU	Doesn't lock-up						ž	
DS	Dead safe							10
DX	Doesn't extract							
DXL	Doesn't extract live round							
EDS	Extractor drops shell				1			
ESB	Ejector sticks back							
ESCR	Empty shell catches receiver							
ESS	Extractor stems shell							

FA	Fires automatically						
FB	Follower binds						
FC	Fails to connect		***************************************				
FCB	Fore-end cracked or broken						
FD	Follows-down		\$46.				
FF	Fails to fire		***				
FFP	Flat firing pin			.			
FOS	Fires on safe	···.					
FPHB	Firing pin hits bbl						
FPHI	Firing pin hits inside rim						
FPO	Floor plate opens	****					
FPOH	Floor plate opens hard					Sec.	
FSR	Fires when safe is released		***************************************		*** //		
FT	Follower tips		***************************************	***************************************			
GCSO	Gas cyl shot off		************	1199			
HBL	Heavy bolt lift				1		
HMSC	Heading mismatch-steps on case						
HPA	High pressure ammo						
HUR	Hard under rail					*****	
JCS	Jumps cartridge					á	
JM	Jumps magazin e						
10	Jars off						
LB	Light blow						
MAH	Magazine assembles hard						
MCW	Magazine capacity wrong						
MFA	Misfires (ammo)						
MFOP	Magazine follower out of position						


r				1			
ML	Magazine lögse						
MLH	Magazine loads hard						
MRH	Magazine removes hard	ac.					
ОН	Opens hard						
OR	Over-indes		žto.				5
PH	Pulls hard						
PSI	Proof stamp illegible						
PSM	Proof stamp missing						
RBOC	Rings and bulges on case						
RDW	(Action) release doesn't work						
RIC	Rings in chamber	****			7		2
RIS	Ring in sholder					Sec.	
RS	Rim srem			<i>##</i>	***		
SBC	Stems bottom chambers			***			
SBE	Stems bbl extension			1788			
SCB	Stock cracked or broken				*****		
SCX	Shell catches						
SHI	Short indent						
SI	Stems incline				1	*****	1
SIC	Stems in chamber					18	1
SL	shaves lead						***************************************
SLC	Stems left side of chamber						
SMOC	Stretch marks on case						
SOR	Stem over-ride						
SP	Stems port						
SR	Shoulder rough						
SRC	Stems right side of chamber						
					•	•	


SRIC	Specific rings in chamber							
8500	Surface scratches on case							
STC	Stems top chamber		***************************************					
SWE	Safety switch works too easily							
SWH	Safety switch works too hard		\$45.					
sww	Safety ewitxh won't work		***					
TD	Tips down							
TU	Tips up							
TWP	Trigger won't pull				*** *********************************			
TWR	Trigger won't retract							
UNCN-T	Uncoded	***			***			
XH	Extracts hard						Seo.	10
			***************************************		***			
HI	High		***************************************					
LO	Low		4.00	***				
LEFT	Left				******			
RIGHT	Right		***************************************					
DG	Doesn't Group							
FSST	Front sight tipped		***************************************				2004	
RSTT	Rear sight tipped		1				18	
RSBR	Rear sight base raised							*****
FSTR	Front sight raised		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1					
FSTL	Front sight loose							
RSTL	Rear sight loose							
MGPT-G	Missing parts at target							
UNCN-G	Uncoded nonconformity at target							
						_		


AI-P	Assembly incompleye at proof		A					
868	Barrel bracket gracked or broken at proof							
BC-P	Blows cases at proof		***************************************					
BEB-P	Barrel extension broken at proof		***************************************					
BLP-P	Blanked primer at proof		áva.					
BLSO-P	Barrel lug shot off at proof							
BP-P	Blown primer at proof							
BS-P	Barrel split at proof							
DLOS-P	Doesn't lock over shells at proof							
ESB-P	Ejector sticks back at proof							
FCB-P	Fore-end cracked at proof	1				11/10		
FESO-P	Fore-end shot off at proof						5ec.	
FF-P	Fails to fire at proof		***************************************					
GCSO-P	Gas cylinder shot off at proof		***************************************					
MSI-P	Magnaflux stamp illegible on bbl		4.00	***				
MSM-P	Magnaflux stamp missing on bbl		-		*******			
PP-P	Pierced primer at proof		***************************************					
SCB-P	Stock cracked or broken at proof		-					
UNCM-P	Uncoded proof malfunctions		***************************************				****	8


XR-100	7400	7500	7600	7615	Rimfire	totals


			1	1		2
2						5
1						8

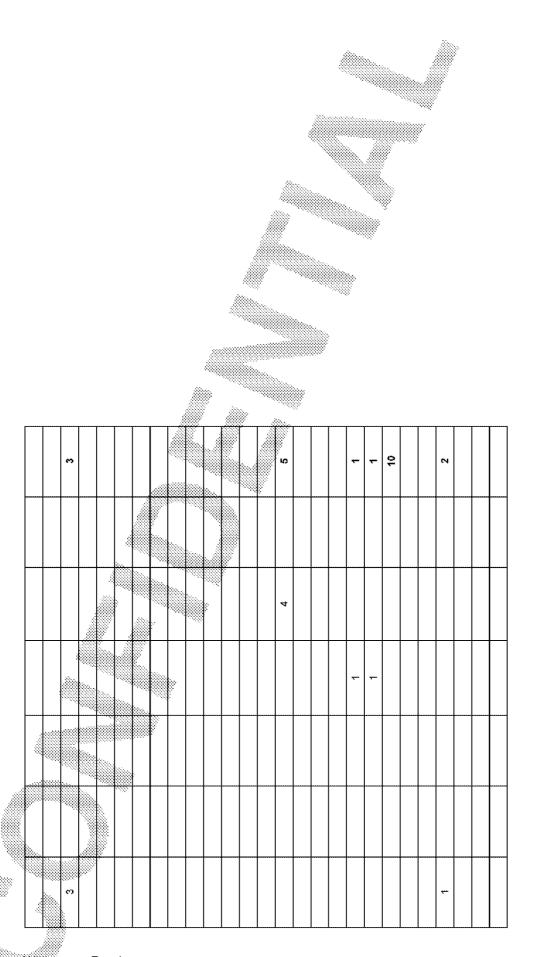

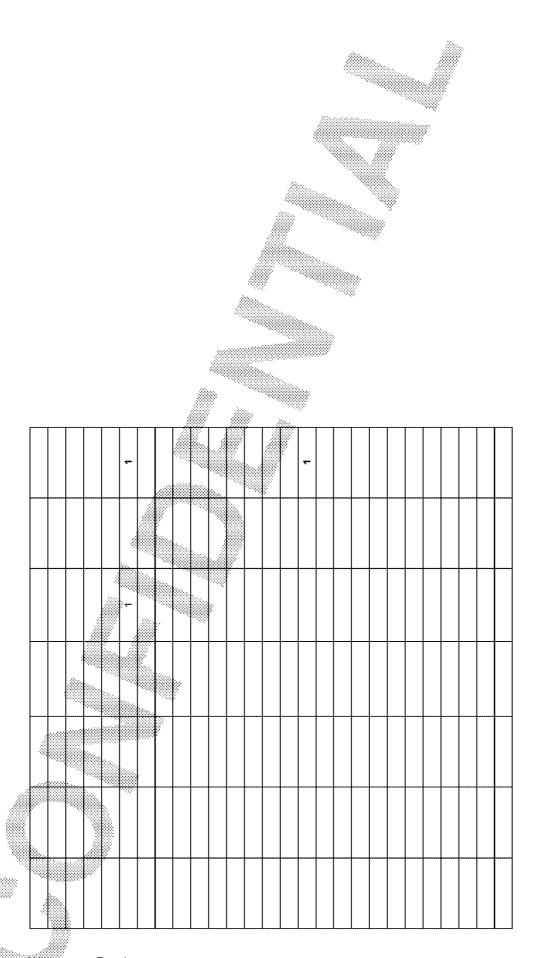

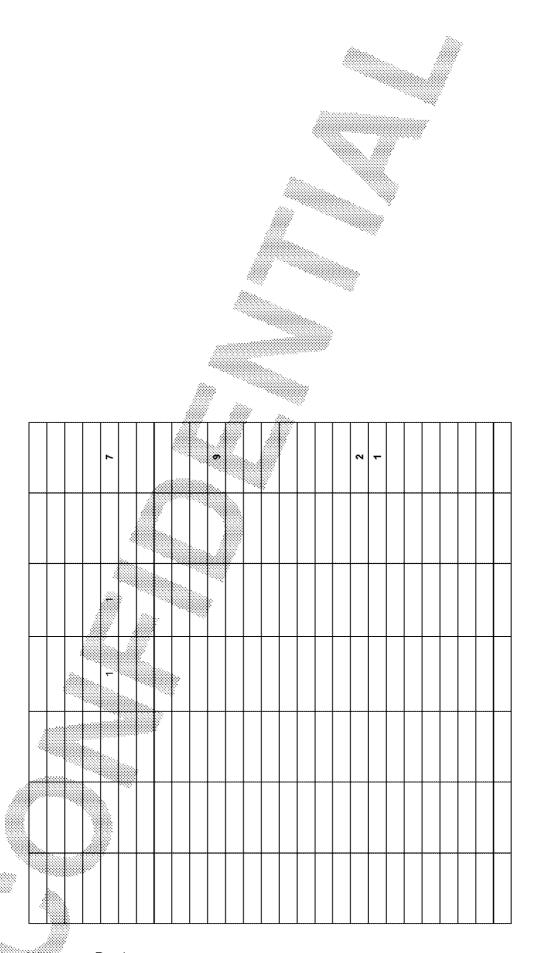

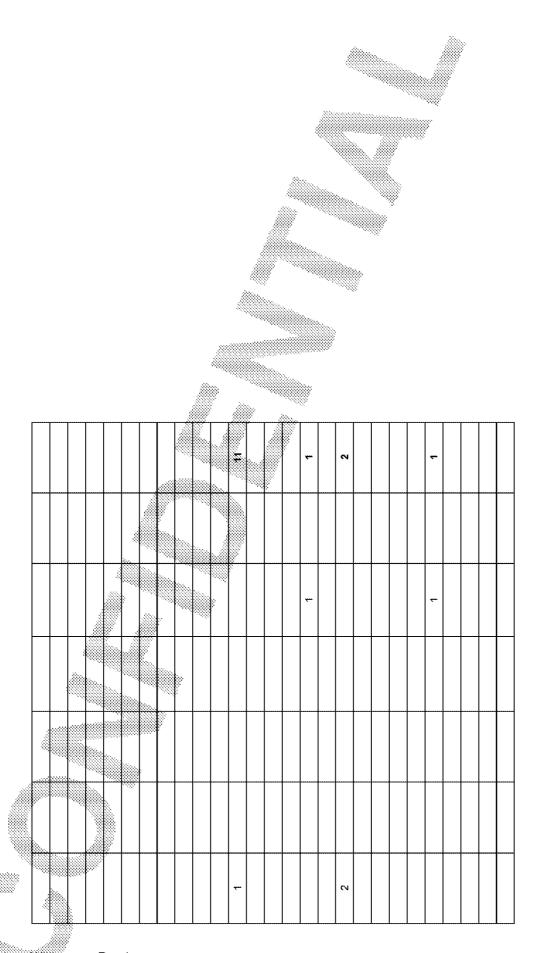

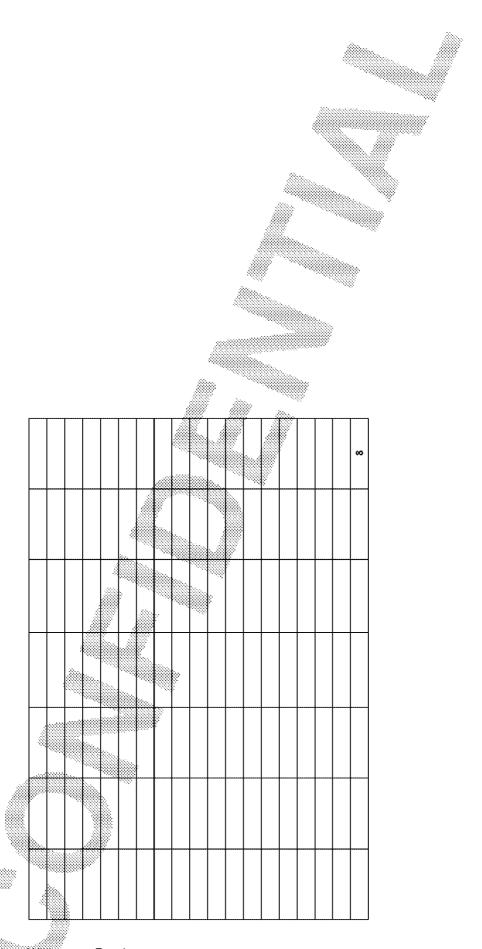

Subject to Protective Order - Williams v. Remington

۲	ı
t	ŧ
	1
C)
C)
H	1
H	1
_	J
u)
_	J
H	1

	77,000,000											
Summa	ary	Total	Test + Pro	of Failures		783						
			Tota	l Rejected:		107						
			Overall R	eject Rate:	1.	3.67						
	- W				8	-	4	4	13	51	30	417
	<i>I</i>	Poof		Rejected	o o	×.	0	0	0	0	0	10
				Percent,	0.0	* 2	0.0	0.0	0.0	0.0	0.0	2.4
				Shot.				13	7	34		424
	7	Test 🦳		Reje cted :	Q		0	Sec. 1	2	13	Đ	67
				Shot: Rejected: Percent: Shot: Rejected: Percent: Shot:	0.0			1 7.7	28.6	38.2		15.8
				Snot.		200	2000	1 78888	<i>A</i> .			8
	7	arget		Rejected:	0		9 0	 Ø	0	0	0	0
				Percent:			0	t)	0			0.0

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7

AB	Action binds		***************************************	<i></i>				
BABS	Bulge at body shoulder		***************************************					* **
BAC	Burr at chamber		***************************************					11
BBMA	BBL-to-bolt misalignment				****			
вв	Bolt binds/catches		***************************************		1			
BCOBS	Bolt catches on bolt stop					.,		
BCOF	Bolt catches on follower						370.00	
вс	Blows cases		-				;	
BHR	Bolt hits receiver		-					
BHS	Bolt plug hits safety switch		***************************************					
BLOP	Bar lock or disconnector out of position		311					
BLSO	Barrel lug shot off							
BPO	Bolt pulls out		***************************************					
BSSM	Bolt stems shell in magazine		- Control of the Cont					
BWCD	Bolt won't cam down		and the second s					

BWCFM	Bolt won't close over full magazine		-				
CD	Case dented		**************************************				
СН	Closes hard		**************************************				
CLM	Can't laod magazine						
со	Cut-off		244.				
CR	Cuts rim						
cs	Cases swell						
CTOG	Chamber tom or gouged	···					
CTP	Creepy trigger pull						
CWSB	Cams wrong side of action bar						
DBB	Doesn't blow back	1.400			1///		
DCS	Double click in safety switch					Sec.	
DCT	Double click in trigger		***************************************	****			
DCU	Doesn't close-up		***************************************				
DE	Doesn't eject		4.00				
DEL	Doesn't eject live round		-	**************************************			
DFB	Doesn't feed back		-				
DFU	Doesn't feed up						
DLO	Doesn't lock open (after last shell)		***************************************			******	
DLU	Doesn't lock-up		**************************************			ž.	
DS	Dead safe		***************************************				4
DX	Doesn't extract		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1				
DXL	Doesn't extract live round		***************************************				
EDS	Extractor drops shell		***	1			
ESB	Ejector sticks back		***************************************				
ESCR	Empty shell catches receiver		-				
ESS	Extractor stems shell		-			_	

FA	Fires automatically							
FB	Follower binds							
FC	Fails to comect		***************************************					
FCB	Fore-end cracked of broken		V					
FD	Folfows-down		\$20.					
FF	Fails to fire							
FFP	Flat firing pin							
FOS	Fires on safe	···						
FPHB	Firing pin hits bbl				*			
FPHI	Firing pin hits inside rim							
FPO	Floor plate opens	***				1000		
FPOH	Floor plate opens hard						Sec.	
FSR	Fires when safe is released		***************************************		****			
FT	Follower tips	Anna	***************************************					1
GCSO	Gas cyl shot off		***************************************	***				
HBL	Heavy bolt lift				**************************************			4
HMSC	Heading mismatch-steps on case		***************************************					
HPA	High pressure ammo							
HUR	Hard under rail		***************************************				******	2
JCS	Jumps cartridge		1				ž.	
JM	Jumps magazin e							*******
7O	Jars off		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1					
LB	Light blow							
MAH	Magazine assembles hard		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1					
MCW	Magazine capacity wrong							
MFA	Misfires (ammo)							
MFOP	Magazine follower out of position							

ML.

Magazine loose

SRIC	Specific rings in chamber							
SSOC	Surface scratches on case		Per la constante de la constan					
STC	Stems top chamber		***************************************					1
SWE	Safety switch works too easily							
SWH	Safety switch works too hard		\$45.					1
sww	Safety ewitxh work		***					
TD	Tips down							
TU	Tips up	· · · · · //						
TWP	Trigger won't pull							
TWR	Trigger won't retract							
UNCN-T	Uncoded	***						
XH	Extracts hard			1		12	Sec.	1


HI	High							
LO	Low		***************************************	***				
LEFT	Left				1900 B			
RIGHT	Right		***************************************					
DG	Doesn't Group							
FSST	Front sight tipped		***************************************				**************************************	
RSTT	Rear sight tipped		1				8	
RSBR	Rear sight base raised							
FSTR	Front sight raised							
FSTL	Front sight loose							
RSTL	Rear sight loose							
MGPT-G	Missing parts at target							
UNCN-G	Uncoded nonconformity at target							


AI-P	Assembly incompleye at proof		2					
868	Barrel bracket gracked or broken at proof		***************************************					
BC-P	Blows cases at proof							
BEB-P	Barrel extension broken at proof		-					
BLP-P	Blanked primer at proof		desc.					
BLSO-P	Barrel lug shot off at proof							
BP-P	Blown primer at proof							
BS-P	Barrel split at proof	· · ·						
DLOS-P	Doesn't lock over shells at proof							
ESB-P	Ejector sticks back at proof							
FCB-P	Fore-end cracked at proof	***				1000		
FESO-P	Fore-end shot off at proof						Sec.	
FF-P	Fails to fire at proof		-		****			
GCSO-P	Gas cylinder shot off at proof			******	.			
MSI-P	Magnaflux stamp illegible on bbl		-	777				1000
MSM-P	Magnaflux stamp missing on bbl				· · · · · · · · · · · · · · · · · · ·			
PP-P	Pierced primer at proof							
SCB-P	Stock cracked or broken at proof							
UNCM-P	Uncoded proof malfunctions		***************************************				*****	10
	•	•	,	•	•	•	•	


		4				
	Test Date:		Man			totals
147	80	1 2000	72	50		876
0	- 0	0	11	0	0	21
0.0	0.0		15.3	00		2.4
102	79	1	31	67	F	762
0	0	0	3	0	0	86
0.0	0.0		9.7	0.a		11.3
102			2	67		179
0	0	0	0	.0	0 O	0
0.0			0.0	2.0		0.0
				300	83 300 B	81 - 68801001


XR-100	7400	7500	7600	7615	Rimfire	totals


			1			1
						11
						1

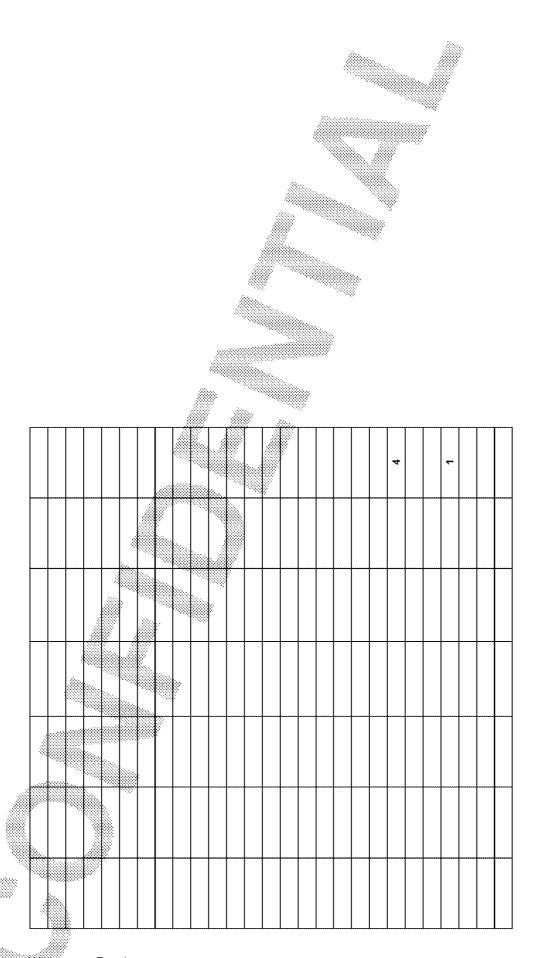

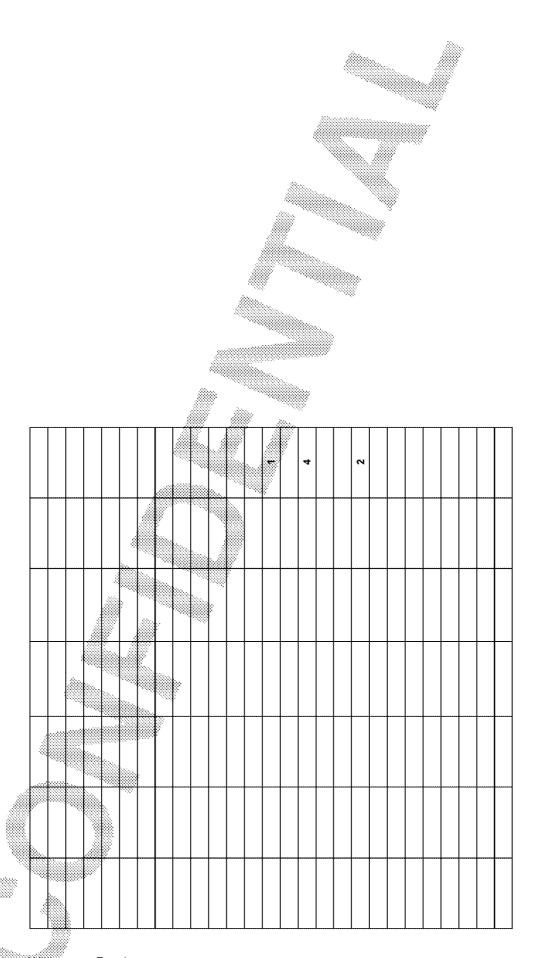

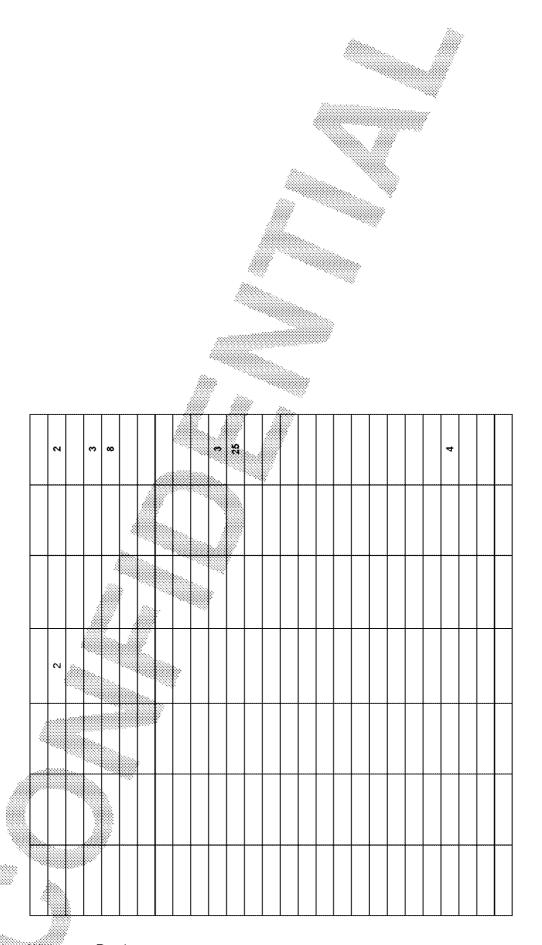

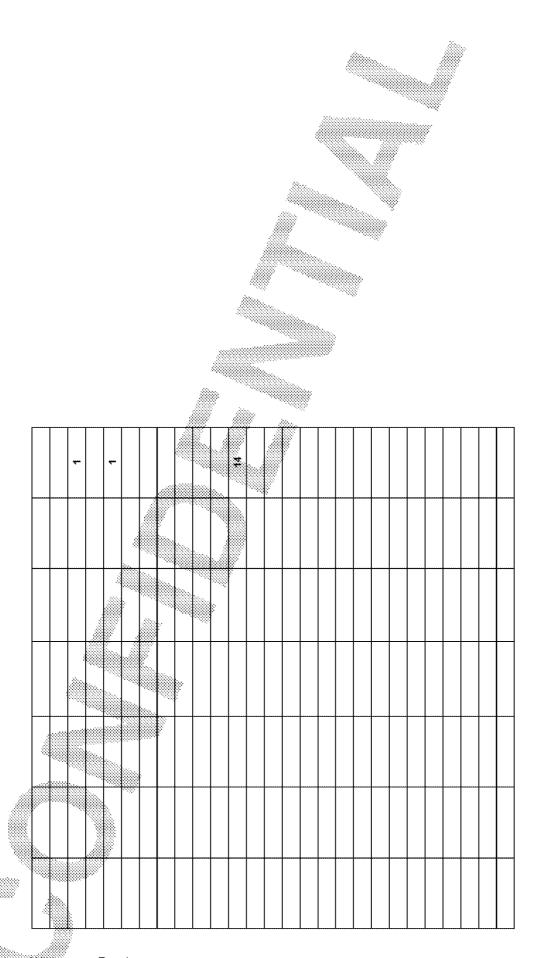

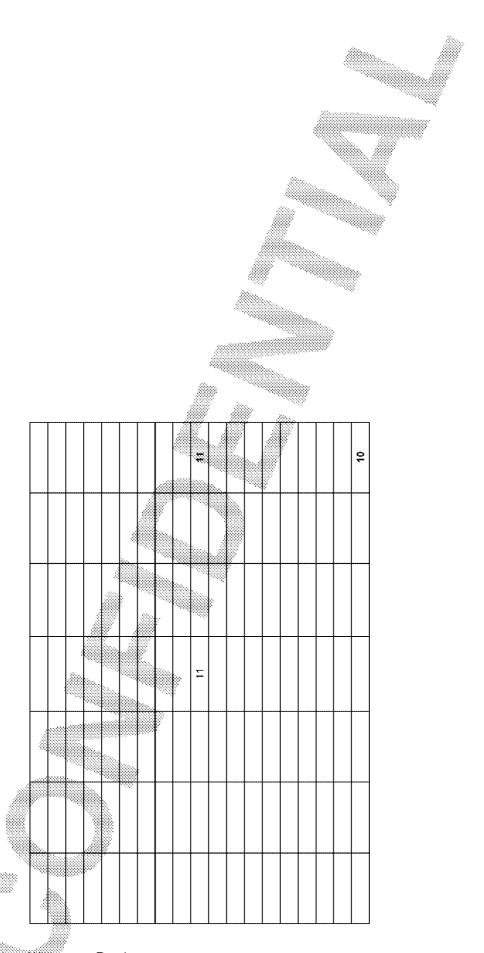

Subject to Protective Order - Williams v. Remington

ł		ı	
ĺ		ŧ	
Ì	_	İ	
(Ξ)	
١	_	•	
ŀ	_		
ŀ	_		
•	•	j	
۶	X	,	
•	۸ ۸	,	
8	å	£	

10000000									
Summary		Proof Failures Total Rejected: alf Reject Rate:	795 62						
			7.80						
*** *********************************	Proof	\$hot: [Rejected:	Micro.	24	5	22	49		220
********	Proof	Rejected.	0	0	0	0	0	0	2
		₽ercent:	o .	0.0	0.0	0.0	0.0		0.9
		Shot.	885. B	888F		8	43		308
	Test	Rejected:	Q.	0	₂₀₀ 0	0	5	0	34
		Shot: [Rejected: Percent: Shot: [Rejected: Percent: Shot: [Rejected:	a.	0		0.0	11.6		11.0
		Shot:		2000	l 1888	4.	3		9
	Target	Rejected:	0 ****	9/	Ø	O	0	0	0
	3	Percent:	0	9	O	0	0.0		0.0

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			************				X	
AB	Action binds			<i></i>				
BABS	Bulge at body shoulder		vening the same of					
BAC	Burr at chamber		***************************************					
BBMA	BBL-to-bolt misalignment				****			
ВВ	Bolt binds/catches							1
BCOBS	Bolt catches on bolt stop							
BCOF	Bolt catches on follower		-					
ВС	Blows cases						8	
BHR	Bolt hits receiver							*****
BHS	Bolt plug hits safety switch							
BLOP	Bar lock or disconnector out of position							
BLSO	Barrel lug shot off		***					
BPO	Bolt pulls out		-					
BSSM	Bolt stems shell in magazine							
BWCD	Bolt won't cam down							

۲	4	
t	4	
ŀ	9	
ľ	כ	
1	=	
ι	_	
ŀ	_1	
Ļ	_1	
٠	TT FOO117	
L	ر د د	
Ć	Ó	
i	Š	

BWCFM	Bolt won't close over full magazine							
CD	Case dented		**************************************					
СН	Closes hard		440044100					
CLM	Can't laod magazine		***					
СО	Cut-off							
CR	Cuts rim		- XX.					
CS	Cases swell							
CTOG	Chamber tom or gouged							
CTP	Creepy trigger pull							
CWSB	Cams wrong side of action bar							
DBB	Doesn't blow back	***						
DCS	Double click in safety switch						Sto.	
DCT	Double click in trigger		***************************************		***			
DCU	Doesn't close-up		************					1
DE	Doesn't eject		450445044					
DEL	Doesn't eject live round		SATISFACE OF THE PARTY OF THE P		*****			
DFB	Doesn't feed back		***************************************					
DFU	Doesn't feed up		***************************************					
DLO	Doesn't lock open (after last shell)		1100				****	
DLU	Doesn't lock-up		40.04				*	**
DS	Dead safe		30.00			1		***
DX	Doesn't extract							
DXL	Doesn't extract live round		4440044400					
EDS	Extractor drops shell	***************************************	*******					
ESB	Ejector sticks back		-					8
ESCR	Empty shell catches receiver							
ESS	Extractor stems shell		***************************************					

Fires automatically							
Follower binds		***************************************					
Fails to connect		***************************************					
Fore-end cracked or broken		***************************************					
Follows-down		ása.					
Fails to fire							
Flat firing pin							
Fires on safe	· · · · //						
Firing pin hits bbl							
Firing pin hits inside rim							
Floor plate opens	***						
Floor plate opens hard						Stv.	
Fires when safe is released							
Follower tips		***************************************					1
Gas cyl shot off		***************************************	***				
Heavy bolt lift				******	1		300
Heading mismatch-steps on case							
High pressure ammo						1000000000	
Hard under rail						*****	2
Jumps cartridge						ž.	
Jumps magazin e					1		*******
Jars off		***************************************					
Light blow							
Magazine assembles hard		***************************************					
Magazine capacity wrong							
Misfires (ammo)							
Magazine follower out of position							
	Follower binds Fails to connect Fore-end cracked or broken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (ammo)	Follower binds Fails to connect Fore-end cracked or broken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (ammo)	Follower binds Fails to comeet Fore-and cracked or broken Foitows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (ammo)	Follower binds Fails to connect Fore-end cracked or broken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (arnmo)	Follower binds Fails to connect Fore-and cracked or broken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (ammo)	Follower birids Fails to connect Fore-and gracked or proken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (ammo)	Follower birids Fails to cometit Fore-end cascked or broken Follows-town Fails to fire Fails to fire Flat firing pin Fires on safe Firing pin hits bibl Firing pin hits inside rim Floor plate opens Floor plate opens Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bott lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jumps magazine Jumps magazine Juss off Light blow Magazine capacity wrong Misfires (ammo) Misfires (ammo)

	900000000000 TTTT-0000000000000000000000							
ML	Magazine loose							
MLH	Magazine loads hard							
MRH	Magazine removes hard							
ОН	Opens hard							
OR	Over-rides		day.					12
PH	Pulls hard							
PSI	Proof stamp illegible							
PSM	Proof stamp missing							
RBOC	Rings and bulges on case							
RDW	(Action) release doesn't work							
RIC	Rings in chamber	***			***	Žija .		4
RIS	Ring in sholder							
RS	Rim srem							
SBC	Stems bottom chambers			***************************************				**************************************
SBE	Stems bbl extension			***				
SCB	Stock cracked or broken				*******			
scx	Shell catches							
SHI	Short indent							
SI	Stems incline						2000	
SIC	Stems in chamber							
SL	shaves lead							1844///
SLC	Stems left side of chamber							
SMOC	Stretch marks on case							
SOR	Stem over-ride							
SP	Stems port							
SR	Shoulder rough							
SRC	Stems right side of chamber		1					

SRIC	Specific rings in chamber							
SSOC	Surface scratches on case							
STC	Stems top chamber	,.						
SWE	Safety switch works too easily					2		
SWH	Safety switch works too hard		žec.					3
sww	Safety ewitxh won't work							
TD	Tips down							
TU	Tips up							
TWP	Trigger won't pull							
TWR	Trigger won't retract							
UNCN-T	Uncoded	***			***			
XH	Extracts hard						Sec.	


н	High							388 00.
LO	Low			***				
LEFT	Left				*****			
RIGHT	Right							
DG	Doesn't Group							
FSST	Front sight tipped						***************************************	
RSTT	Rear sight tipped						8	
RSBR	Rear sight base raised							****
FSTR	Front sight raised							
FSTL	Front sight loose							
RSTL	Rear sight loose							
MGPT-G	Missing parts at target							
UNCN-G	Uncoded nonconformity at target							


AI-P	Assembly incompleye at proof		***************************************				
868	Barrel bracket cracked or broken at proof		**************************************				
BC-P	Blows cases at proof		440044100				
BEB-P	Barrel extension broken at proof		MANAGEMAN				
BLP-P	Blanked primer at proof						
BLSO-P	Barrel lug shot off at proof						
BP-P	Blown primer at proof						
BS-P	Barrel split at proof						
DLOS-P	Doesn't lock over shells at proof						
ESB-P	Ejector sticks back at proof						2
FCB-P	Fore-end cracked at proof	***					
FESO-P	Fore-end shot off at proof					50a.	
FF-P	Fails to fire at proof		***************************************				
GCSO-P	Gas cylinder shot off at proof		************				
MSI-P	Magnaflux stamp illegible on bbl		4.00	***			
MSM-P	Magnaflux stamp missing on bbl		***************************************		*******		
PP-P	Pierced primer at proof		***************************************				
SCB-P	Stock cracked or broken at proof						
UNCM-P	Uncoded proof malfunctions		-			****	
						;	


XIV-100	1400	7300	1000	1910	Killille	iotais
XR-100	7400	7500	7600	7615	Rimfire	totals
0.0	0.0					0.0
0	0	0	0	0	0	0
268	5		T /////			285
5.6	0.0		0.0		0.0	6.9
15	0	0	0	· 0	Ø	54
268	131		13		16	787
0.0	4.5		0.0		0.0	1.0
0	6	0	0	0	0	8
328	133	1 // // //	24	4.	16	821
						totals
	Test Date:	**************************************				
119990	SANGER CANADA CALADA					


XR-100	7400	7500	7600	7615	Rimfire	totals


						1
						•

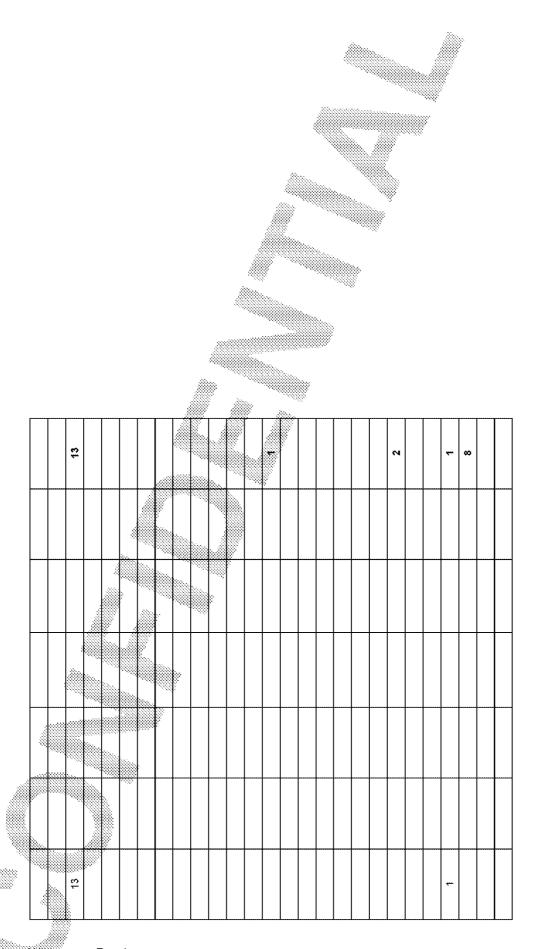

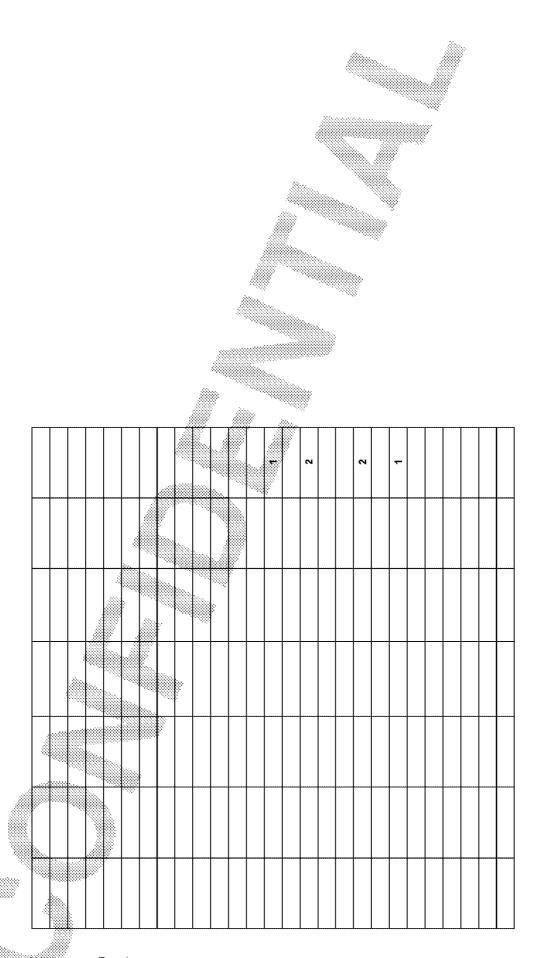

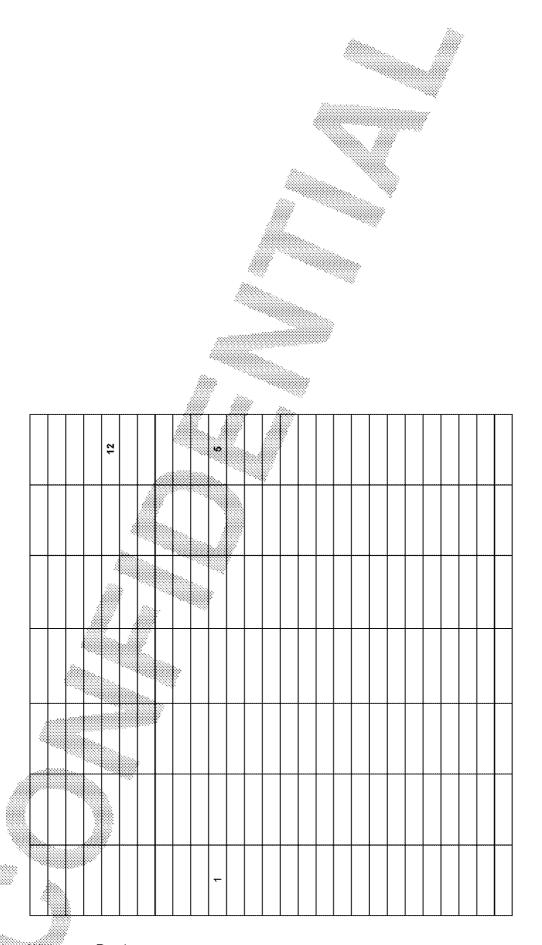

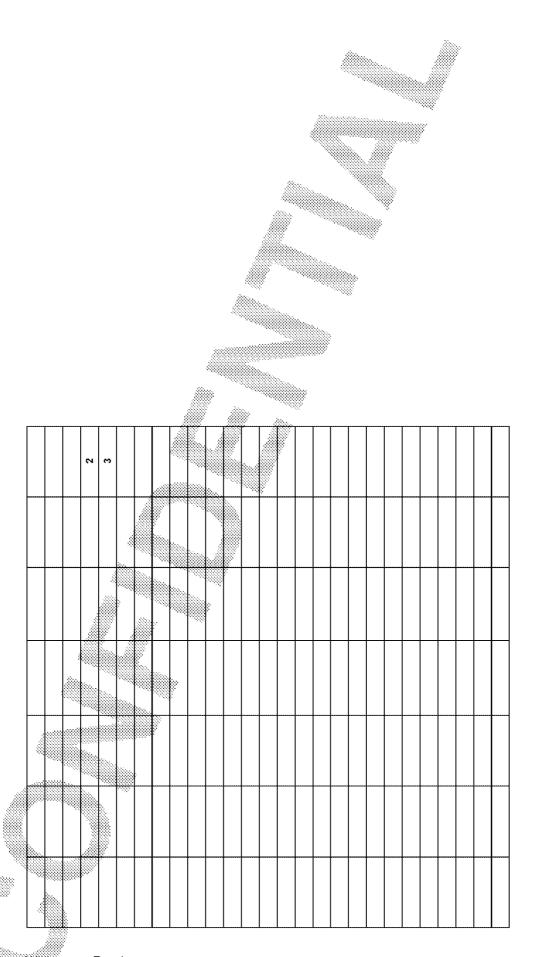

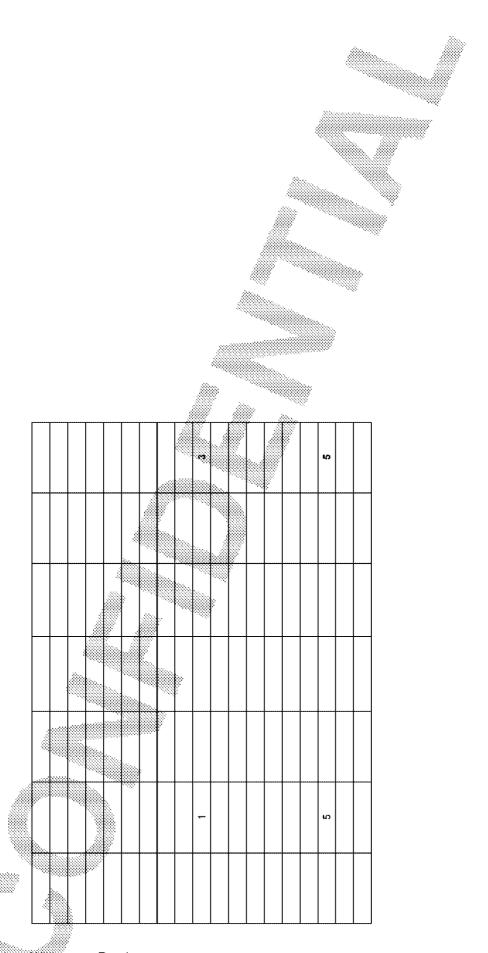

Subject to Protective Order - Williams v. Remington

۲	4	
ŀ	4	
ŀ	1	
C	ō	
C	Ç	
H	_	
H	1	
-	J	
U	J	
V	0	
Ľ	П	

	100000000000000000000000000000000000000										
Summa	any	Total		of Failures	624						
			Tota	l Rejected: eject Rate:	57						
					9.13						
				\$hot:	15	3	55	126		44	82
	***************************************	Proof		Rejected:	·····•••••••••••••••••••••••••••••••••	0	0	4	0	0	0
				Percent. Shot:	0.0	0.0	0.0	3.2		0.0	0.0
				Shot.	18	<i></i>	69	136	30	25	81
		Test	* ****	Rejected:	4.	0	11	19	5	Ð	13
				Percent:	4 22,2	0	.15.9	14.0	16.7	0.0	16.0
				SOOL.			6	A		25	
		Target		Rejected:	0 333	9	Ø	0	0	Đ	0
		3		Percent:	0	O.	0 .0	0		0.0	

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			*******				380	
AB	Action binds			1///				
BABS	Bulge at body shoulder		*******					** *****
BAC	Burr at chamber		***************************************	1.32	1			
BBMA	BBL-to-bolt misalignment		and the same of th		****			
ВВ	Bolt binds/catches		and the same of th	6	2			
BCOBS	Bolt catches on bolt stop		**************************************			.,		
BCOF	Bolt catches on follower		and the same of th				****	
ВС	Blows cases		Palatetinate				;	
BHR	Bolt hits receiver		- Anna Anna Anna Anna Anna Anna Anna Ann					
BHS	Bolt plug hits safety switch		The state of the s					
BLOP	Bar lock or disconnector out of position		**************************************					
BLSO	Barrel lug shot off		***************************************					
BPO	Bolt pulis out		-					
BSSM	Bolt stems shell in magazine							
BWCD	Bolt won't cam down		****					

BWCFM


Bolt won't close over full magazine


1


FA	Fires automatically						
FВ	Follower binds						
FC	Fails to comect						
FCB	Fore-end cracked or broken						
FD	Follows-down		žito.				
FF	Fails to fire						
FFP	Flat firing pin						
FOS	Fires on safe						
FPHB	Firing pin hits bbl				Militar.		
FPHI	Firing pin hits inside rim						
FPO	Floor plate opens	***			1		
FPOH	Floor plate opens hard					88.	
FSR	Fires when safe is released				***		
FT	Follower tips			***************************************			
GCSO	Gas cyl shot off			178			
HBL	Heavy bolt lift				2		
HMSC	Heading mismatch-steps on case						
HPA	High pressure ammo						
HUR	Hard under rail					***************************************	
JCS	Jumps cartridge					*	
JM	Jumps magazine			5			
JO	Jars off						
LB	Light blow						
MAH	Magazine assembles hard						
MCW	Magazine capacity wrong						
MFA	Misfires (ammo)						
MFOP	Magazine follower out of position						


	92000000000000000000000000000000000000							
ML	Magazine lögse							
MLH	Magazine loads hard							
MRH	Magazine removes hard		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1					
ОН	Opens hard							
OR	Over-ndes		\$46.					
PH	Pulls hard		<i>*************************************</i>					
PSI	Proof stamp illegible							
PSM	Proof stamp missing							
RBOC	Rings and bulges on case							
RDW	(Action) release doesn't work							
RIC	Rings in chamber	***	//////////////////////////////////////		7	11/11/11		1
RIS	Ring in sholder						5to.	
RS	Rim srem			11/11/1	***			
SBC	Stems bottom chambers			***************************************				· 5
SBE	Stems bbl extension			7.00				WW 2000
SCB	Stock cracked or broken				**************************************			
scx	Shell catches		***************************************					
SHI	Short indent		A					
SI	Stems incline						*****	2
SIC	Stems in chamber		-				8	
SL	shaves lead							
SLC	Stems left side of chamber							
SMOC	Stretch marks on case		***************************************					
SOR	Stem over-ride							
SP	Stems port							
SR	Shoulder rough							
SRC	Stems right side of chamber							
	•	•		•	•			


AI-P	Assembly incompleye at proof		***************************************				
868	Barrel bracket stacked or broken at proof		***************************************				
BC-P	Blows cases at proof		***************************************				
BEB-P	Barrel extension broken at proof						
BLP-P	Blanked primer at proof		iva.				
BLSO-P	Barrel lug shot off at proof						
BP-P	Blown primer at proof						
BS-P	Barrel split at proof	· · · · //					
DLOS-P	Doesn't lock over shells at proof				***		
ESB-P	Ejector sticks back at proof						
FCB-P	Fore-end cracked at proof	***					
FESO-P	Fore-end shot off at proof					Sec.	
FF-P	Fails to fire at proof		***				
GCSO-P	Gas cylinder shot off at proof		***************************************				
MSI-P	Magnaflux stamp illegible on bbl			· **			
MSM-P	Magnaflux stamp missing on bbl				**************************************		
PP-P	Pierced primer at proof		***************************************				
SCB-P	Stock cracked or broken at proof		***************************************				
UNCM-P	Uncoded proof malfunctions				4	2000	
		·				 - 2	2000 (2000)

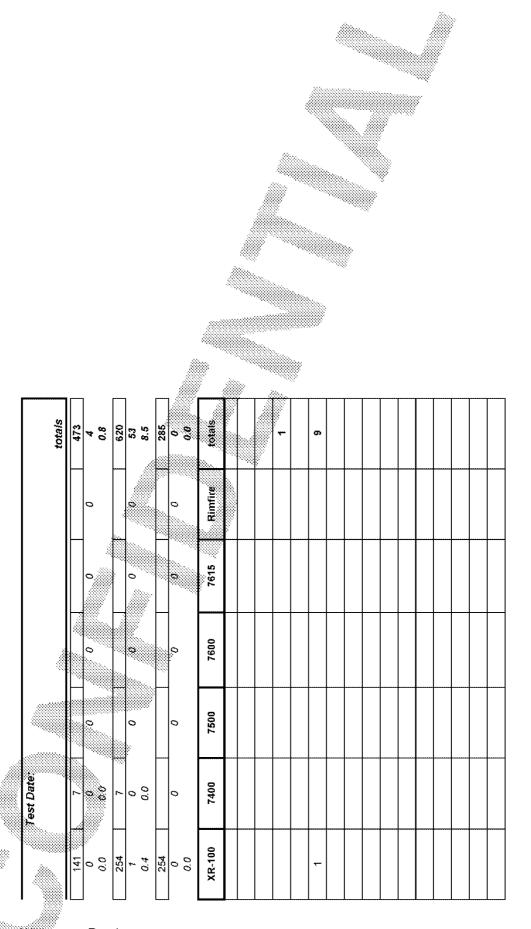


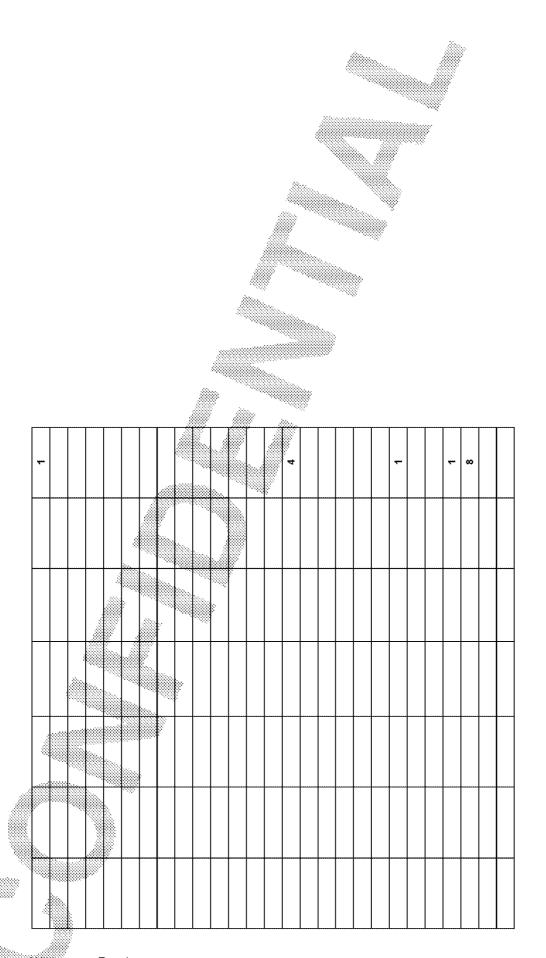

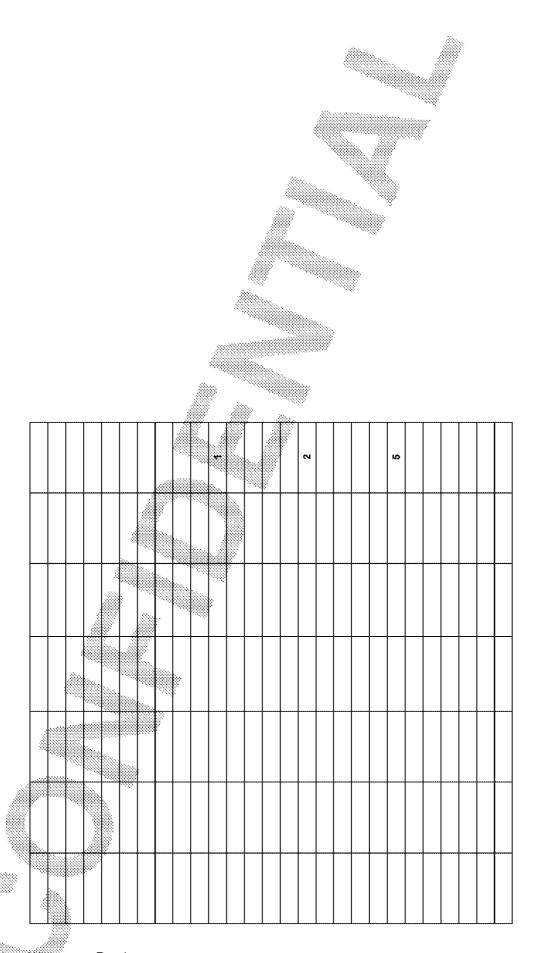

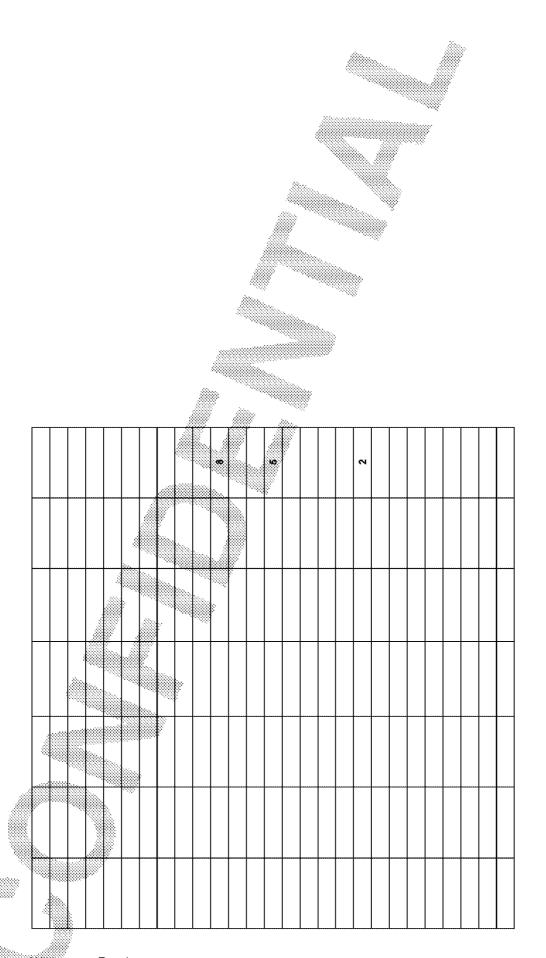

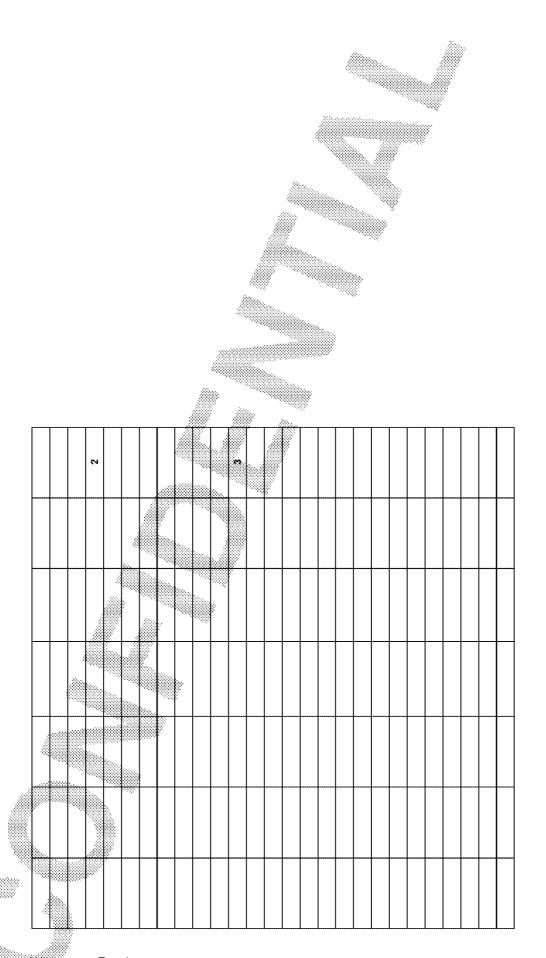

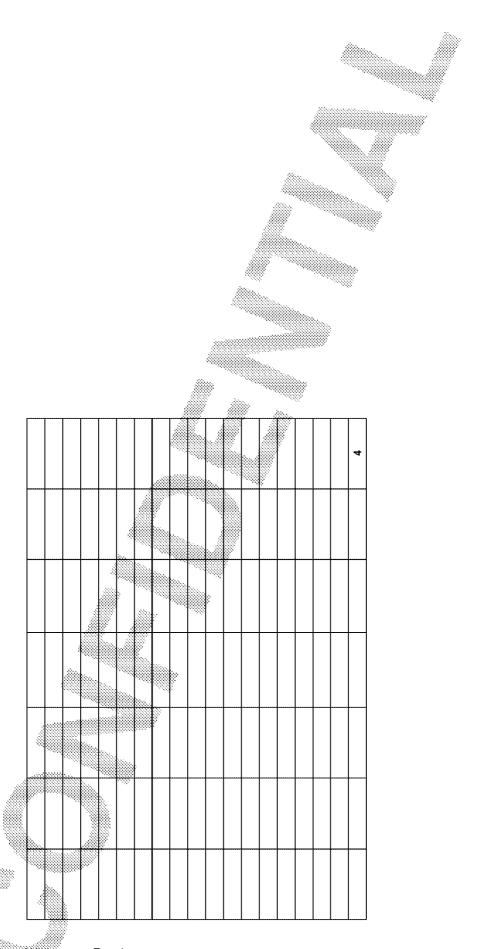

Subject to Protective Order - Williams v. Remington

	100000000000000000000000000000000000000									
Summa	ary	Total	Test + Proof Failures	1						
			Total Rejected:	1						
			Total Rejected: Overall Reject Rate:	100.00						
	P	roof	Shot. Rejected: Percent: Shot. Rejected: Percent:							
	P	roof	Rejected.	0	0	0	0	0	0	0
			Percent,	<i>o</i>	doos.					
			Shot.		<i>33339</i>					
	Te	est	Reje cted :	Q	0	O	0	0	Đ	0
			Percent:		0					
			Shot: Rejected:	.8888	Y 2000	100000	4.			
	T	arget		0 333	9	Ü	0	0	0	0
		-	Percent:	0	9	¢	0			
_				******	22332333	1777 1783	******			

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			************				X	
AB	Action binds		***************************************	<i></i>	9996			
BABS	Bulge at body shoulder		***************************************	***************************************				
BAC	Burr at chamber		***************************************					
BBMA	BBL-to-bolt misalignment				***		3000	
ВВ	Bolt binds/catches		***************************************					
BCOBS	Bolt catches on bolt stop							
BCOF	Bolt catches on follower						****	
ВС	Blows cases		-					
BHR	Bolt hits receiver							****
BHS	Bolt plug hits safety switch		***************************************					
BLOP	Bar lock or disconnector out of position		311					
BLSO	Barrel lug shot off							
BPO	Bolt pulls out							
BSSM	Bolt stems shell in magazine		- Control of the Cont					
BWCD	Bolt won't cam down							


FA	Fires automatically					
FB	Follower bin ds					
FC	Fails to comect					
FCB	Fore-end cracked or broken					
FD	Folfows-down		šta.			
FF	Fails to fire					
FFP	Flat firing pin					
FOS	Fires on safe					
FPHB	Firing pin hits bbl					
FPHI	Firing pin hits inside rim					
FP0	Floor plate opens	***				
FPOH	Floor plate opens hard				Sec.	
FSR	Fires when safe is released					
FT	Follower tips					
GCSO	Gas cyl shot off					
HBL	Heavy bolt lift			*******		
HMSC	Heading mismatch-steps on case					
HPA	High pressure ammo					
HUR	Hard under rail				**************************************	
JCS	Jumps cartridge				8	
JM	Jumps magazin e					
10	Jars off					
LB	Light blow					
MAH	Magazine assembles hard					
MCW	Magazine capacity wrong					
MFA	Misfires (ammo)					
MFOP	Magazine follower out of position					

ML	Magazine loose							
MLH	Magazine loads hard							
MRH	Magazine removes hard	·						
ОН	Opens hard							
OR	Overandes		što.					
PH	Pulls hard							
PSI	Proof stamp illegible							
PSM	Proof stamp missing							
RBOC	Rings and bulges on case							
RDW	(Action) release doesn't work							
RIC	Rings in chamber	***	//////		***)		
RIS	Ring in sholder						Sec.	
RS	Rim srem			11/11/16	***			
SBC	Stems bottom chambers							
SBE	Stems bbl extension			****				
SCB	Stock cracked or broken				*******			
SCX	Shell catches							
SHI	Short indent							
SI	Stems incline						*****	
SIC	Stems in chamber						18	
SL	shaves lead							
SLC	Stems left side of chamber							
SMOC	Stretch marks on case							
SOR	Stem over-ride							
SP	Stems port							
SR	Shoulder rough							
SRC	Stems right side of chamber					_		

								_
SRIC	Specific rings in chamber							
SSOC	Surface scratches on case		***************************************					
STC	Stems top chamber		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1					
SWE	Safety switch works too easily		National Property and Property					
SWH	Safety switch works too hard		\$45.					
sww	Safety ewitxh wont work		***					1
TD	Tips down							
TU	Tips up	• • •						
TWP	Trigger won't pull							
TWR	Trigger won't retract							
UNCN-T	Uncoded	***			***	<i>200</i>		
XH	Extracts hard						Sec.	
HI	High		***************************************					
LO	Low		***************************************	****				
LEFT	Left				1918			
RIGHT	Right							
DG	Doesn't Group							
FSST	Front sight tipped						**************************************	
RSTT	Rear sight tipped						***	
RSBR	Rear sight base raised							ľ
FSTR	Front sight raised							
FSTL	Front sight loose		***************************************					
RSTL	Rear sight loose							
MGPT-G	Missing parts at target							
UNCN-G	Uncoded nonconformity at target							
							_	
								-

]			
		-	
	l		*****

AI-P	Assembly incompleye at proof					
868	Barrel bracket gracked or broken at proof	***************************************				
BC-P	Blows cases at proof	 ***************************************				
BEB-P	Barrel extension broken at proof.					
BLP-P	Blanked primer at proof	žva.				
BLSO-P	Barrel lug shot off at proof					
BP-P	Blown primer at proof		.			
BS-P	Barrel split at proof					
DLOS-P	Doesn't lock over shells at proof					
ESB-P	Ejector sticks back at proof					
FCB-P	Fore-end cracked at proof					
FESO-P	Fore-end shot off at proof				Sec.	
FF-P	Fails to fire at proof	***		****		
GCSO-P	Gas cylinder shot off at proof	***************************************				
MSI-P	Magnaflux stamp illegible on bbl		***			
MSM-P	Magnaflux stamp missing on bbl	-		100		
PP-P	Pierced primer at proof	-				
SCB-P	Stock cracked or broken at proof	***************************************				
UNCM-P	Uncoded proof malfunctions	***************************************			2006	
						(1999) (1

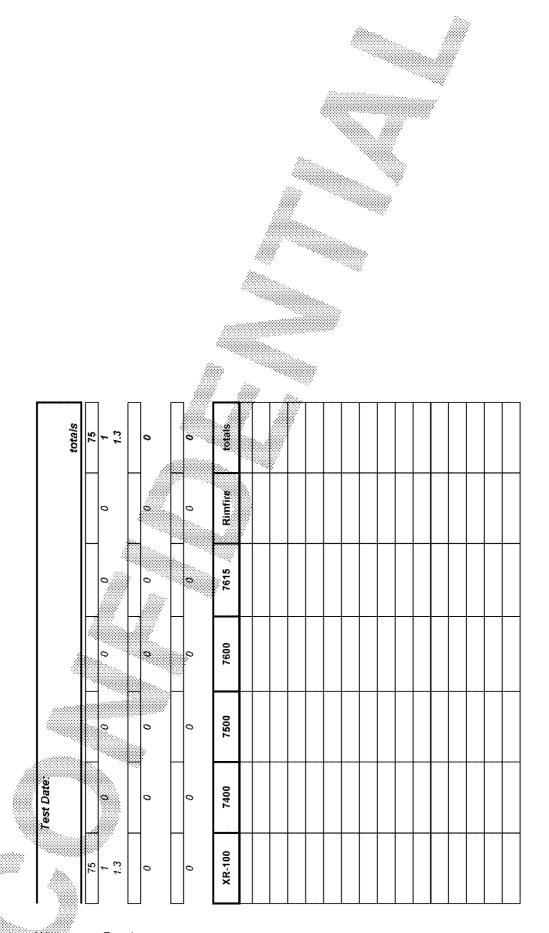


Subject to Protective Order - Williams v. Remington









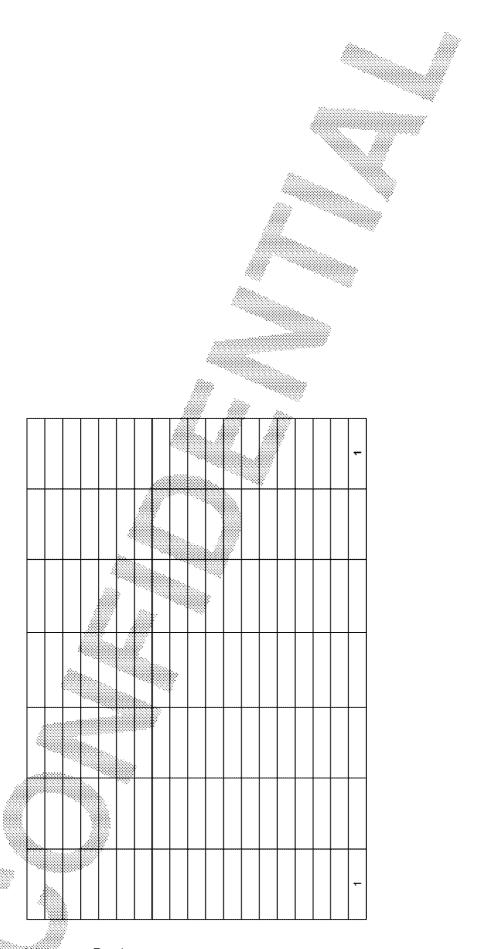

Subject to Protective Order - Williams v. Remington

	////								
Summ	ary Tot	al Test + Proof Failures							
		Total Rejected:	3						
		Total Rejected: Overall Reject Rate:							
	Proo	Shot: Rejected: Percent: Shot: Rejected: Percent:							
	Proo	f Rejected.	0	0	0	0	0	0	0
		Percent,		\$66.					
		Shot	.	8800F					
	Test	Reje ște d	Q	0	O	0	0	Đ	0
		Pe rcen t:		0					
		∴SHOL:	.8883	7 2000	700000	<i>A</i> .			
	Targe	e t Rejected:	0 ****	9	O O	0	0	0	0
	-	Percent:	0	0	Ü	0			
				77 7777		******			

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			************				X	
AB	Action binds		***************************************	<i></i>	9996			
BABS	Bulge at body shoulder		***************************************	***************************************				
BAC	Burr at chamber		***************************************					
BBMA	BBL-to-bolt misalignment				788			
ВВ	Bolt binds/catches		***************************************				***	
BCOBS	Bolt catches on bolt stop							
BCOF	Bolt catches on follower						****	
ВС	Blows cases		-					
BHR	Bolt hits receiver							****
BHS	Bolt plug hits safety switch		***************************************					
BLOP	Bar lock or disconnector out of position		311					
BLSO	Barrel lug shot off							
BPO	Bolt pulls out							
BSSM	Bolt stems shell in magazine		- Control of the Cont					
BWCD	Bolt won't cam down							


		 			 		_	
BWCFM	Bolt won't close over full magazine							
CD	Case dented							
СН	Closes hard							
CLM	Can't laod magazine							
со	Cut-off	\$20.						
CR	Cuts rim							
cs	Cases swell							
CTOG	Chamber tom or gouged							
CTP	Creepy trigger pull			**************************************				
CWSB	Cams wrong side of action bar							
DBB	Doesn't blow back			***				
DCS	Double click in safety switch				Sec.			
DCT	Double click in trigger		<i>III</i>	****				
DCU	Doesn't close-up							
DE	Doesn't eject		***			WW 3000		
DEL	Doesn't eject live round			*****	3///			
DFB	Doesn't feed back] /////	į
DFU	Doesn't feed up							
DLO	Doesn't lock open (after last shell)				7784.5			
DLU	Doesn't lock-up				3			
DS	Dead safe					******		: 4
DX	Doesn't extract							
DXL	Doesn't extract live round							
EDS	Extractor drops shell							*605
ESB	Ejector sticks back							
ESCR	Empty shell catches receiver							
ESS	Extractor stems shell							

	00000000 * 000000000						
FA	Fires automatically		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1				
FB	Follower binds		Personal Control of Co				
FC	Fails to comect		***************************************				
FCB	Fore-end cracked of broken						
FD	Follows-down		\$20.				
FF	Fails to fire		W				
FFP	Flat firing pin						
FOS	Fires on safe	· · · · //					
FPHB	Firing pin hits bbl						
FPHI	Firing pin hits inside rim						
FPO	Floor plate opens	***					
FPOH	Floor plate opens hard					Sec.	
FSR	Fires when safe is released		***************************************				
FT	Follower tips		***************************************				
GCSO	Gas cyl shot off		***************************************	***			
HBL	Heavy bolt lift				**************************************		
HMSC	Heading mismatch-steps on case		***************************************				
HPA	High pressure ammo		***************************************				
HUR	Hard under rail		***************************************			2008	
JCS	Jumps cartridge		1			,	
JM	Jumps magazin e		nan-				*******
70	Jars off		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1				
LB	Light blow						
MAH	Magazine assembles hard						
MCW	Magazine capacity wrong						
MFA	Misfires (ammo)						
MFOP	Magazine follower out of position		-				

ML	Magazine logse		***************************************				
MLH	Magazine loads hard		***************************************				
MRH	Magazine removes hard		***************************************				
ОН	Opens hard						
OR	Over-rides		iva.				
PH	Pulls hard						
PSI	Proof stamp illegible						
PSM	Proof stamp missing						
RBOC	Rings and bulges on case						
RDW	(Action) release doesn't work						
RIC	Rings in chamber		<i></i>		***		
RIS	Ring in sholder					Sec.	
RS	Rim srem						
SBC	Stems bottom chambers			***//			
SBE	Stems bbl extension		-	1799			
SCB	Stock cracked or broken				**************************************		
SCX	Shell catches						
SHI	Short indent						
SI	Stems incline					2004)	
SIC	Stems in chamber	-	***************************************			á	
SL	shaves lead						
SLC	Stems left side of chamber						
SMOC	Stretch marks on case		***************************************				
SOR	Stem over-ride						
SP	Stems port						
SR	Shoulder rough						
SRC	Stems right side of chamber						


	//////////////////////////////////////						
SRIC	Specific rings in chamber						
SSOC	Surface scratches on case		Per la constante de la constan				
STC	Stems top chamber		***************************************				
SWE	Safety switch works too easily						
SWH	Safety switch works too hard		\$45.				
sww	Safety ewitxh work						
TD	Tips down						
TU	Tips up						
TWP	Trigger won't pull						
TWR	Trigger won't retract						
UNCN-T	Uncoded				***		
хн	Extracts hard					Seo.	
			***************************************		****		
HI	High		***************************************				
LO	Low		***************************************	***			
LEFT	Left				**************************************		
RIGHT	Right						
DG	Doesn't Group						
FSST	Front sight tipped						
RSTT	Rear sight tipped	-	***************************************			ž	
RSBR	Rear sight base raised						
FSTR	Front sight raised		A				
FSTL	Front sight loose		***************************************				
RSTL	Rear sight loose						
MGPT-G	Missing parts at target		Name of the last o				
UNCN-G	Uncoded nonconformity at target						
			-				


AI-P	Assembly incompleye at proof						
868	Barrel bracket gracked or broken at proof						
BC-P	Blows cases at proof						
BEB-P	Barrel extension broken at proof						
BLP-P	Blanked primer at proof		\$46.				
BLSO-P	Barrel lug shot off at proof		<i>*************************************</i>				
BP-P	Blown primer at proof			.			
BS-P	Barrel split at proof	· · · · //					
DLOS-P	Doesn't lock over shells at proof						
ESB-P	Ejector sticks back at proof						
FCB-P	Fore-end cracked at proof						
FESO-P	Fore-end shot off at proof					5ec.	
FF-P	Fails to fire at proof						
GCSO-P	Gas cylinder shot off at proof						
MSI-P	Magnaflux stamp illegible on bbl			***			
MSM-P	Magnaflux stamp missing on bbl				*******		
PP-P	Pierced primer at proof						
SCB-P	Stock cracked or broken at proof						
UNCM-P	Uncoded proof malfunctions					*****	
	_	<u> </u>			<u> </u>	 ;	

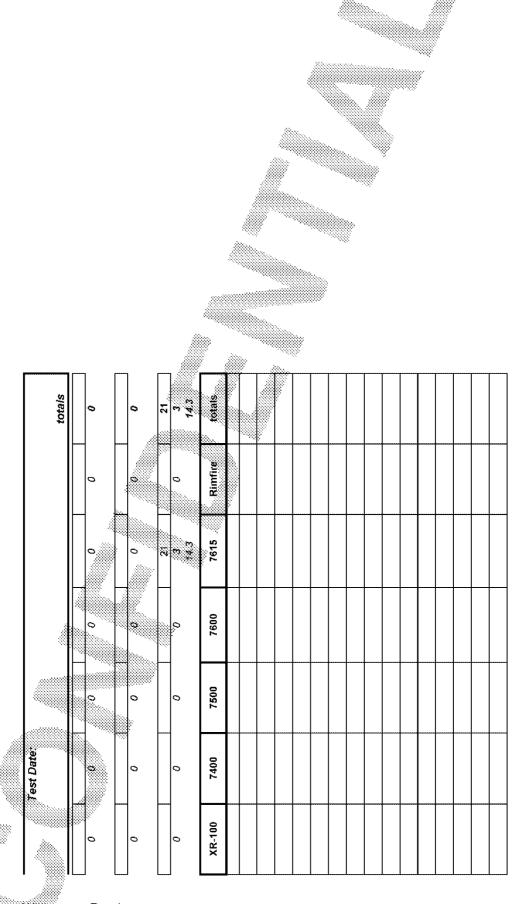






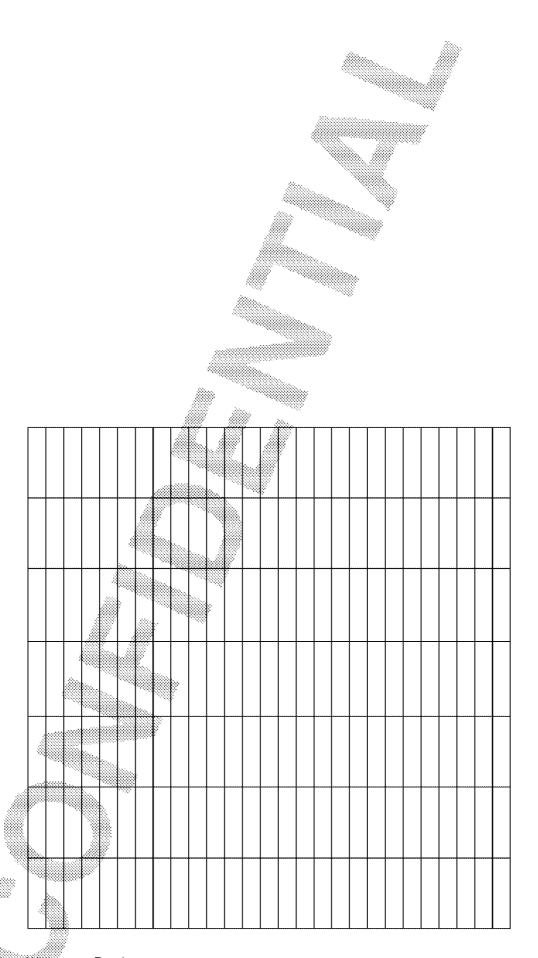

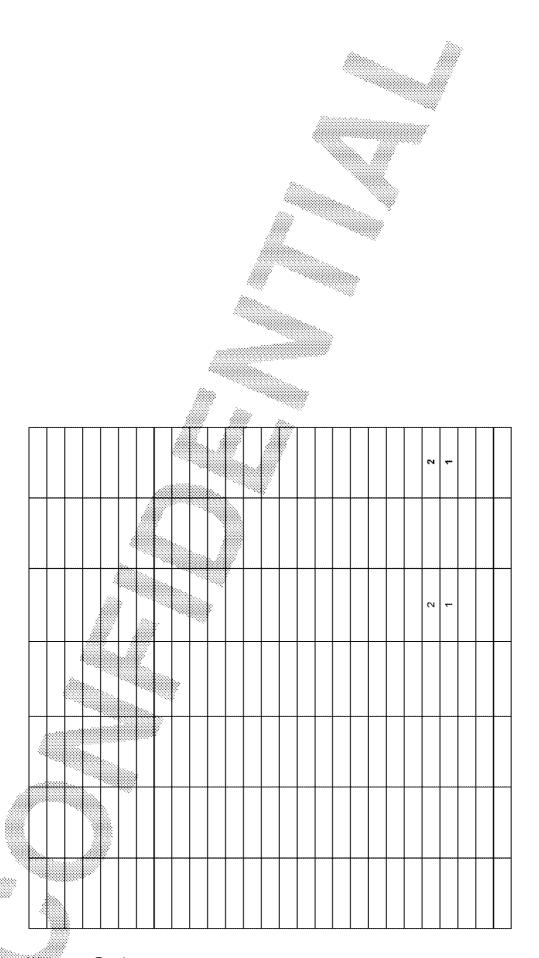

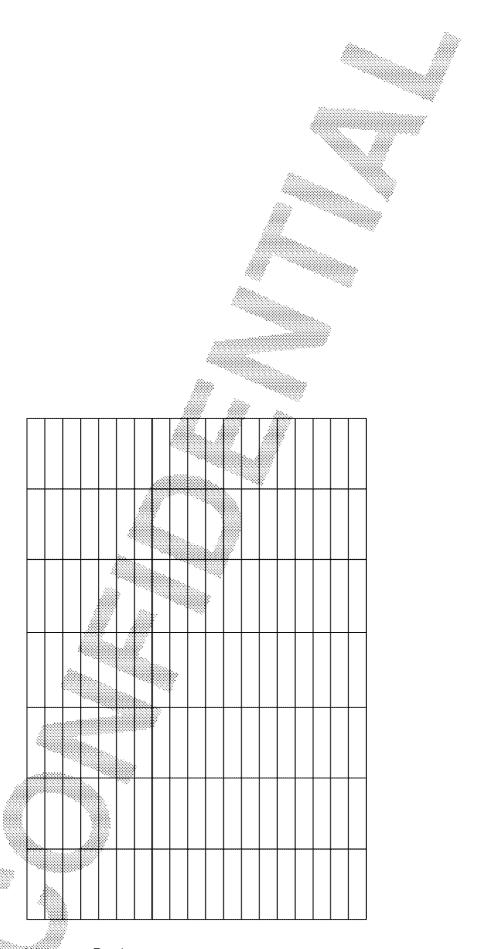

Subject to Protective Order - Williams v. Remington

	10000000										
Summ	ary			of Failures	719						
			Total	Rejected:	36						
Summ			Overall Re	eject Rate:	5.01						
		Proof		\$hot: [Sec. 85	4	15	52	35	13	33
	***************************************	Proof	#8# 8 #	Rejected	0	0	0	0	0	0	0
				Shot: [Rejected: Percent: Shot: [0 00	0.0	0.0	0.0	0.0	0.0	0.0
		<i>#</i>		Shot [55	I	43	15			88
		Test	*	Shot. [Reje sted :	Q.	0	5	0	0	Đ	1
				Percent: Shot: [0.0	0	5 .11.6	0.0			1.1
			·	Shot:	300	K ******	```````````3	2			
		Target		Rejected:	0	0	Ø Ø.0	0 0.0	0	0	0
				Percent:			20. 0	0.0			

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			**********				X	
AB	Action binds			1///				
BABS	Bulge at body shoulder		** Andrews and **					
BAC	Burr at chamber		***************************************					
BBMA	BBL-to-bolt misalignment		and the same of th		*****		3////	
ВВ	Bolt binds/catches		Photo the same of					
BCOBS	Bolt catches on bolt stop		**************************************					
BCOF	Bolt catches on follower		***************************************				****	
ВС	Blows cases		Palatetenate				8	
BHR	Bolt hits receiver		- Anna Anna Anna Anna Anna Anna Anna Ann					*****
BHS	Bolt plug hits safety switch		***************************************					
BLOP	Bar lock or disconnector out of position		**********					
BLSO	Barrel lug shot off		and the same of th					
вро	Bolt pulis out		****					
BSSM	Bolt stems shell in magazine							
BWCD	Bolt won't cam down							


À							
BWCFM	Bolt won't close over full magazine						
CD	Case dented						
СН	Closes hard		***************************************				
CLM	Can't laod magazine						
со	Cut-off		\$20.				
CR	Cuts rim						
CS	Cases swell						
CTOG	Chamber torn or gouged	···					
CTP	Creepy trigger pull						
CWSB	Cams wrong side of action bar						
DBB	Doesn't blow back						
DCS	Double click in safety switch					Sec.	
DCT	Double click in trigger		44440444				
DCU	Doesn't close-up	Anna	***************************************				
DE	Doesn't eject		***************************************	***			
DEL	Doesn't eject live round				**************************************		
DFB	Doesn't feed back		***************************************				
DFU	Doesn't feed up						
DLO	Doesn't lock open (after last shell)		***************************************			***************************************	
DLU	Doesn't lock-up		1			ž.	
DS	Dead safe						***************************************
DX	Doesn't extract						
DXL	Doesn't extract live round		***************************************				
EDS	Extractor drops shell		***				
ESB	Ejector sticks back		Name of the last o				
ESCR	Empty shell catches receiver						
ESS	Extractor stems shell						
	<u> </u>						


Fires automatically							
Follower binds		Per la constante de la constan					
Fails to connect		***************************************					
Fore-end cracked of broken							
Follows-down		Seco.					
Fails to fire		***					
Flat firing pin							
Fires on safe	- ".						
Firing pin hits bbl							
Firing pin hits inside rim							
Floor plate opens	. 449						
Floor plate opens hard						Seo.	
Fires when safe is released		***************************************					
Follower tips							
Gas cyl shot off		***************************************	***				
Heavy bolt lift				×4.555			
Heading mismatch-steps on case		***************************************					
High pressure ammo		***************************************				200000	
Hard under rail		***************************************				*****	
Jumps cartridge		-				ž.	
Jumps magazin e							
Jars off							
Light blow		***************************************					
Magazine assembles hard							
Magazine capacity wrong							
Misfires (ammo)		-	_				
Magazine follower out of position		-					
	Follower binds Fails to connect Fore-end pracked or proken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (ammo)	Follower binds Fails to connect Fore-end bracked or broken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (ammo)	Follower binds Fails to connect fore-end cracked or broken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (ammo)	Follower binds Fails to connect Fore-end cracked or broken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (ammo)	Follower birigs Fails to contrect Fore-end cracked or broken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (armmo)	Follower binds Fails to codifiect Fore-end gracked or broken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (ammo)	Follower binds Fails to commed Fore and cracked or broken Follower-down Fails to fire Fails to fire Filst firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy boll lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (ammo)


SRIC	Specific rin gs in chamber						
SSOC	Surface scratches on case						
STC	Stems top chamber						
SWE	Safety switch works too easily						
SWH	Safety switch works too hard		što.				
sww	Safety ewitxh work						
TD	Tips down						
TU	Tips up						
TWP	Trigger won't pull						
TWR	Trigger won't retract						
UNCN-T	Uncoded	***					
XH	Extracts hard					Sec.	
				11/11/16	***		
HI	High						
LO	Low						
LEFT	Left				*******		
RIGHT	Right						
DG	Doesn't Group						
FSST	Front sight tipped					**************************************	
RSTT	Rear sight tipped					8	
RSBR	Rear sight base raised						*****
FSTR	Front sight raised						
FSTL	Front sight loose						
RSTL	Rear sight loose						
MGPT-G	Missing parts at target						
UNCN-G	Uncoded nonconformity at target						


AI-P	Assembly incompleye at proof		***************************************					
868	Barrel bracket gracked or broken at proof		Maria					
BC-P	Blows cases at proof		***************************************					
BEB-P	Barrel extension broken at proof		***************************************					
BLP-P	Blanked primer at proof		200					
BLSO-P	Barrel lug shot off at proof							
BP-P	Blown primer at proof							
BS-P	Barrel split at proof	···						
DLOS-P	Doesn't lock over shells at proof	100			**************************************			
ESB-P	Ejector sticks back at proof							
FCB-P	Fore-end cracked at proof	****				<i>1</i> //////		
FESO-P	Fore-end shot off at proof						5ec.	
FF-P	Fails to fire at proof		***************************************					
GCSO-P	Gas cylinder shot off at proof	Anna	***************************************					
MSI-P	Magnaflux stamp illegible on bbl		***************************************	***				
MSM-P	Magnaflux stamp missing on bbl		-					
PP-P	Pierced primer at proof		***************************************					
SCB-P	Stock cracked or broken at proof		***************************************					
UNCM-P	Uncoded proof malfunctions						*****	


XR-100	7400	7500	7600	7615	Rimfire	totals
					***************************************	/////
			1			1
8						8

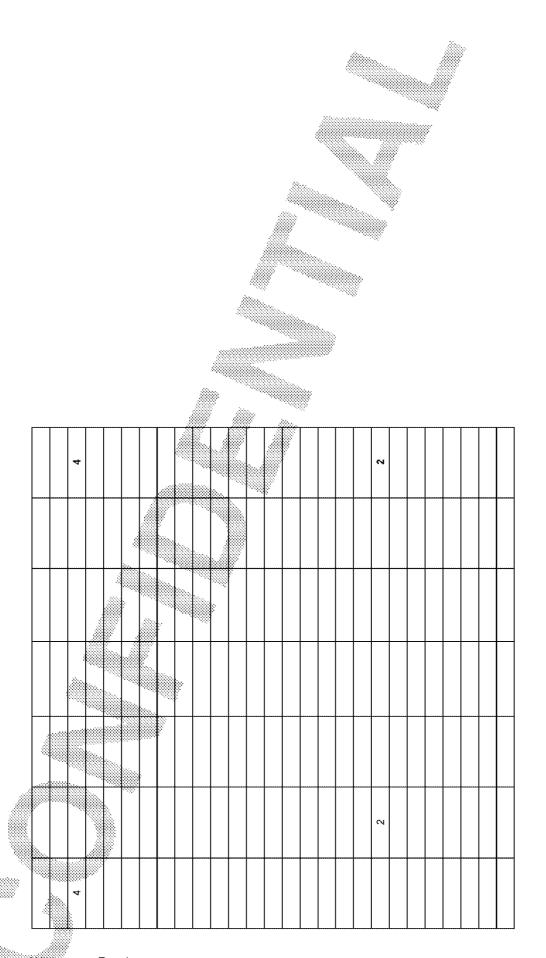

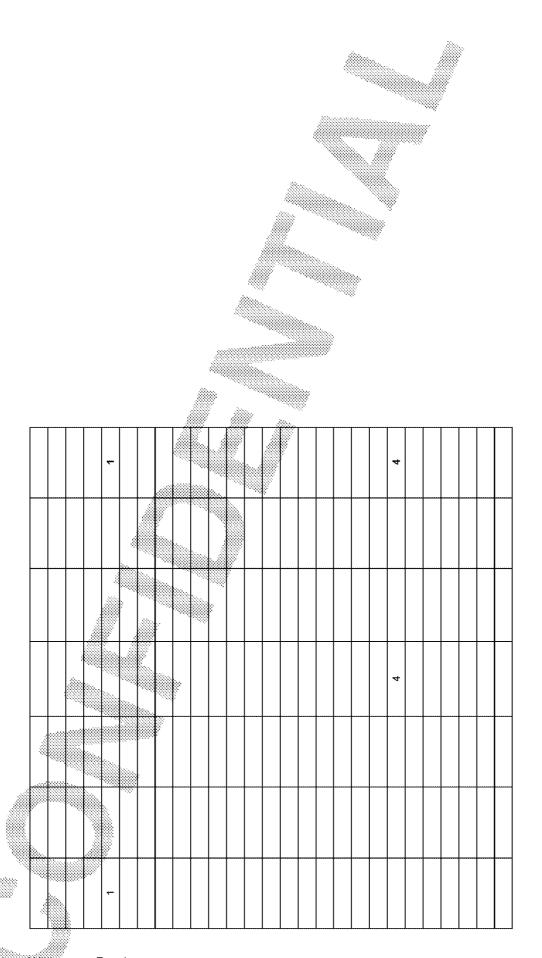

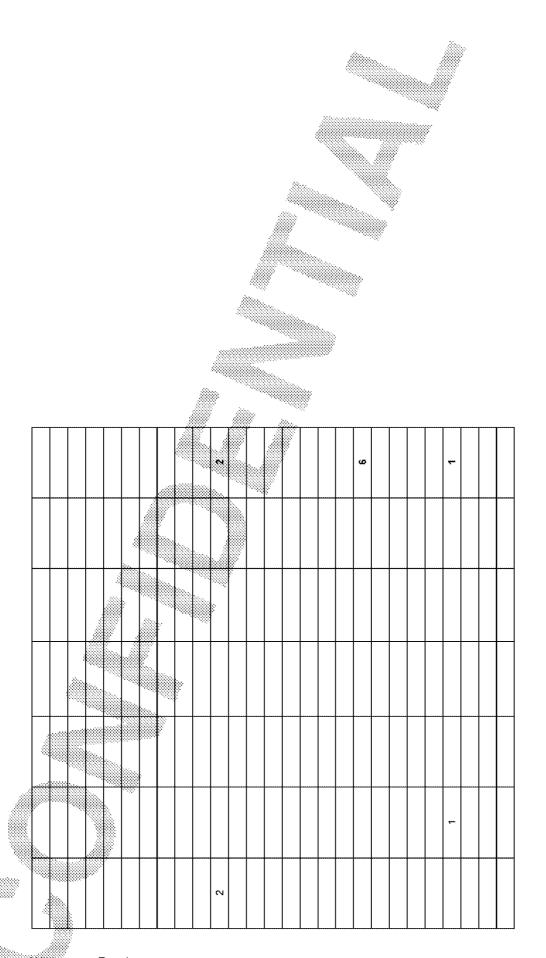

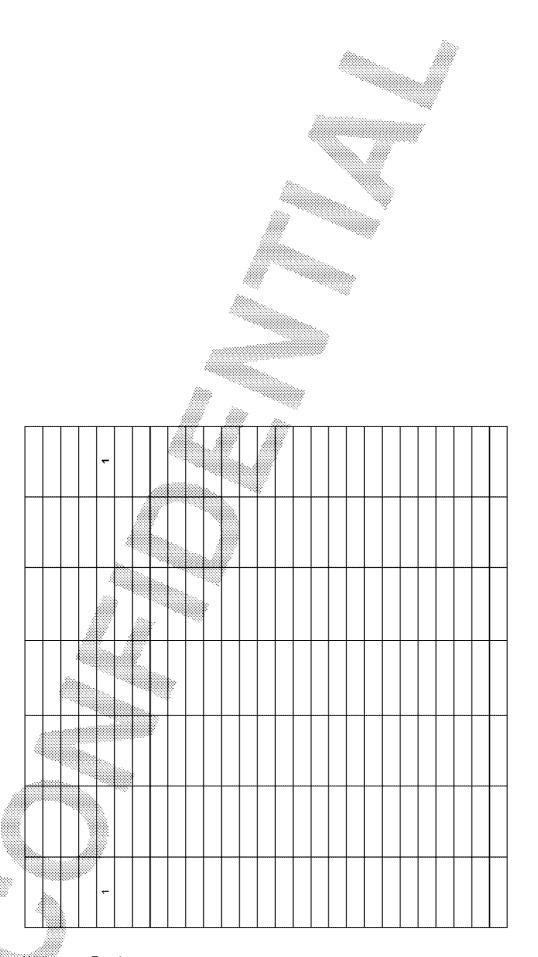

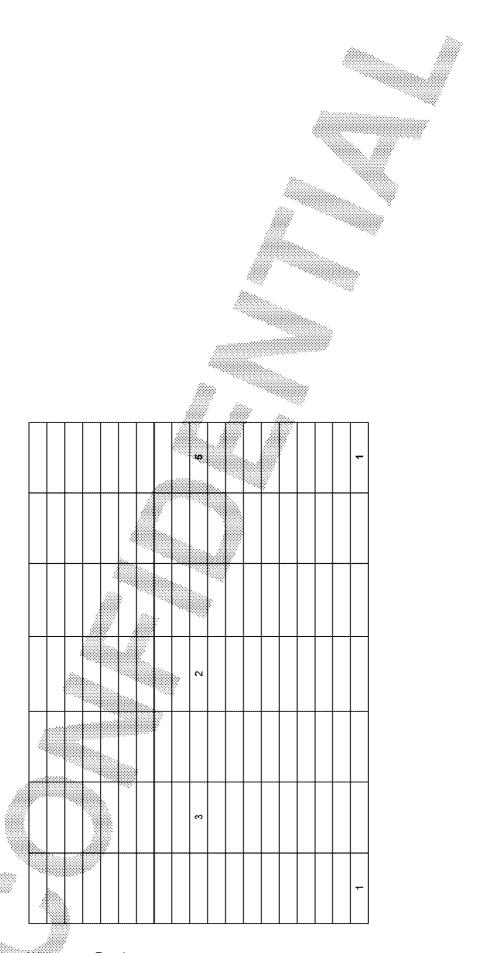

Subject to Protective Order - Williams v. Remington

	200999000									
Sum	mary		Test + Proof Failures							
	7		Total Rejected:	53						
Sum			Total Rejected: Overall Reject Rate:	5.50						
			\$hot:	28	28	6	281	52	2	103
	******	Proof	Rejected:	333 (333 (3 4)	0	0	0	0	0	1
			Percent: Shot	0.0		0.0	0.0	0.0	0.0	1.0
			Shot	*	23		282		88	180
		Test	Reje cted :	Q	88888 n 288882	O	11	0	Đ	2
		,	Shot: Rejected: Percent: Shot: Rejected: Percent:		0 0. g		3.9		0.0	1.1
			Shot:		¥ .0000¥	1000000	26		88	
		Target	Rejected:	0 8888	9 //	O O	0 n n	0	13	0
		3	Percent:	0	9	¢	0.0		14.8	

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	700 CDL	700 POLICE	MODEL 7
			**********		1 ************************************			
AB	Action binds		***************************************					
BABS	Bulge at body shoulder		***************************************					
BAC	Burr at chamber		***************************************		1			
BBMA	BBL-to-bolt misalignment		***************************************		77.00			
ВВ	Bolt binds/catches		***************************************		4			
BCOBS	Bolt catches on bolt stop		***************************************			.,		
BCOF	Bolt catches on follower						****	
ВС	Blows cases		-				,	
BHR	Bolt hits receiver		***************************************					
BHS	Bolt plug hits safety switch		-					
BLOP	Bar lock or disconnector out of position		***************************************					
BLSO	Barrel lug shot off							
BPO	Bolt pulis out		-					
BSSM	Bolt stems shell in magazine		The state of the s					
BWCD	Bolt won't cam down							

			-				
BWCFM	Bolt won't clase over full magazine						
CD	Case dented						
СН	Closes hand				1		
CLM	Can't laod magazine						
co	Cut-off						
CR	Cuts rim		<i>*************************************</i>				
CS	Cases swell						
CTOG	Chamber torn or gouged	***					
CTP	Creepy trigger pull						
CWSB	Cams wrong side of action bar						
DBB	Doesn't blow back	***					
DCS	Double click in safety switch					Sec.	
DCT	Double click in trigger			<i>III</i>	****		
DCU	Doesn't close-up						
DE	Doesn't eject			100			
DEL	Doesn't eject live round				**************************************		
DFB	Doesn't feed back						
DFU	Doesn't feed up						
DLO	Doesn't lock open (after last shell)					*****	
DLU	Doesn't lock-up					18	
DS	Dead safe						
DX	Doesn't extract						1
DXL	Doesn't extract live round						
EDS	Extractor drops shell						
ESB	Ejector sticks back						
ESCR	Empty shell catches receiver						
ESS	Extractor sterns shell						
					•		

ML

Magazine loose

Magazine loads hard


Specific rin gs in chamber							
Surface scratches on case							
Stems top chamber		***************************************					
Safety switch works too easily		-					
Safety switch works too hard		ása.					
Safety ewitxh work							
Tips down							
Tips up							
Trigger won't pull				*** *********************************			
Trigger won't retract							
Uncoded					11/1/11		
Extracts hard				1		5to.	
		-	<i>200</i>	1 200			
High			***************************************				
Low			***				1000
Left				· · · · · · · · · · · · · · · · · · ·			
Right							
Doesn't Group						13	
Front sight tipped		***************************************				****	
Rear sight tipped		***************************************					
Rear sight base raised							***///
Front sight raised							
Front sight loose							
Rear sight loose							
Missing parts at target		-					
Uncoded nonconformity at target							
	Surface scratches on pase Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewitxh work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scratches on dase Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewilxh won't work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scratches on base Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewitxh work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight base raised Front sight raised Front sight loose Rear sight loose Missing parts at target	Surface scratches on pase Stems top enamber Safety switch works too easily Safety switch works too hard Safety ewitxh work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight loose Rear sight loose Missing parts at target	Surface scratches on gase Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewitch works Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight toose Front sight loose Rear sight loose Missing parts at target	Surface scratches on case Stems top chamber Safety switch works too easily Safety switch works too easily Safety switch works too hard Safety ewitxh work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard 1. High Low Left Right Doesn't Group Front sight tipped Rear sight toose Front sight loose Rear sight loose Missing parts at target	Surface scratches on saise Stems top chainber Safety switch works too easily Safety switch works too hard Safety ewitch works too hard Safety ewitch work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight tipped Front sight loose Rear sight loose Missing parts at target


AI-P	Assembly incompleye at proof		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1					
868	Barrel bracket gracked or broken at proof		Per la constante de la constan					
BC-P	Blows cases at proof		***************************************					
BEB-P	Barrel extension broken at proof							
BLP-P	Blanked primer at proof		\$45.					
BLSO-P	Barrel lug shot off at proof							
BP-P	Blown primer at proof							
BS-P	Barrel split at proof	· · · · · · · · · · · · · · · · · · ·						
DLOS-P	Doesn't lock over shells at proof							
ESB-P	Ejector sticks back at proof							
FCB-P	Fore-end cracked at proof	****				<i>2</i> ////		
FESO-P	Fore-end shot off at proof						5ec.	
FF-P	Fails to fire at proof		***************************************		****			
GCSO-P	Gas cylinder shot off at proof		***************************************					
MSI-P	Magnaflux stamp illegible on bbl		4.00	***				
MSM-P	Magnaflux stamp missing on bbl				100000			
PP-P	Pierced primer at proof							
SCB-P	Stock cracked or broken at proof							
UNCM-P	Uncoded proof malfunctions						2006	1
							,	


	1000	<u> </u>					
		Test Daté:		Witness.			totals
16	31	51		145	105		962
0	i 1900	0	0	1	0	0	2
0.1	0	0.0		0.7	0.0	_	0.2
19	2	43		153		ř	961
1:	1	2	0	0	1	0	27
5.	7	4.7		00			2.8
17	2				77		363
- 6	į	0	0	0	5	0	24
3.:	5				6.5		6.6
XR-	100	7400	7500	7600	7615	Rimfire	totals


XR-100	7400	7500	7600	7615	Rimfire	totals
					*********	//////////////////////////////////////
				1		1


						1
1						5

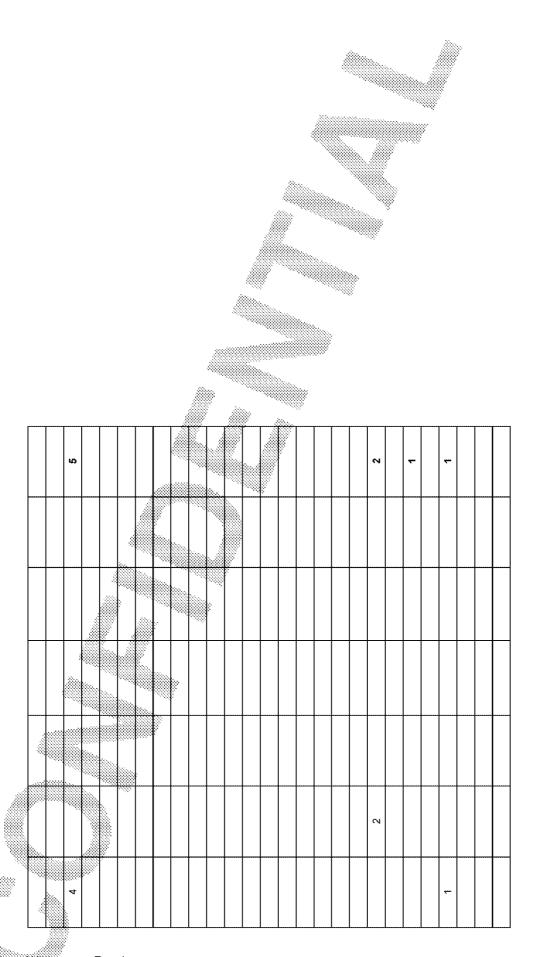

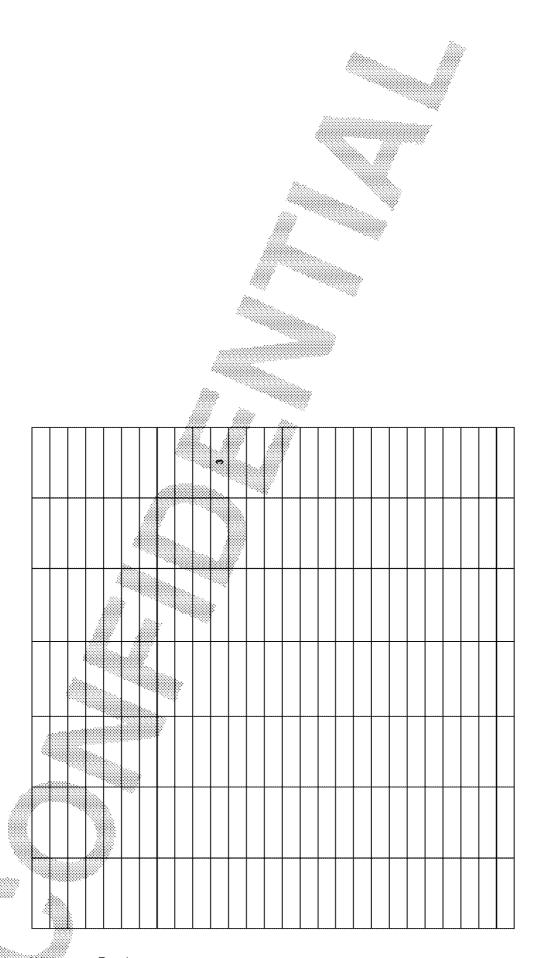

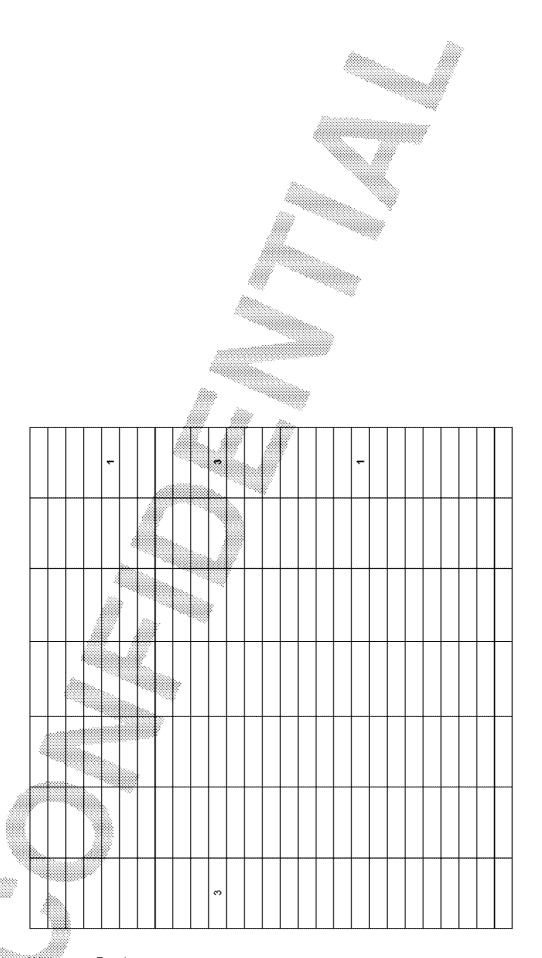

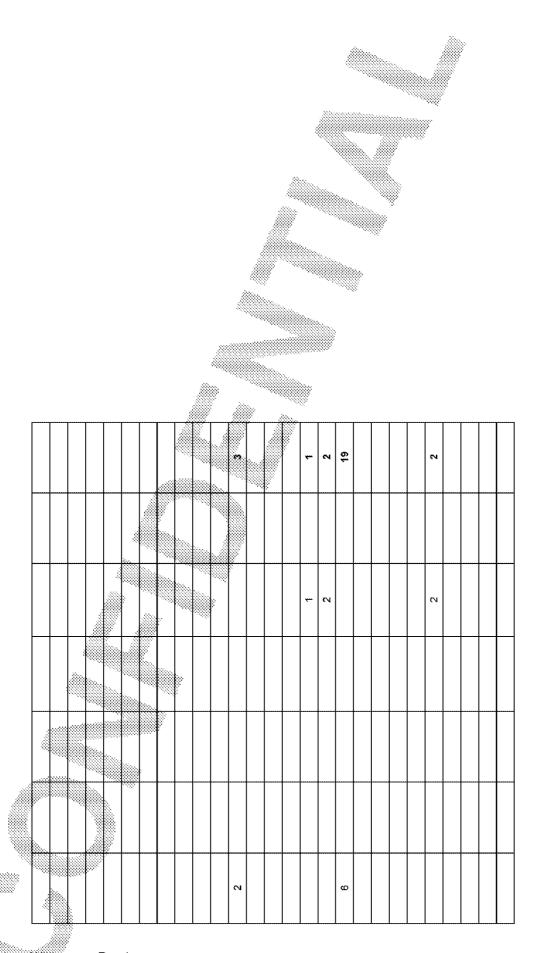

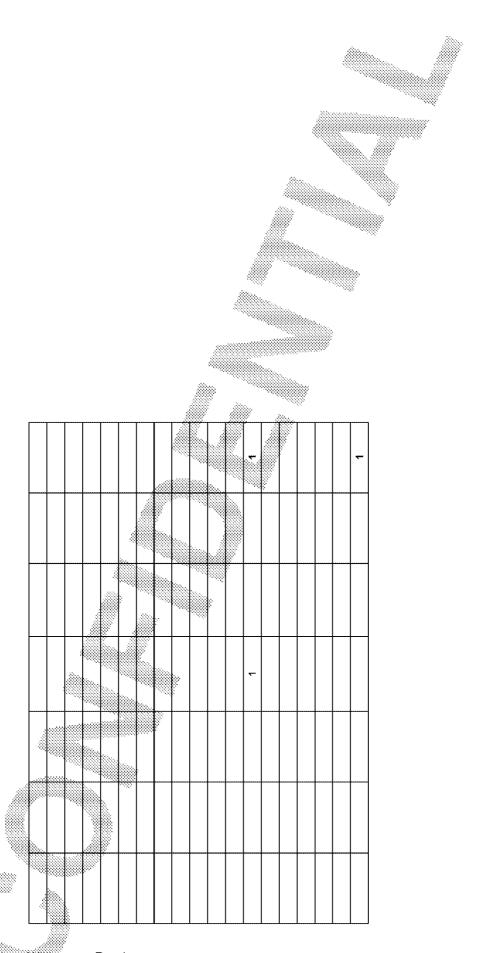

Subject to Protective Order - Williams v. Remington

۲	4	
۲	4	
ŀ	1 1 2	
C	כ	
C)	
Ŀ	_	
ŀ	i	
•	J	
	_	
L	Л	
	Л	

	//////////										
Summa	any	Total		of Failures	76-	4					
			Tota	l Rejected:	6	8					
				il Rejected: Reject Rate:	8.9	0					
		Proof		Shot [₂₀₀ 79	47	6	173	10	17	145
	***************************************	Proof		Rejected	0	0	0	6	0	0	1
				Percent;	0.0	0.0	0.0	3.5	0.0	0.0	0.7
				Shot.	81			161			188
		Test		Rejected.	1	0	0	6	0	Ð	0
		, 551		Shot: [Rejected: Percent: Shot: [Rejected: Percent: Shot: [12	0		3.7			0.0
				Shot:	8 👙	#	1 78888	16			
		Target		Rejected:	0 ///		O	0 0.0	0	0	0
		9 - 1		Percent:	0.Q			9.0			

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			*********				380.	
AB	Action binds		***************************************					
BABS	Bulge at body shoulder		1	***************************************				* *****
BAC	Burr at chamber							
ВВМА	BBL-to-bolt misalignment				****			
вв	Bolt binds/catches				2			
BCOBS	Bolt catches on bolt stop					.,		
BCOF	Bolt catches on follower						******	
вс	Blows cases						,	
BHR	Bolt hits receiver							
BHS	Bolt plug hits safety switch							
BLOP	Bar lock or disconnector out of position							
BLSO	Barrel lug shot off							
BPO	Bolt pulls out							
BSSM	Bolt stems shell in magazine							
BWCD	Bolt won't cam down							

BWCFM

CD

Bolt won't close over full magazine

Case dented

	19900011 1100000000							
FA	Fires automatically							
FB	Follower binds							
FC	Fails to connect							
FCB	Fore-end gracked of broken							
FD	Follows-down		\$t0.					
FF	Fails to fire		<i>-</i>					
FFP	Flat firing pin							
FOS	Fires on safe							
FPHB	Firing pin hits bbl							
FPHI	Firing pin hits inside rim							
FP0	Floor plate opens	***			1	Marie		
FPOH	Floor plate opens hard						Sec.	
FSR	Fires when safe is released			11/11/1	****			
FT	Follower tips							
GCSO	Gas cyl shot off			***				
HBL	Heavy bolt lift				**************************************			
HMSC	Heading mismatch-steps on case							
HPA	High pressure ammo							
HUR	Hard under rail						*****	
JCS	Jumps cartridge						×	
JM	Jumps magazin e							
JO	Jars off							
LB	Light blow							
MAH	Magazine assembles hard							
MCW	Magazine capacity wrong							
MFA	Misfires (ammo)							
MFOP	Magazine follower out of position	_						


ML	Magazine lööse		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1				
MLH	Magazine loads hard						
MRH	Magazine temoves hard						
ОН	Opens hard						
OR	Over-rides		\$20.				
PH	Pulls hard						
PSI	Proof stamp illegible						
PSM	Proof stamp missing						
RBOC	Rings and bulges on case				*		
RDW	(Action) release doesn't work						
RIC	Rings in chamber	***			3		
RIS	Ring in sholder					Sico.	
RS	Rim srem			<i>III</i>	****		
SBC	Stems bottom chambers						
SBE	Stems bbl extension		***************************************	· **			
SCB	Stock cracked or broken				*****		
SCX	Shell catches						
SHI	Short indent		***************************************				
SI	Stems incline	1				****	
SIC	Stems in chamber		-			,	
SL	shaves lead						
SLC	Stems left side of chamber						
SMOC	Stretch marks on case						
SOR	Stem over-ride						
SP	Stems port						
SR	Shoulder rough						
SRC	Stems right side of chamber						


SRIC	Specific rin gs in chamber						
SSOC	Surface scratches on case						
STC	Stems top chamber						
SWE	Safety switch works too easily						
SWH	Safety switch works too hard		što.				
sww	Safety ewitxh work						
TD	Tips down						
TU	Tips up						
TWP	Trigger won't pull						
TWR	Trigger won't retract						
UNCN-T	Uncoded	***					
XH	Extracts hard					Sec.	
				11/11/16	***		
HI	High						
LO	Low						
LEFT	Left				*******		
RIGHT	Right						
DG	Doesn't Group						
FSST	Front sight tipped					**************************************	
RSTT	Rear sight tipped					8	
RSBR	Rear sight base raised						*****
FSTR	Front sight raised						
FSTL	Front sight loose						
RSTL	Rear sight loose						
MGPT-G	Missing parts at target						
UNCN-G	Uncoded nonconformity at target						


AI-P	Assembly incompleye at proof		ALTERNATION OF THE PARTY OF THE					
868	Barrel bracket gracked or broken at proof							
BC-P	Blows cases at proof		Antonia					
BEB-P	Barrel extension broken at proof		***************************************					
BLP-P	Blanked primer at proof		âsa.					
BLSO-P	Barrel lug shot off at proof							
BP-P	Blown primer at proof							
BS-P	Barrel split at proof	···						
DLOS-P	Doesn't lock over shells at proof							
ESB-P	Ejector sticks back at proof							
FCB-P	Fore-end cracked at proof					1000		
FESO-P	Fore-end shot off at proof						5ec.	
FF-P	Fails to fire at proof		-					
GCSO-P	Gas cylinder shot off at proof							
MSI-P	Magnaflux stamp illegible on bbl		-	· **				
MSM-P	Magnaflux stamp missing on bbl		***************************************		*****			
PP-P	Pierced primer at proof				1			
SCB-P	Stock cracked or broken at proof		-					
UNCM-P	Uncoded proof malfunctions		***************************************		5		*****	1
							ž	0.000 (0.0000)


XR-100	7400	7500	7600	7615	Rimfire	totals
					**********	/////
						<i>200</i>


4						6
1						1

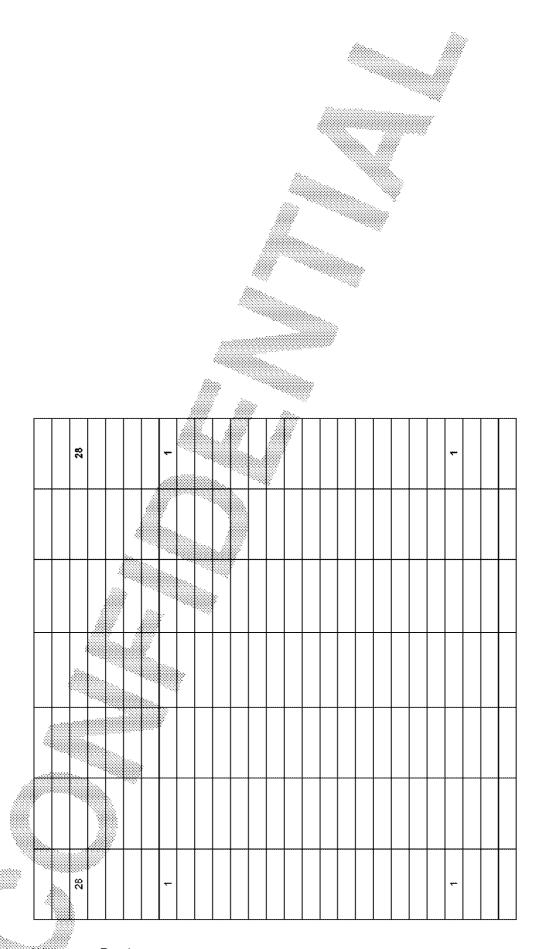

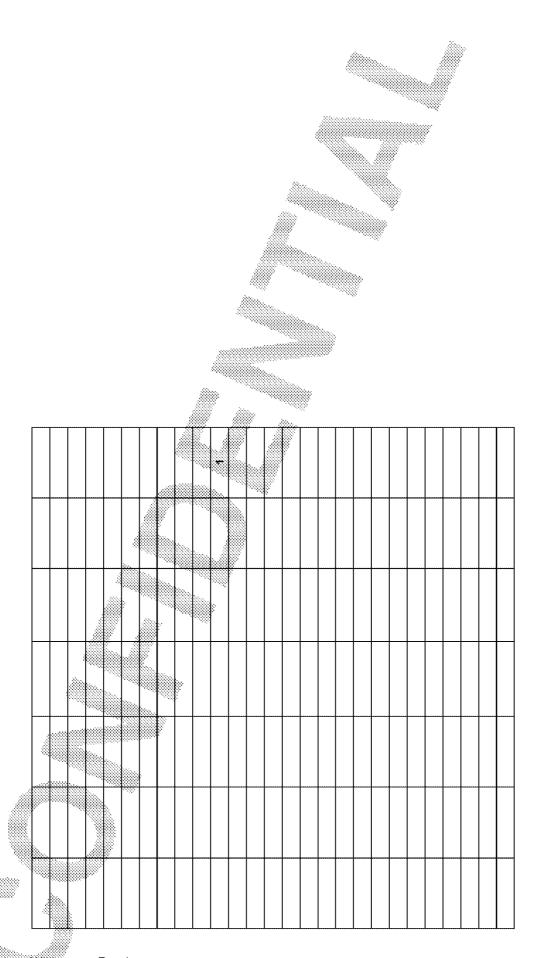

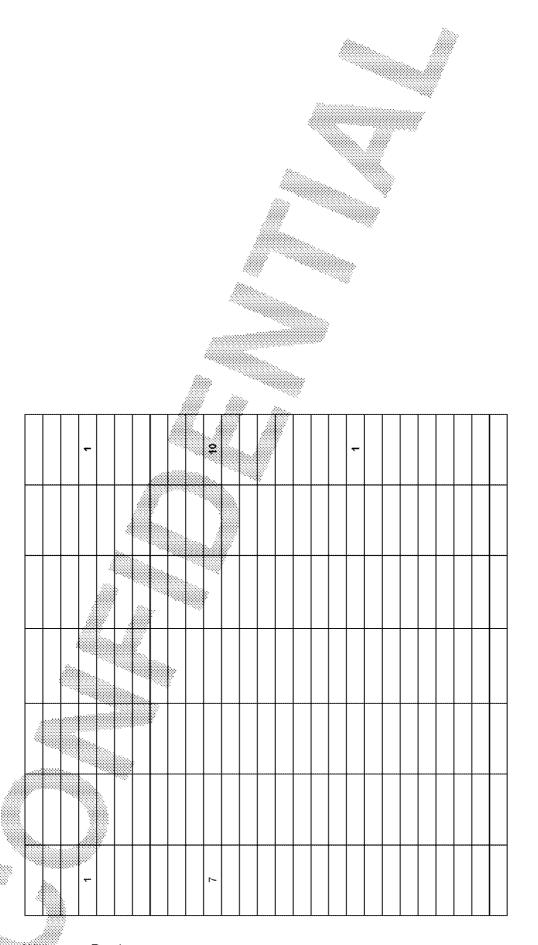

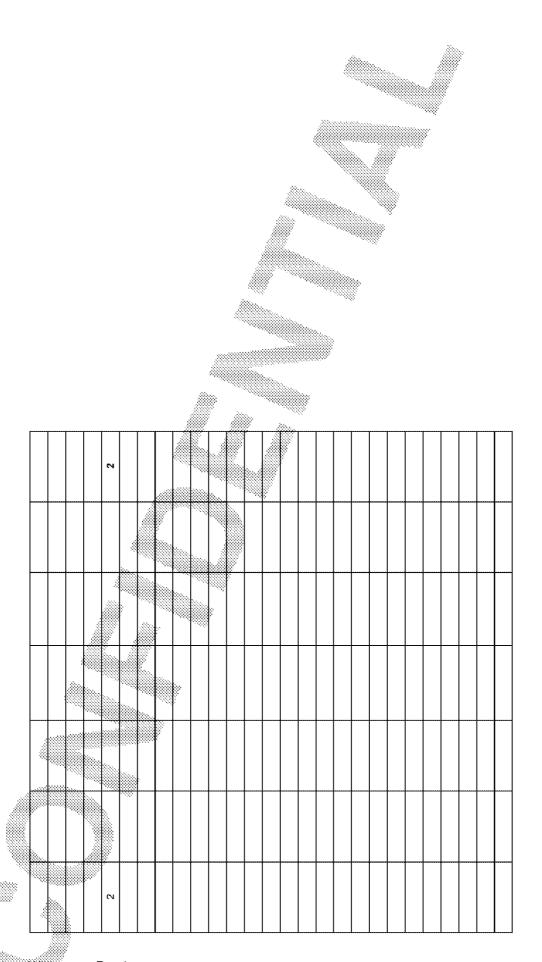

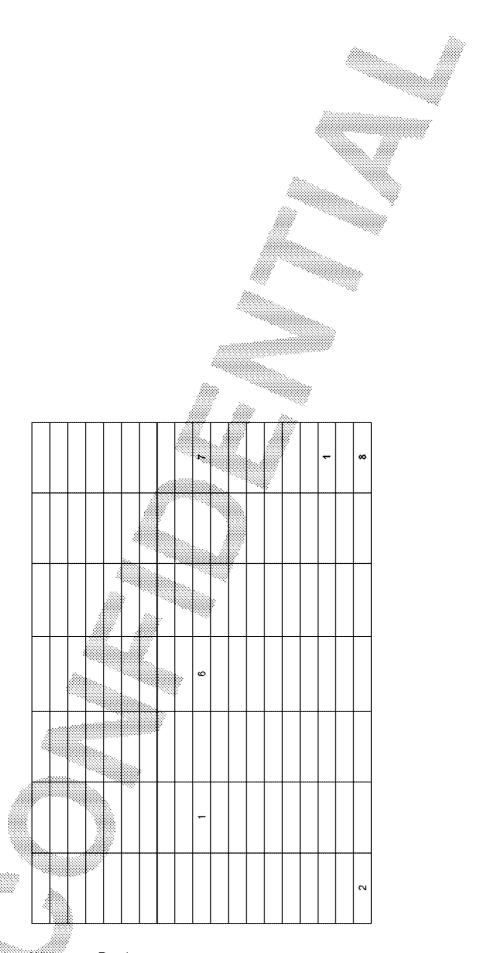

Subject to Protective Order - Williams v. Remington

⊢	1
۲	ŧ
	1
C)
C)
-	1
H	1
-	J
¢	_
O	•
_	J

C			Test + Proof Failures	40	0.7					
Summa			est + Proof Fallures Total Rejected: Overall Reject Rate:	108 7.2	8 <i>1</i> 79 27					
			Shot: Rejected:	269	80		187		26	46
	******	Proof	Rejected:	1	0	0	0	0	0	0
	***************************************		Shot Rejected Percent Shot	0.4	976 39999		0.0		0.0	0.0
			Shot	247			197	212	43	
		Test	Reje cted :	13	0	0	5	0	1	0
			Shot Rejected Percent Shot Rejected Percent	5.3	0		2.5	0.0	2.3	
			Shot:	24	₩	1 78888	. 20		42	
		Target	Rejected:		•	0	0 0 .0	0	12	0
		3	Percent:	0. Q			0.0		28.6	

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			**********				X	
AB	Action binds			<i></i>				
BABS	Bulge at body shoulder		vening the same of					
BAC	Burr at chamber		***************************************					
BBMA	BBL-to-bolt misalignment				****			
ВВ	Bolt binds/catches							
BCOBS	Bolt catches on bolt stop							
BCOF	Bolt catches on follower		-					
ВС	Blows cases						8	
BHR	Bolt hits receiver							*****
BHS	Bolt plug hits safety switch							
BLOP	Bar lock or disconnector out of position							
BLSO	Barrel lug shot off		***					
BPO	Bolt pulls out							
BSSM	Bolt stems shell in magazine							
BWCD	Bolt won't cam down							

BWCFM

Bolt won't close over full magazine

	366366611								_
FA	Fires automatically		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1						1
FB	Follower binds								1
FC	Fails to comect								1
FCB	Fore-end cracked or broken		***************************************						1
FD	Folfows-down		dus.						1
FF	Fails to fire								1
FFP	Flat firing pin								1
FOS	Fires on safe								1
FPHB	Firing pin hits bbl								1
FPHI	Firing pin hits inside rim								1
FP0	Floor plate opens	13			3	11/1/11	1		1
FPOH	Floor plate opens hard						5co.		1
FSR	Fires when safe is released			11/11/1	***				1
FT	Follower tips				2				1
GCSO	Gas cyl shot off		*******	***					1
HBL	Heavy bolt lift				*****				1
HMSC	Heading mismatch-steps on case								1
HPA	High pressure ammo		***************************************						ŀ
HUR	Hard under rail		***************************************				****		
JCS	Jumps cartridge		A.				;		
JM	Jumps magazin e							- 44//	ľ
10	Jars off								1
LB	Light blow								1
MAH	Magazine assembles hard		***************************************						1
MCW	Magazine capacity wrong		***************************************						1
MFA	Misfires (ammo)								1
MFOP	Magazine follower out of position								1


ML	Magazine loose							
MLH	Magazine loads hard		***************************************					
MRH	Magazine removes hard		***************************************					
ОН	Opens hard		National Property and Property					
OR	Over-indes		Seco.					
PH	Pulls hard							
PSI	Proof stamp illegible							
PSM	Proof stamp missing							
RBOC	Rings and bulges on case							
RDW	(Action) release doesn't work							
RIC	Rings in chamber	***						
RIS	Ring in sholder						Sec.	
RS	Rim srem		***************************************					
SBC	Stems bottom chambers							
SBE	Stems bbl extension		*******	****				
SCB	Stock cracked or broken				*******			
SCX	Shell catches					******		
SHI	Short indent		***************************************					
SI	Stems incline		***************************************				******	
SIC	Stems in chamber		A.				á	
SL	shaves lead							
SLC	Stems left side of chamber		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1					
SMOC	Stretch marks on case							
SOR	Stem over-ride							
SP	Stems port							
SR	Shoulder rough							
SRC	Stems right side of chamber		-					


//////////////////////////////////////							
Specific rings in chamber							
Surface scratches on case		Per la constante de la constan					
Stems top chamber		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1					
Safety switch works too easily							
Safety switch works too hard		\$45.					
Safety ewitxh work							
t the rth							
Trigger won't pull							
Trigger won't retract							
Uncoded	1						
Extracts hard						5ec.	
		***************************************		883			
High		***************************************					
Low		***************************************	***				
Left				19.000 m			
Right							
Doesn't Group						12	
Front sight tipped						**************************************	
Rear sight tipped						;	
Rear sight base raised							
Front sight raised		A					
Front sight loose		***************************************					
Rear sight loose							
Missing parts at target		No. of Contract of					
Uncoded nonconformity at target							
		-					
	Surface scratches on case Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewitxh work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight toose Rear sight loose Rear sight loose Missing parts at target	Surface scratches on dase Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewitch work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scribbles on base Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewitch work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight loose Rear sight loose Missing parts at target	Surface scratches on gase Sterns top chamber Safety switch works too easily Safety switch works too hard Safety ewitxh work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scratches on case Stems top chainber Safety switch works too easily Safety switch works too hard Safety switch works Tips down Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight base raised Front sight loose Rear sight loose Rear sight loose Missing parts at target	Surface scrattches on asse Stems top étiamber Safety switch works too easily Safety switch works foo hard Safety ewitch works foo hard Safety ewitch work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scratches on dase Stems top étrainber Safety switch works top easily Safety switch works top easily Safety switch works top easily Safety ewitch works top easily Safety ewitch works top easily Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight toose Front sight loose Rear sight loose Missing parts at target


	30000000000000000000000000000000000000						
AI-P	Assembly incompleye at proof						
868	Barrel bracket gracked or broken at proof		**************************************				
BC-P	Blows cases at proof		440044100				
BEB-P	Barrel extension broken at proof		**************************************				
BLP-P	Blanked primer at proof						
BLSO-P	Barrel lug shot off at proof						
BP-P	Blown primer at proof						
BS-P	Barrel split at proof	· · · · · · · · · · · · · · · · · · ·					
DLOS-P	Doesn't lock over shells at proof						
ESB-P	Ejector sticks back at proof						
FCB-P	Fore-end cracked at proof	100			<i>**</i>		
FESO-P	Fore-end shot off at proof					5ec.	
FF-P	Fails to fire at proof	-	***************************************				
GCSO-P	Gas cylinder shot off at proof		************				
MSI-P	Magnaflux stamp illegible on bbl		410444				
MSM-P	Magnaflux stamp missing on bbl		***************************************	*******			
PP-P	Pierced primer at proof		**********				
SCB-P	Stock cracked or broken at proof		-				
UNCM-P	Uncoded proof malfunctions	1	**************************************			*****	
<u> </u>	·	-		-	-	a a	


XR-100	7400	7500	7600	7615	Rimfire	totals


4						4

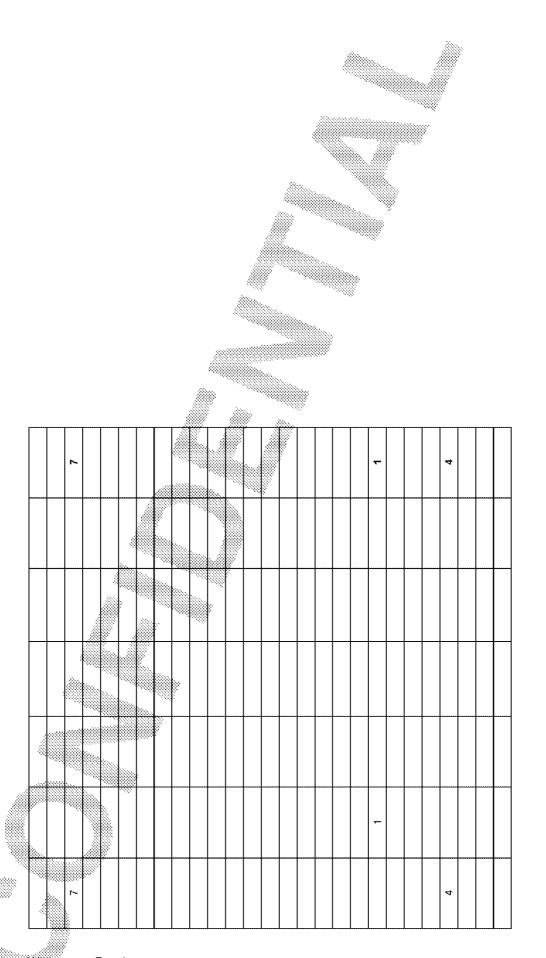

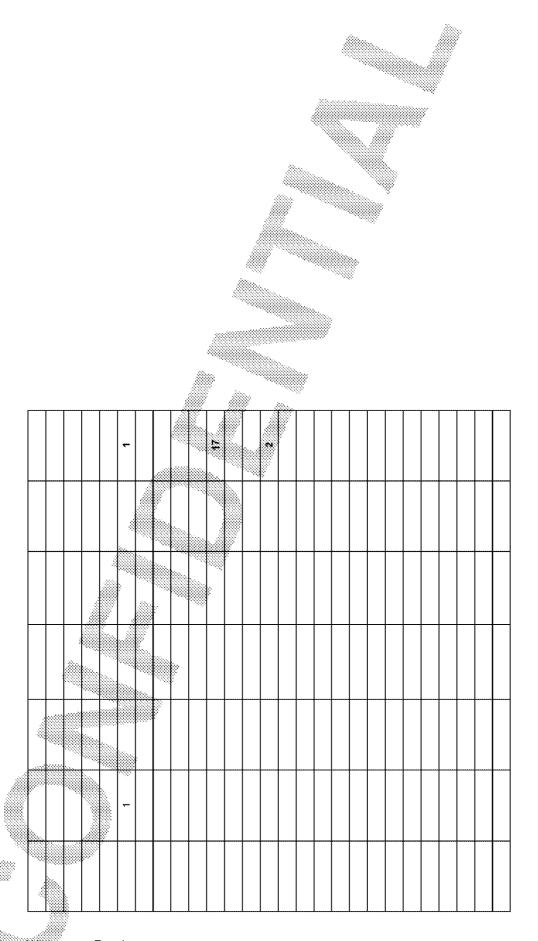

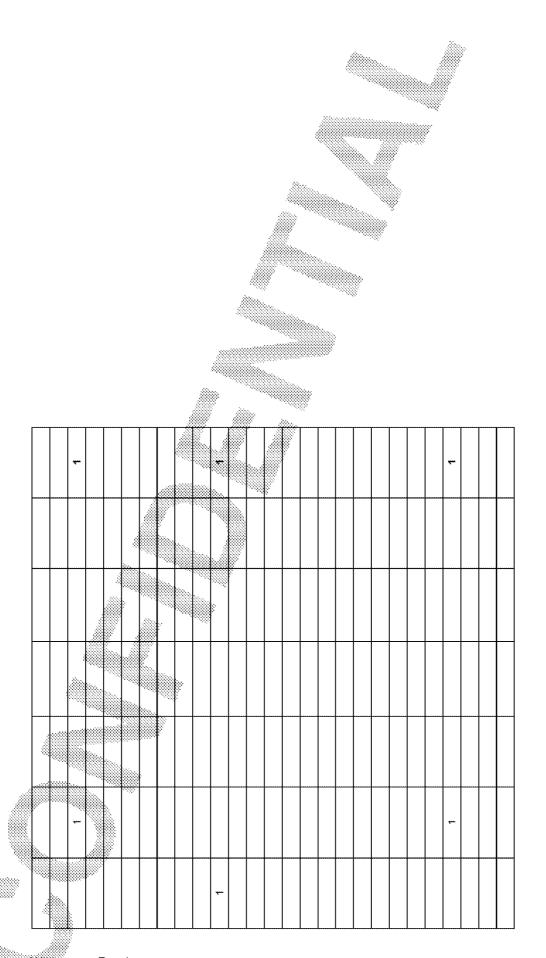

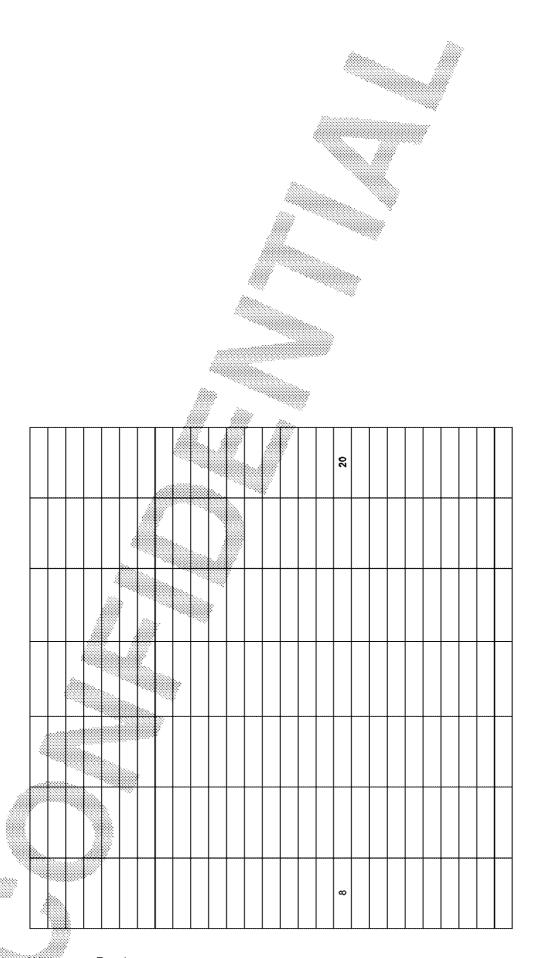

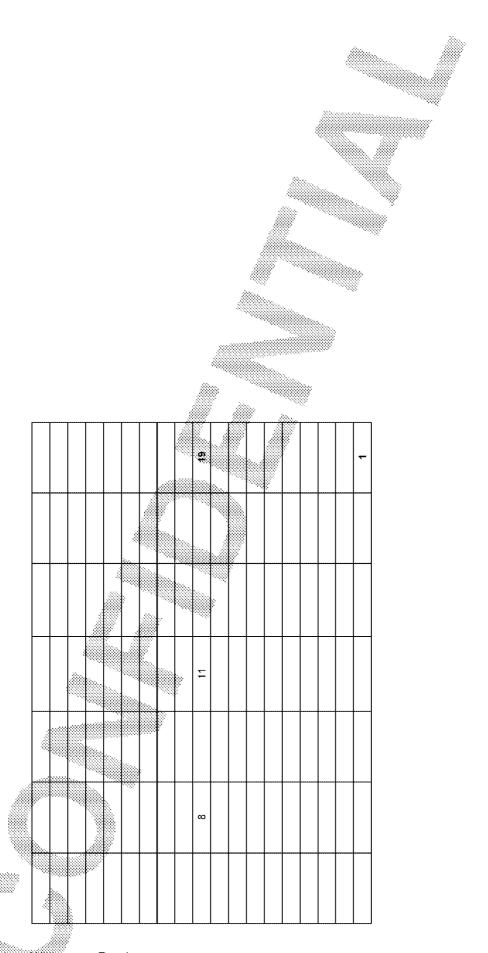

Subject to Protective Order - Williams v. Remington

H	1
Ŀ	ł
Þ	1
C)
C	
۲	
H	1
-	J
1	`
٠.	
u	2

	///////////////////////////////////////										
Summa	any	Total	Test + Proof Fail	ures	788						
			Total Reje	cted:	58						
			Total Rejed Overall Reject I	Rate:	7.36						
			Reji Pe Reji Pe	Shot: icted:	164	2		245	21		39
	***********	Proof	Reje	cted:	0	0	0	3	0	0	0
			Pe	rcent	0.0	0.0		1.2	0.0		0.0
				Shot.	196	<i>1007</i>		306			25
		Test	Reje	cted:	19	0	Sec. 0	8	0	Ð	1
			Pe	rcent: Shot:	19 9.7		O	2.6			4.0
			489	Shot:	19		1 100000	23			2
		Target	Reje	cted:	0	## #	Ø.	0_	0	0	0
		3	Pe.	rcent:	0.0		Ü	0.0			0.0

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	700 CDL	700 POLICE	MODEL 7
			*********			***	X	
AB	Action binds		***************************************	<i>/////</i>				
BABS	Bulge at body shoulder		***************************************					
BAC	Burr at chamber		***************************************		3			
BBMA	BBL-to-bolt misalignment		***************************************		*****			
ВВ	Bolt binds/catches		***************************************					
BCOBS	Bolt catches on bolt stop		The services					
BCOF	Bolt catches on follower		***************************************		2		3,000	
ВС	Blows cases						,	
BHR	Bolt hits receiver							
BHS	Bolt plug hits safety switch		***************************************					
BLOP	Bar lock or disconnector out of position		· ·					
BLSO	Barrel lug shot off		***************************************					
BPO	Bolt pulls out		***************************************					
BSSM	Bolt stems shell in magazine		-					
BWCD	Bolt won't cam down							

		1	ŧ .				ı
	Bolt won't close over full magazine		1				
CD	Case dented		***************************************				
СН	Closes hard		***********				1
CLM	Can't laod magazine		-		1		
СО	Cut-off						
CR	Cuts rim		***				
cs	Cases swell						
стоб	Chamber torn or gouged	· · · · ·					
CTP	Creepy trigger pull				Militar.		
CWSB	Cams wrong side of action bar						
DBB	Doesn't blow back	***			**.		
DCS	Double click in safety switch					Sec.	
DCT	Double click in trigger		***************************************		****		
DCU	Doesn't close-up		***************************************	***************************************			
DE	Doesn't eject		***************************************	***			
DEL	Doesn't eject live round				***************************************		
DFB	Doesn't feed back		***************************************				
DFU	Doesn't feed up						
DLO	Doesn't lock open (after last shell)						
DLU	Doesn't lock-up		***************************************			*80	
DS	Dead safe						***//
DX	Doesn't extract						
DXL	Doesn't extract live round						
EDS	Extractor drops shell				1		
ESB	Ejector sticks back						
ESCR	Empty shell catches receiver						
ESS	Extractor stems shell						
ESS	Extractor stems shell		1				

4	
Hi.	
ij	
0	
Ō	
01	
011	
ILE00117	
74	
74	
J	

FA	Fires automatically							
FB	Follower binds							
FC	Fails to connect		***************************************					
FCB	Fore-end cracked of broken		***************************************					
FD	Follows-down							
FF	Fails to fire		***					
FFP	Flat firing pin							
FOS	Fires on safe							
FPHB	Firing pin hits bbl							
FPHI	Firing pin hits inside rim							
FPO	Floor plate opens	5			1	<i>11/1</i> /11		
FPOH	Floor plate opens hard						Sec.	
FSR	Fires when safe is released		***************************************					
FT	Follower tips	2	***************************************					
GCSO	Gas cyl shot off		***************************************	·**				
HBL	Heavy bolt lift				*****			
HMSC	Heading mismatch-steps on case		***************************************					
HPA	High pressure ammo							
HUR	Hard under rail						*****	
JCS	Jumps cartridge						ž.	
JM	Jumps magazin e							
10	Jars off							
LB	Light blow		***************************************					
MAH	Magazine assembles hard		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1					
MCW	Magazine capacity wrong							
MFA	Misfires (ammo)							
MFOP	Magazine follower out of position							


ML	Magazine lööse							
MLH	Magazine loads hard		**************************************					
MRH	Magazine removes hard		-					
ОН	Opens hard							
OR	Over-ndes		344.					
PH	Pulls hard		W					
PSI	Proof stamp illegible							
PSM	Proof stamp missing	· · · · //						
RBOC	Rings and bulges on case							
RDW	(Action) release doesn't work							
RIC	Rings in chamber		//////////////////////////////////////			<i>11/1</i> /11		
RIS	Ring in sholder						Sec.	
RS	Rim srem		****		****			
SBC	Stems bottom chambers		***************************************					*****
SBE	Stems bbl extension		-	1%				
SCB	Stock cracked or broken		-		**************************************			
SCX	Shell catches		-					
SHI	Short indent							
SI	Stems incline	3	Haddeledade				***************************************	
SIC	Stems in chamber		****				ž.	
SL	shaves lead		***************************************					******
SLC	Stems left side of chamber		**********					
SMOC	Stretch marks on case	g	***************************************					
SOR	Stem over-ride		**************************************					
SP	Stems port		***					
SR	Shoulder rough		***************************************					
SRC	Stems right side of chamber	-	-					


deco		·					
Specific rings in chamber							
Surface scratches on case							
Stems top chamber	.,.						
Safety switch works too easily							
Safety switch works too hard		\$10.					
Safety ewitxh won't work		<i></i>					
Tips down							
Tips up							
Trigger won't pull				*			
Trigger won't retract							
Uncoded	***	//////////////////////////////////////		***			
Extracts hard						5to.	
			<i>III</i>	*** //			
High				.			*** ******
Low			***				
Left				**************************************			
Right							
Doesn't Group						36666999	
Front sight tipped						2000	
Rear sight tipped						;	
Rear sight base raised							
Front sight raised							
Front sight loose							
Rear sight loose							
Missing parts at target							
Uncoded nonconformity at target							
	Surface scratches on dase Stems top chainber Safety switch works too easily Safety switch works too hard Safety ewitxh won't work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scratches on case Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewitxh won't work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight base raised Front sight loose Rear sight loose Rear sight loose Missing parts at target	Surface scratches on base Stems top etrainber Safety switch works too easily Safety switch works foo easily Safety ewilxh work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight loose Rear sight loose Missing parts at target	Surface scratches on base Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewitxh work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight loose Front sight loose Missing parts at target	Surface scrattches on case Sterns top chamber Safety switch works too easily Safety switch works too hard Safety switch works too hard Safety ewitch works Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight tose Front sight raised Front sight loose Rear sight loose Missing parts at target	Surface scratches on case Stems top character Safety switch works too easily Safety switch works foo hard Safety ewitxh work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight loose Rear sight loose Missing parts at target	Surface scrattches on dase Stems top chainber Safety switch works too easily Safety switch works foo haid Safety ewixth work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Lett Right Doesn't Group Front sight tipped Rear sight tipped Rear sight toose Rear sight loose Rear sight loose Missing parts at target

AI-P	Assembly incompleye at proof						
868	Barrel bracket gracked or broken at proof						
BC-P	Blows cases at proof		***************************************				
BEB-P	Barrel extension broken at proof		***************************************				
BLP-P	Blanked primer at proof						
BLSO-P	Barrel lug shot off at proof		A.				
BP-P	Blown primer at proof						
BS-P	Barrel split at proof						
DLOS-P	Doesn't lock over shells at proof						
ESB-P	Ejector sticks back at proof						
FCB-P	Fore-end cracked at proof	1.400					
FESO-P	Fore-end shot off at proof					Seo.	
FF-P	Fails to fire at proof		***************************************				
GCSO-P	Gas cylinder shot off at proof		***************************************				
MSI-P	Magnaflux stamp illegible on bbl		4.00	133			
MSM-P	Magnaflux stamp missing on bbl				*******		
PP-P	Pierced primer at proof						
SCB-P	Stock cracked or broken at proof						
UNCM-P	Uncoded proof malfunctions				3	****	
						á	


XR-100	7400	7500	7600	7615	Rimfire	totals
					***********	////


						3
8						8
						2

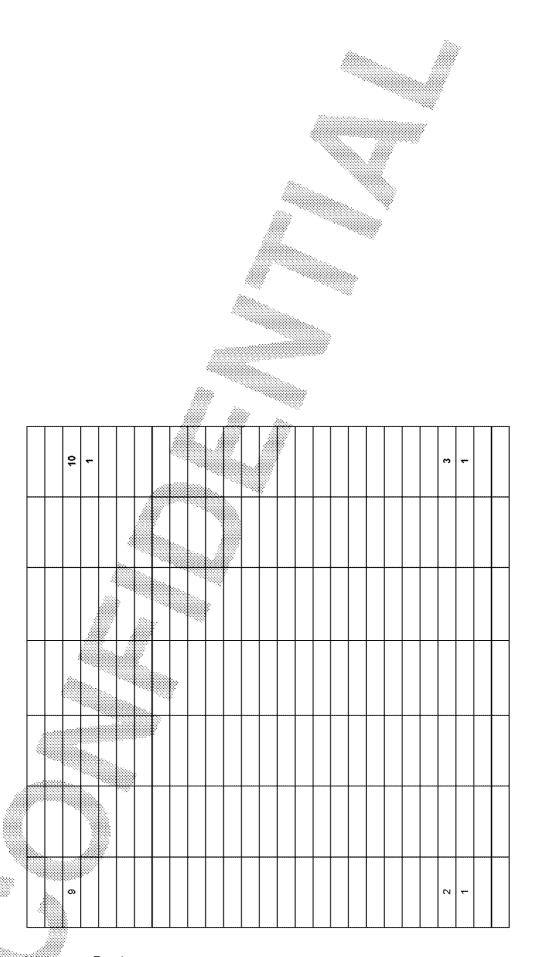


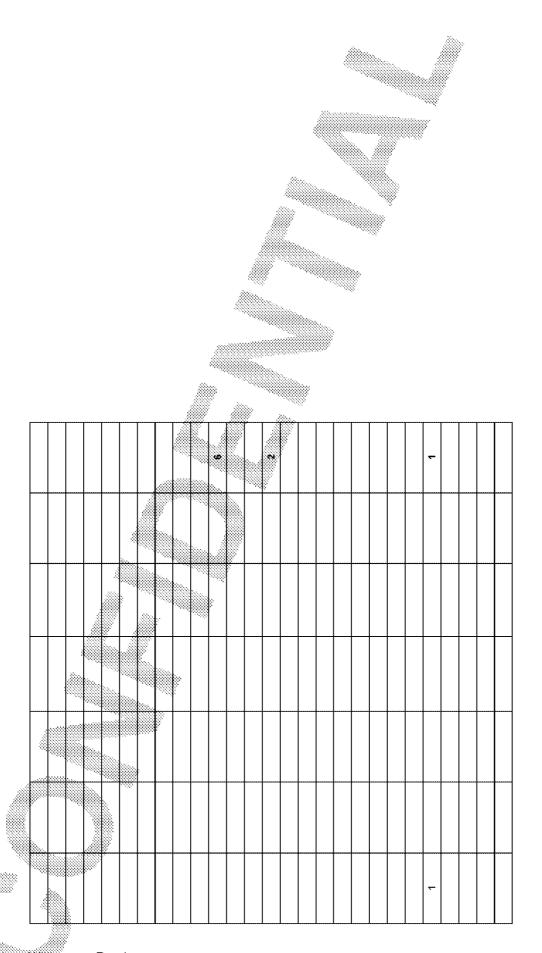

Subject to Protective Order - Williams v. Remington

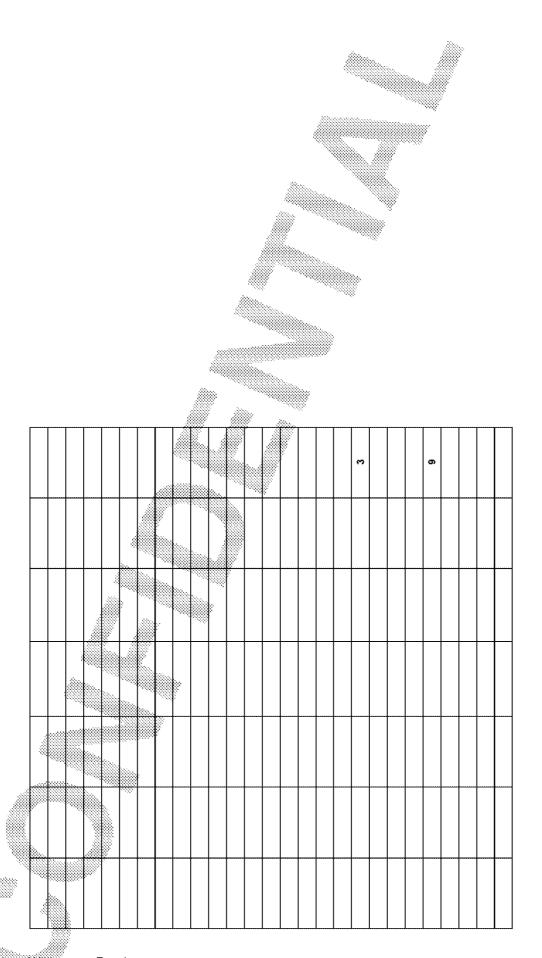

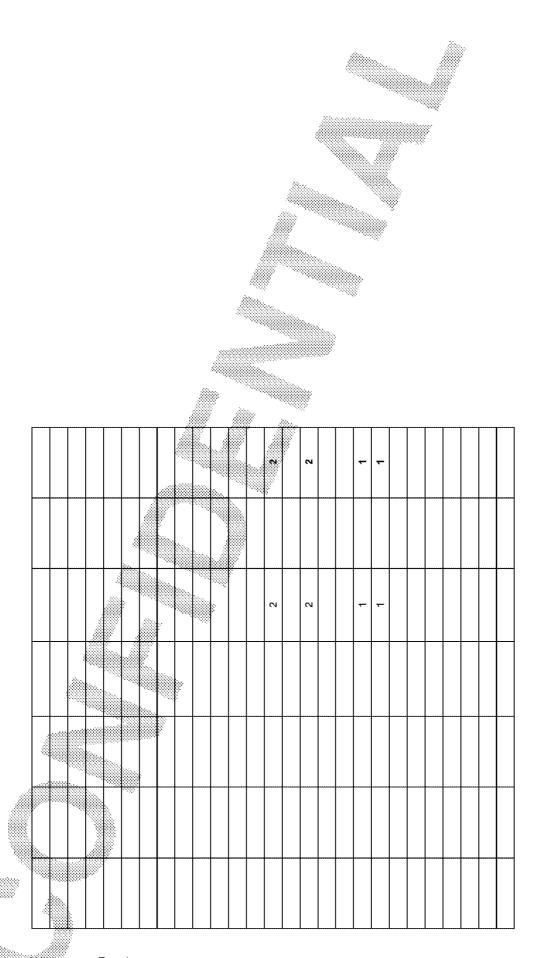

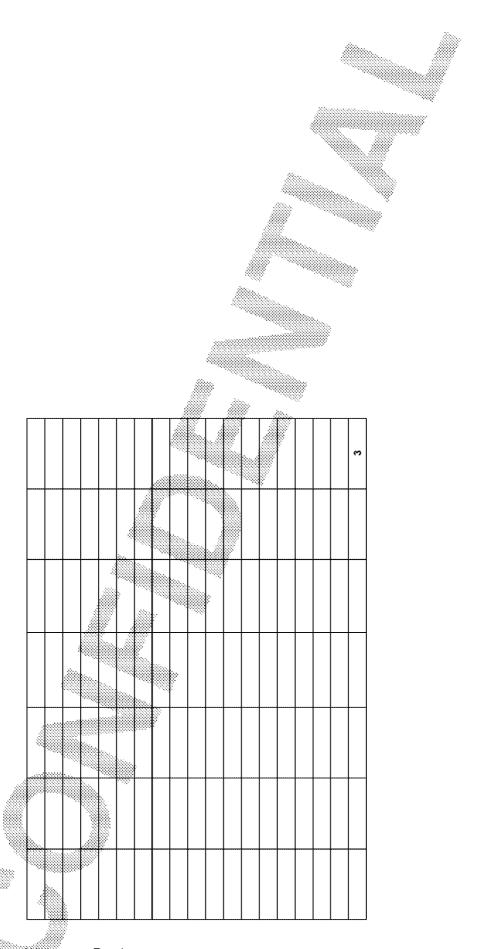

Subject to Protective Order - Williams v. Remington

	10000000	99999999 ₂₂								
Summ	any		est + Proof Failures	100						
			Total Rejected:	7						
		(Total Rejected: Overall Reject Rate:	7.00						
		Proof	Shot:	Size.			13	3		
		Proof	Rejected:	0	0	0	0	0	0	0
			Percent;	0.	880		0.0	0.0		
			Shot	s K	<i>888</i>					
		Test	Rejeptød:	Q.	0	O	0	0	0	0
			Percent:	G	0					
			Rejepted: Percent: Shot:							
		Target	Rejected:	0 💥	9/		0	0	0	0
		3	Percent:	0	Q	0	0			

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			************				X	
AB	Action binds		***************************************	<i></i>	9996			
BABS	Bulge at body shoulder		***************************************	***************************************				
BAC	Burr at chamber		***************************************					
BBMA	BBL-to-bolt misalignment				***		3000	
ВВ	Bolt binds/catches		***************************************					
BCOBS	Bolt catches on bolt stop							
BCOF	Bolt catches on follower						3700	
ВС	Blows cases		-					
BHR	Bolt hits receiver		-					****
BHS	Bolt plug hits safety switch		***************************************					
BLOP	Bar lock or disconnector out of position		311					
BLSO	Barrel lug shot off							
BPO	Bolt pulls out							
BSSM	Bolt stems shell in magazine		- Control of the Cont					
BWCD	Bolt won't cam down							

BWCFM

CD

Bolt won't close over full magazine

Case dented

	6/200000000								
FA	Fires automatically		Anna Anna Anna Anna Anna Anna Anna Anna						
FB	Follower binds		Part of the Control o						
FC	Fails to connect								
FCB	Fore-end cracked or broken		on and a second						
FD	Follows-down		Sec.						
FF	Fails to fire		W						
FFP	Flat firing pin								
FOS	Fires on safe								
FPHB	Firing pin hits bbl				**************************************				
FPHI	Firing pin hits inside rim								
FP0	Floor plate opens	***	//////////////////////////////////////		***	1000			
FPOH	Floor plate opens hard						Sec.		
FSR	Fires when safe is released		****						
FT	Follower tips	Anna	*******						
GCSO	Gas cyl shot off		-	1%					
HBL	Heavy bolt lift		-		× × × × × × × × × × × × × × × × × × ×				
HMSC	Heading mismatch-steps on case		-						
HPA	High pressure ammo								
HUR	Hard under rail		***************************************				**************************************		
JCS	Jumps cartridge		***************************************				į		
JM	Jumps magazin e		***************************************					******	ľ
JO	Jars off		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1						
LB	Light blow		***************************************						
MAH	Magazine assembles hard		***************************************						
MCW	Magazine capacity wrong								
MFA	Misfires (ammo)								
MFOP	Magazine follower out of position		-						

SRIC	Specific rings in chamber						_
SSOC	Surface scratches on case		Per la constante de la constan				
STC	Stems top chamber		***************************************				
SWE	Safety switch works too easily						
SWH	Safety switch works too hard		\$45.				
sww	Safety ewitxh wont work		***				
TD	Tips down						
TU	Tips up						
TWP	Trigger won't pull						
TWR	Trigger won't retract						
UNCN-T	Uncoded	***					
XH	Extracts hard					Sec.	

HI	High	Anna	***************************************				
LO	Low		***************************************	· **			
LEFT	Left				1900 B		
RIGHT	Right		***************************************				
DG	Doesn't Group						
FSST	Front sight tipped					***************************************	
RSTT	Rear sight tipped					á	
RSBR	Rear sight base raised						***************************************
FSTR	Front sight raised						
FSTL	Front sight loose		***************************************				
RSTL	Rear sight loose						
MGPT-G	Missing parts at target						
UNCN-G	Uncoded nonconformity at target						
	<u> </u>					 	

AI-P	Assembly incompleye at proof						
868	Barrel bracket stacked or broken at proof						
BC-P	Blows cases at proof		·				
BEB-P	BarreLextension broken at proof.		****				
BLP-P	Blanked primer at proof						
BLSO-P	Barrel lug shot off at proof						
BP-P	Blown primer at proof						
BS-P	Barrel split at proof						
DLOS-P	Doesn't lock over shells at proof						
ESB-P	Ejector sticks back at proof						
FCB-P	Fore-end cracked at proof	1					
FESO-P	Fore-end shot off at proof					Seo.	
FF-P	Fails to fire at proof		***************************************		****		
GCSO-P	Gas cylinder shot off at proof		************				
MSI-P	Magnaflux stamp illegible on bbl		-	***			
MSM-P	Magnaflux stamp missing on bbl		***************************************				
PP-P	Pierced primer at proof						
SCB-P	Stock cracked or broken at proof		***************************************				
UNCM-P	Uncoded proof malfunctions		-			****	
	·	_	_		•	3	300000 (6000000)

		****	////////	- 174 - 1860 - 1860 - 1860 - 1860 - 1860 - 1860 - 1860 - 1860 - 1860 - 1860 - 1860 - 1860 - 1860 - 1860 - 1860	3/3/38/7 ******	(88).
45				27	<i>*******</i> *****************************	72
0	0	0	0	O	0	0
0.0				27 0 2.0		0 0: 0
XR-100	7400	7500	7600	7615	Rimfire	totals
					***************************************	2000
					1	1


2						2
		i	i	I	1	I .

totals


0.0

7 7.0


0 0.0

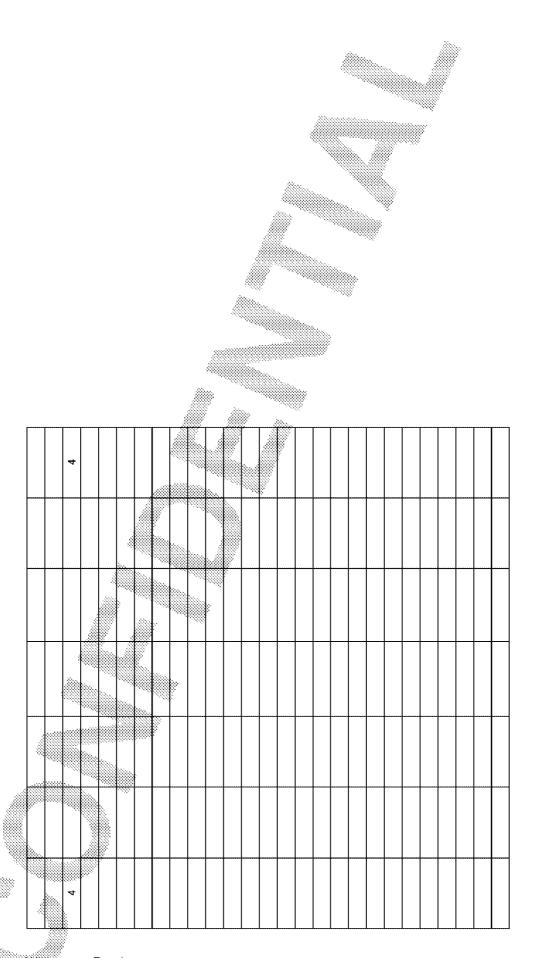



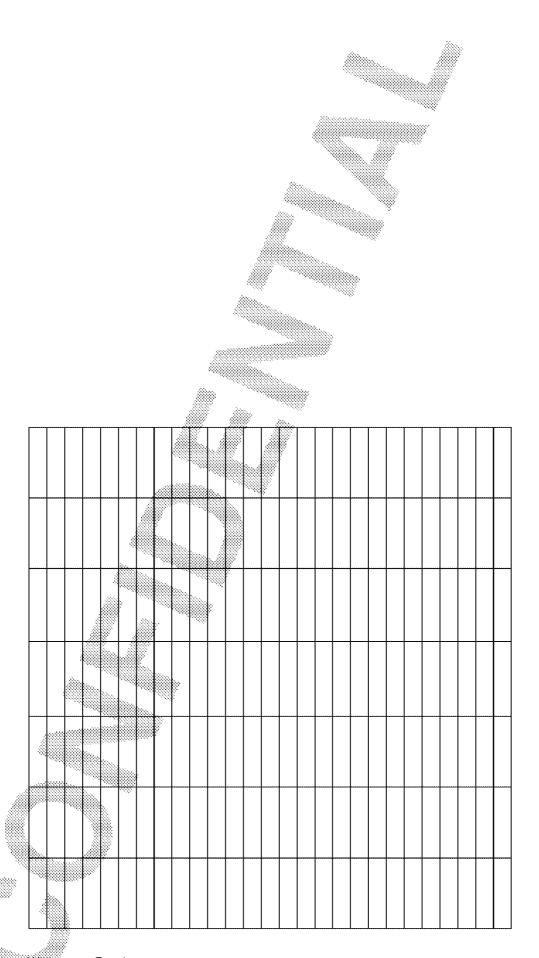



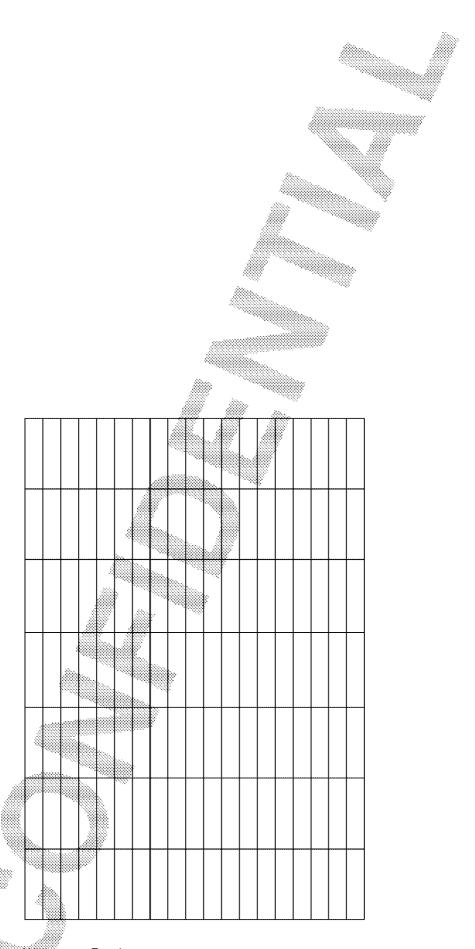

Subject to Protective Order - Williams v. Remington

	////	8a.								
Summ	ary To	otai Test i	Proof Failures	0						
		***	Total Rejected:	0						
		Over	Total Rejected: all Reject Rate:							
	Pro	of .	Shot: Rejected Percent Shot Rejected: Percent:							
	Pro	of	Rejected.	0	0	0	0	0	0	0
			Percent	0	\$350.					
			Shot.	See	<i>8000</i> 7					
	Tes	t ***	Reje cted :	O O	0	0	0	0	O	0
			Percent:	Q.	0					
			Shot: Rejected:	.88838	3000	1 1988 H	۸.			
	Tar	get		0 🧼	9/	O	0	0	O	0
		=	Percent:	0	9	Ü	0			
				7777777	2222222	3.273.232.	***************************************			


CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			************				X	
AB	Action binds							
BABS	Bulge at body shoulder		***************************************	***************************************				
BAC	Burr at chamber		***************************************					
BBMA	BBL-to-bolt misalignment				***			
ВВ	Bolt binds/catches		***************************************					
BCOBS	Bolt catches on bolt stop							
BCOF	Bolt catches on follower						3700	
ВС	Blows cases		-					
BHR	Bolt hits receiver							****
BHS	Bolt plug hits safety switch		***************************************					
BLOP	Bar lock or disconnector out of position		311					
BLSO	Barrel lug shot off							
BPO	Bolt pulls out							
BSSM	Bolt stems shell in magazine		- Control of the Cont					
BWCD	Bolt won't cam down							

1 300	1	1	1					
BWCFM	Bolt won't class over full magazine							
CD	Case dented							
СН	Closes hard							
CLM	Can't laod magazine							
СО	Cut-off							
CR	Cuts rim							
CS	Cases swell							
CTOG	Chamber tom or gouged	· · · · //						
CTP	Creepy trigger pull				800. 800.			
CWSB	Cams wrong side of action bar							
DBB	Doesn't blow back					<i>**</i>		
DCS	Double click in safety switch					***	Sec.	
DCT	Double click in trigger			11/11/4	***			
DCU	Doesn't close-up			***********				
DE	Doesn't eject			***				
DEL	Doesn't eject live round				(A)			
DFB	Doesn't feed back							
DFU	Doesn't feed up							
DLO	Doesn't lock open (after last shell)						******	
DLU	Doesn't lock-up						8	
DS	Dead safe							*****
DX	Doesn't extract							
DXL	Doesn't extract live round							
EDS	Extractor drops shell							
ESB	Ejector sticks back							
ESCR	Empty shell catches receiver							
ESS	Extractor stems shell							
		•						

ML	Magazine loose							
BALH	Magazine loads hard		***************************************					
MRH	Magazine removes hard	,.						
ОН	Opens hard		***************************************					
OR	Overandes		dus.					
PH	Pulls hard		- A.					
PSI	Proof stamp illegible							
PSM	Proof stamp missing	· · · · · ///						
RBOC	Rings and bulges on case							
RDW	(Action) release doesn't work							
RIC	Rings in chamber	*****			***	*		
RIS	Ring in sholder						Sec.	
RS	Rim srem							
SBC	Stems bottom chambers			***************************************				::::::::::::::::::::::::::::::::::::::
SBE	Stems bbl extension		-	77%				
SCB	Stock cracked or broken				*****			
SCX	Shell catches		7			******		
SHI	Short indent]
SI	Stems incline						****	
SIC	Stems in chamber						;	
SL	shaves lead		***************************************					
SLC	Stems left side of chamber							
SMOC	Stretch marks on case		-					
SOR	Stem over-ride		***************************************					
SP	Stems port							
SR	Shoulder rough							
SRC	Stems right side of chamber							

SRIC	Specific rin gs in chamber		ACT TO SERVICE AND ADDRESS OF THE SERVICE AND AD				
850C	Surface scratches on case		***************************************				
STC	Stems top chamber		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1				
SWE	Safety switch works too easily		VARIABLE				
SWH	Safety switch works too hard		\$20.				
sww	Safety ewitxh work		- XX				
TD	Tips down						
TU	Tips up						
TWP	Trigger won't pull						
TWR	Trigger won't retract						
UNCN-T	Uncoded	1 ***			1000		
хн	Extracts hard					Sec.	
			44440444	****			
HI	High						
LO	Low		***************************************				
LEFT	Left			**************************************			
RIGHT	Right		***************************************				
DG	Doesn't Group						
FSST	Front sight tipped					*****	
RSTT	Rear sight tipped		1			į	
RSBR	Rear sight base raised						
FSTR	Front sight raised						
FSTL	Front sight loose						
RSTL	Rear sight loose		***				
MGPT-G	Missing parts at target						
UNCN-G	Uncoded nonconformity at target						
			-				

1							
AI-P	Assembly incompleye at proof						
868	Barrel bracket gracked or broken at proof						
BC-P	Blows cases at proof		***************************************				
BEB-P	Barrel extension broken at proof		***				
BLP-P	Blanked primer at proof		\$40.				
BLSO-P	Barrel lug shot off at proof						
BP-P	Blown primer at proof						
BS-P	Barrel split at proof						
DLOS-P	Doesn't lock over shells at proof						
ESB-P	Ejector sticks back at proof						
FCB-P	Fore-end cracked at proof	1					
FESO-P	Fore-end shot off at proof					Sec.	
FF-P	Fails to fire at proof		***************************************				
GCSO-P	Gas cylinder shot off at proof		*************				
MSI-P	Magnaflux stamp illegible on bbl		***************************************	/%			
MSM-P	Magnaflux stamp missing on bbl		-		*****		
PP-P	Pierced primer at proof		-				
SCB-P	Stock cracked or broken at proof	-	**********				
UNCM-P	Uncoded proof malfunctions					******	
						· · · · · · · · · · · · · · · · · · ·	

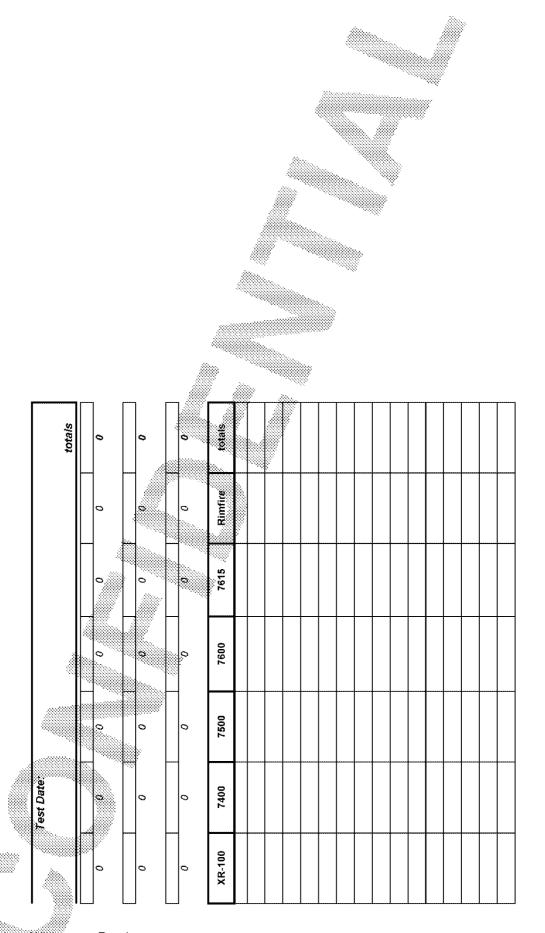


Subject to Protective Order - Williams v. Remington









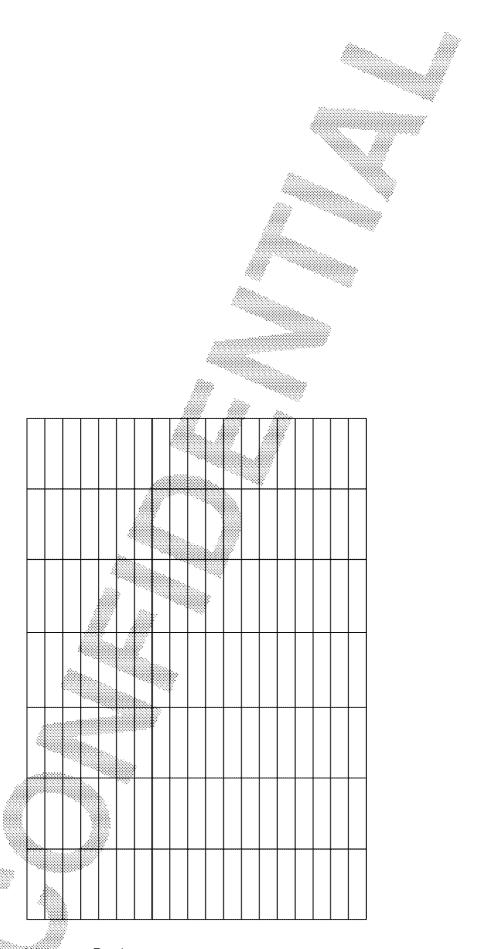

Subject to Protective Order - Williams v. Remington

	////										
Summa	ary			roof Failures	88	5					
			To	tal Rejected: Reject Rate:	61	!					
			Overall	Reject Rate:	6.89)					
				Shot: Rejected	294	***	2	392	4	182	13
	***************************************	Proof	### ##	Rejected	0	0	0	0	0	0	0
				Percent;	0 0:0	Ma.	0.0	0.0	0.0	0.0	0.0
		<i>#</i>		Shot.	246	235		246		70	
		Test	ř	Rejected:	9.	19	o 0	2	0	1	0
		,	200	Shot: Rejected: Percent: Shot: Rejected: Percent:	3.7	19 8.1		0.8		1.4	
				Shot:	23	(k) 2300	1 199	6		69	
		Target		Rejected:	0 💥	: ::: 0 ::	Ç	0	0	19	0
		3		Percent:	0. Q	0.0	Q	0 5.0		27.5	

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			********				X	
AB	Action binds		***************************************					
BABS	Bulge at body shoulder		***************************************					
BAC	Burr at chamber		***************************************					
BBMA	BBL-to-bolt misalignment		Martinos 6144		*****			
ВВ	Bolt binds/catches		**************************************		1	10000		
BCOBS	Bolt catches on bolt stop		***************************************					
BCOF	Bolt catches on follower		***************************************				****	
ВС	Blows cases		***************************************				2	
BHR	Bolt hits receiver		-					
BHS	Bolt plug hits safety switch		***************************************					
BLOP	Bar lock or disconnector out of position		***************************************					
BLSO	Barrel lug shot off		***************************************					
BPO	Bolt pulls out		***************************************					
BSSM	Bolt stems shell in magazine							
BWCD	Bolt won't cam down							

۲	ł
t	ŧ
	1
C)
c	•
⊢	1
H	1
	J
Ú	ī
Ē	1
đ	

BWCFM	Bolt won't close over full magazine	1	***************************************				
CD	Case dented		***************************************				
СН	Closes hard	.	2				
CLM	Can't laod magazine		2				
co	Cut-off		što.				
CR	Cuts rim						
CS	Cases swell						
CTOG	Chamber tom or gouged						
CTP	Creepy trigger pull						
CWSB	Cams wrong side of action bar						
DBB	Doesn't blow back	1					
DCS	Double click in safety switch					Sec.	
DCT	Double click in trigger		***				
DCU	Doesn't close-up		***************************************				
DE	Doesn't eject		1	132			
DEL	Doesn't eject live round				******		
DFB	Doesn't feed back		-				
DFU	Doesn't feed up						
DLO	Doesn't lock open (after last shell)		**********			*****	
DLU	Doesn't lock-up					;	
DS	Dead safe						
DX	Doesn't extract	1	***************************************				
DXL	Doesn't extract live round		***************************************				
EDS	Extractor drops shell		***			1	
ESB	Ejector sticks back						
ESCR	Empty shell catches receiver						
ESS	Extractor stems shell						

Fires automatically							
Follower binds							
Fails to connect		***************************************					
Fore-end cracked of broken		National Property and Property					
Folfows-down		Seco.					
Fails to fire							
Flat firing pin							
Fires on safe							
Firing pin hits bbl				*			
Firing pin hits inside rim							
Floor plate opens	4	1		***	11/1/11		
Floor plate opens hard						Sec.	
Fires when safe is released				***		<i>I</i>	
Follower tips		***************************************					
Gas cyl shot off		-	777				
Heavy bolt lift	1			*****			
Heading mismatch-steps on case							
High pressure ammo							
Hard under rail		***************************************				200 B	
Jumps cartridge						,	
Jumps magazine							
Jars off							
Light blow		-					
Magazine assembles hard							
Magazine capacity wrong							
Misfires (ammo)							
Magazine follower out of position							
	Follower binds Fails to connect Fore-end pracked or broken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (ammo)	Follower binds Fails to comect Fore-end cracked or broken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens 4 Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift 1 Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (ammo)	Follower binds Fails to connect Fore-end cracked of broken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (ammo)	Follower binds Fails to connect Fore-end cracked or broken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens 4 1 Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift 1 Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (ammo)	Follower bings Fails to connect Fore-end cracked or broken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens and Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (ammo)	Follower binds Fails to connect Fore-and gracked or proken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits bbl Firing pin hits inside rim Floor plate opens Floor plate opens Fires when safe is released Follower tips Gas cyl shot off Heavy bolt lift Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine assembles hard Magazine capacity wrong Misfires (armmo)	Follower binds Fails to connect Rore- and cracked or broken Follows-down Fails to fire Flat firing pin Fires on safe Firing pin hits ibbl Firing pin hits inside rim Floor plate opens 4 Floor plate opens 4 Floor plate opens hard Fires when safe is released Follower tips Gas cyl shot off Heavy bott lift 1 Heading mismatch-steps on case High pressure ammo Hard under rail Jumps cartridge Jumps magazine Jars off Light blow Magazine capacity wrong Misfires (ammo)

ML


Magazine loose

Magazine loads hard


SRIC	Specific rings in chamber						
SSOC	Surface scratches on case						
STC	Sterns top chamber	a.					
SWE	Satety switch works too easily						
SWH	Safety switch works too hard		4 200				
sww	Safety ewitxh work						
TD	Tips down						
TU	Tips up						
TWP	Trigger won't pull						
TWR	Trigger won't retract						
UNCN-T	Uncoded	***			***		
XH	Extracts hard					5a.	


HI	High			***//			**************************************
LO	Low			170			
LEFT	Left						
RIGHT	Right						
DG	Doesn't Group					19	
FSST	Front sight tipped					***************************************	
RSTT	Rear sight tipped					á	
RSBR	Rear sight base raised						
FSTR	Front sight raised						
FSTL	Front sight loose						
RSTL	Rear sight loose						
MGPT-G	Missing parts at target						
UNCN-G	Uncoded nonconformity at target						


18	30000000000000000000000000000000000000						
AI-P	Assembly incompleye at proof						
868	Barrel bracket gracked or broken at proof		**************************************				
BC-P	Blows cases at proof		440044100				
BEB-P	Barrel extension broken at proof		Managara anaka				
BLP-P	Blanked primer at proof						
BLSO-P	Barrel lug shot off at proof						
BP-P	Blown primer at proof						
BS-P	Barrel split at proof						
DLOS-P	Doesn't lock over shells at proof						
ESB-P	Ejector sticks back at proof						
FCB-P	Fore-end cracked at proof	1					
FESO-P	Fore-end shot off at proof					5ec.	
FF-P	Fails to fire at proof		***************************************				
GCSO-P	Gas cylinder shot off at proof		************				
MSI-P	Magnaflux stamp illegible on bbl		450445044	***			
MSM-P	Magnaflux stamp missing on bbl		***************************************		**************************************		
PP-P	Pierced primer at proof						
SCB-P	Stock cracked or broken at proof		-				
UNCM-P	Uncoded proof malfunctions		**************************************			*****	
·	_					ž.	

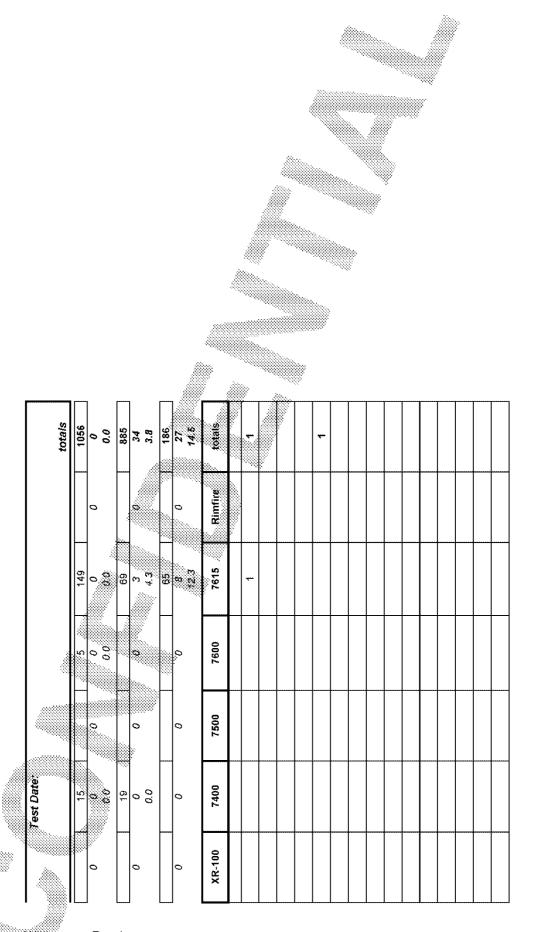



Subject to Protective Order - Williams v. Remington

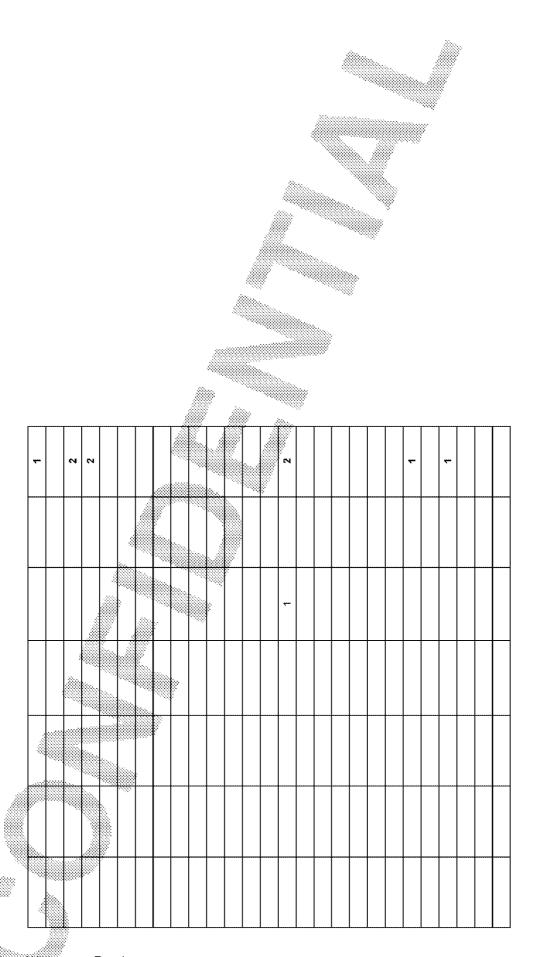

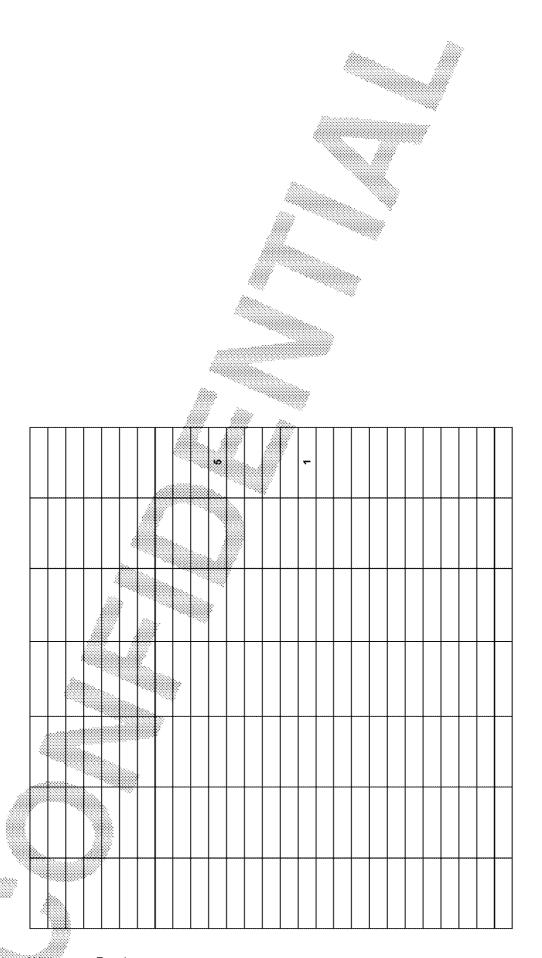

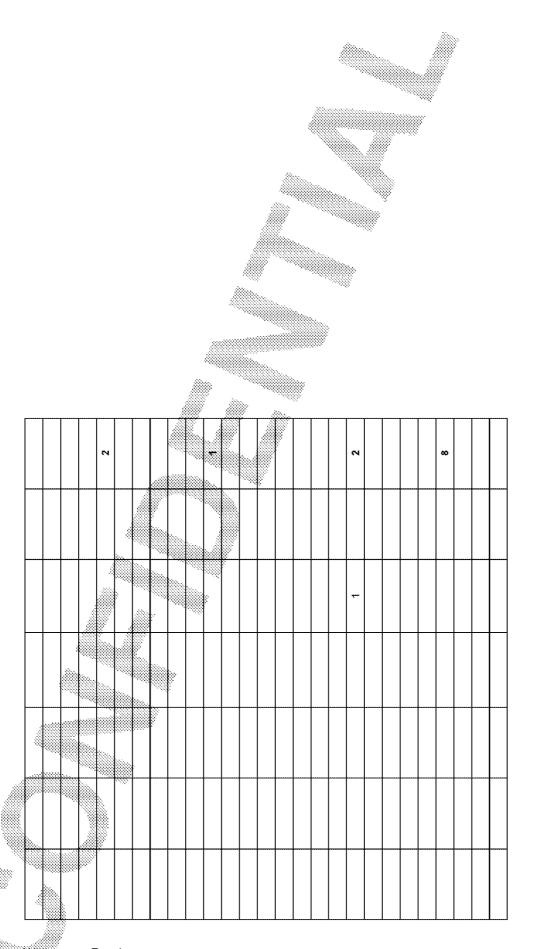

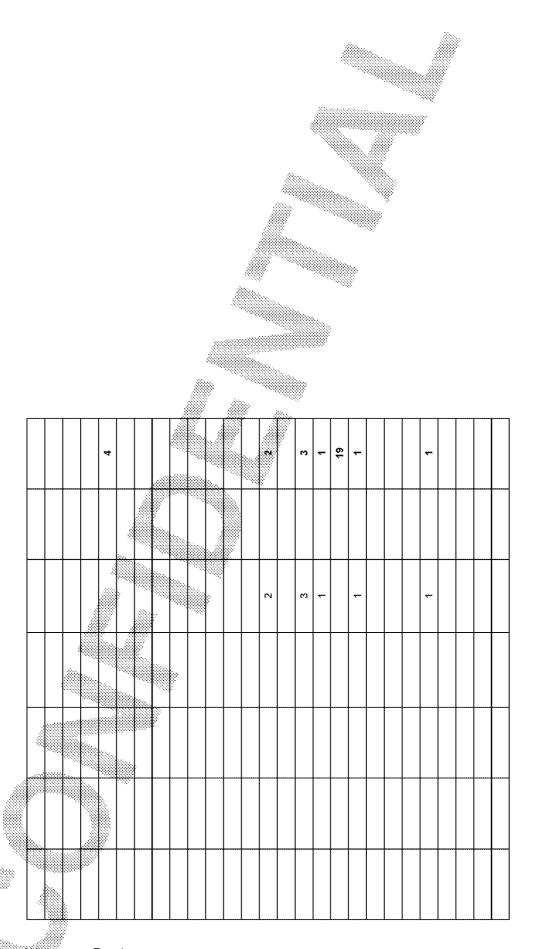

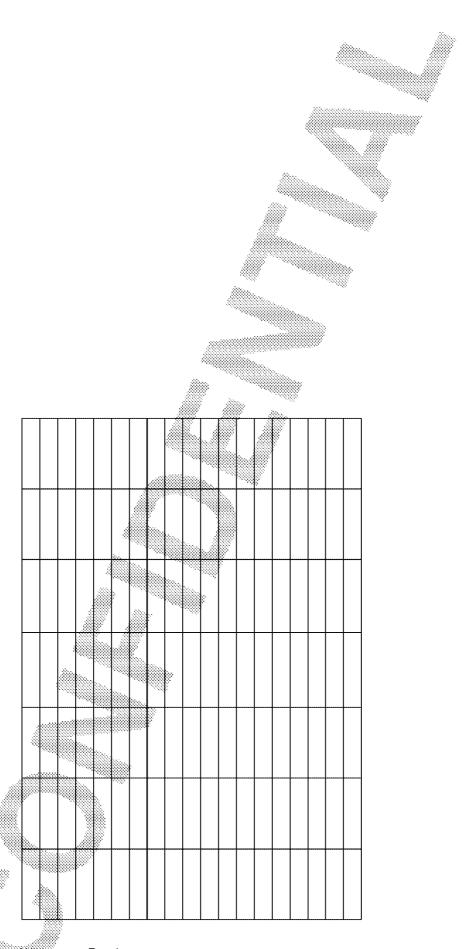

Subject to Protective Order - Williams v. Remington

	20000000											
Summa	ary			Proof Failures		33						
			<i></i>	otal Rejected:	1	04						
			Overa	otal Rejected: Ill Reject Rate:	12.	48						
		<i>.</i>		Shot: Rejected	167	3.		77	194		149	12
		Proof		Rejected:	0	2	•	0	0	0	2	0
				Percent.	0.0	6.	5	0.0	0.0		1.3	0.0
				Shot.	186	38	3	52	239		147	
		Test	¥.	Shot. Reje stød: Pergent:	11.	0		2	30	0	14	0
					5.9	0.	2	3.8	12.6		9.5	
				Shot:		3		5	11		147	
		Target		Rejected:	0 🐰	(4)		Ū	0	0	23	0
		3		Percent:	0.Q) 🦓	00	0 0. 0		15.6	

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$S	700 BDL & ADL	700 SS	700 CDL	700 POLICE	MODEL 7
			· *******				380.v	
AB	Action binds		***************************************	1111				
BABS	Bulge at body shoulder		***************************************					
BAC	Burr at chamber		Anna					
BBMA	BBL-to-bolt misalignment		MATTER STATE OF THE STATE OF TH		70000			
вв	Bolt binds/catches		***************************************		2	W//		
BCOBS	Bolt catches on bolt stop		***					
BCOF	Bolt catches on follower		***************************************				4	
вс	Blows cases		200				8	
BHR	Bolt hits receiver		***************************************					***//
BHS	Bolt plug hits safety switch		***					
BLOP	Bar lock or disconnector out of position		***************************************					
BLSO	Barrel lug shot off		****					
BPO	Bolt pulis out		-					
BSSM	Bolt stems shell in magazine							
BWCD	Bolt won't cam down			1				

BWCFM	Bolt won't close over full magazine						
CD	Case dented						
СН	Closes hard						
CLM	Can't laod magazine						
СО	Cut-off		žto.				
CR	Cuts rim						
CS	Cases swell						
CTOG	Chamber tom or gouged	• • •					
CTP	Creepy trigger pull				Militar.		
CWSB	Cams wrong side of action bar						
DBB	Doesn't blow back	***			***		
DCS	Double click in safety switch					Siau.	
DCT	Double click in trigger						
DCU	Doesn't close-up						
DE	Doesn't eject	1		****			
DEL	Doesn't eject live round	2		1			
DFB	Doesn't feed back						
DFU	Doesn't feed up						
DLO	Doesn't lock open (after last shell)					******	
DLU	Doesn't lock-up					ž.	
DS	Dead safe						
DX	Doesn't extract						
DXL	Doesn't extract live round						
EDS	Extractor drops shell					10	
ESB	Ejector sticks back						
ESCR	Empty shell catches receiver						
ESS	Extractor stems shell						

FA	Fires automatically					
FB	Follower bin ds					
FC	Fails to comect					
FCB	Fore-end cracked or broken					
FD	Folfows-down		šta.			
FF	Fails to fire					
FFP	Flat firing pin					
FOS	Fires on safe					
FPHB	Firing pin hits bbl					
FPHI	Firing pin hits inside rim					
FP0	Floor plate opens	***				
FPOH	Floor plate opens hard				Sec.	
FSR	Fires when safe is released					
FT	Follower tips					
GCSO	Gas cyl shot off					
HBL	Heavy bolt lift			*******		
HMSC	Heading mismatch-steps on case					
HPA	High pressure ammo					
HUR	Hard under rail				**************************************	
JCS	Jumps cartridge				8	
JM	Jumps magazin e					
10	Jars off					
LB	Light blow					
MAH	Magazine assembles hard					
MCW	Magazine capacity wrong					
MFA	Misfires (ammo)					
MFOP	Magazine follower out of position					

		ı		
ŀ		i		
ŀ		į		
)		
Ĺ)		
۲		1		
ŀ	_	•		
•		J		
Ļ)			
۶	7	•		
Ł		ı	_	

99299900000000000000000000000000000000							
Magazine logsé							
Magazine loads hard		***************************************					
Magazine removes hard		***************************************					
Opens hard		***************************************					
Over-indes		- Sec.		1			
Pulls hard							
Proof stamp illegible							
Proof stamp missing							
Rings and bulges on case							
(Action) release doesn't work							
Rings in chamber	4			14			
Ring in sholder				13		330.	
Rim srem		***************************************		****			
Stems bottom chambers							
Stems bbl extension		*******	***				
Stock cracked or broken				*****			
Shell catches							
Short indent		-					
Stems incline		***************************************				2006	
Stems in chamber		***************************************				į.	
shaves lead		MARKA MA					******
Stems left side of chamber							
Stretch marks on case		***************************************					
Stem over-ride	2						
Stems port							
Shoulder rough							
Stems right side of chamber		-					
	Magazine loads hard Magazine removes hard Opens hard Over-rides Pulls hard Proof stamp illegible Proof stamp missing Rings and bulges on case (Action) release doesn't work Rings in chamber Ring in sholder Rim srem Stems bottom chambers Stems bbl extension Stock cracked or broken Shell catches Short indent Stems in chamber shaves lead Stems left side of chamber Stems port Stems port Shoulder rough	Magazine loads:hard Magazine removes hard Opens hard Over-rides Pulls hard Proof stamp illegible Proof stamp missing Rings and bulges on case (Action) release doesn't work Rings in chamber Ring sin sholder Rim srem Stems bottom chambers Stems bbl extension Stock cracked or broken Shell catches Short indent Stems in chamber Stems in chamber Stems in chamber Stems in chamber Stems jincline Stems in chamber Stems left side of chamber Stretch marks on case Stem over-ride Stems port Shoulder rough	Magazine loads hard Magazine removes hard Opens hard Over-rides Pulls hard Proof stamp illegible Proof stamp missing Rings and bulges on case (Action) release doesn't work Rings in chamber Ring in sholder Rim srem Stems bottom chambers Stems bbl extension Stock cracked or broken Shell catches Short indent Stems in chamber stams lead Stems left side of chamber Stems over-ride Stems port Shoulder rough	Magazine loads hard Magazine removes hard Opens hard Opens hard Over-rides Pulls hard Proof stamp illegible Proof stamp missing Rings and bulges on case (Action) release doesn't work Rings in chamber Ring in sholder Rim srem Stems bottom chambers Stems bottom chambers Stems bbl extension Stock cracked or broken Shell catches Short indent Stems in chamber stems in chamber Stems lead Stems left side of chamber Stretch marks on case Stems port Shoulder rough	Magazine loads hard Magazine removes hard Opens hard Over-rides 1 Pulls hard Proof stamp illegible Proof stamp missing Rings and bulges on case (Action) release doesn't work Rings in chamber 4 Ring in sholder Rim srem Stems bottom chambers Stems bott extension Stock cracked or broken Shell catches Short indent Stems in chamber Stems on case Stems left side of chamber Stretch marks on case Stem over-ride 2 Stems port Shoulder rough	Magazine loads land Magazine loads land Magazine perpoves hard Opens hard Opens hard Over-indes 1 Pulls hard Proof stamp illegible Proof stamp missing Rings and bulges on case (Action) release doesn't work Rings in chamber 4 Ring in sholder Rism srem Stems bottom chambers Stems bottom chambers Stems bottom chambers Stems bot extension Stock cracked or broken Short indent Stems in chamber Stems in chamber Stems in chamber Stems lead Stems lead Stems lead Stems lead Stems left side of chamber Stretch marks on case Stem sport Stems port Shoulder rough	Magazine loads hard Magazine loads hard Magazine semoves hard Opens hard Opens hard Opens hard Proof stamp illegible Proof stamp missing Rings and bulges on case (Action) release doesn't work Rings in chamber 4 14 Ring in sholder Rins sem Stems bottom chambers Stems bottom chambers Stems bottom chambers Short indent Stems in chamber Stems in ch


SRIC	Specific rings in chamber						
350C	Surface scratches on case						
STC	Stems top chamber		***************************************				
SWE	Safety switch works too easily		VANDETHINA				
SWH	Safety switch works too hard	2	\$20.				
sww	Safety ewitxh wont work						
TD	Tips down						
TU	Tips up	· · · · ///					
TWP	Trigger won't pull						
TWR	Trigger won't retract						
UNCN-T	Uncoded	***					
ХH	Extracts hard					Sec.	
				<i>III</i>	***		
HI	High		***************************************				
LO	Low		*******	100			
LEFT	Left				1900 B		
RIGHT	Right						
DG	Doesn't Group		***************************************			23	
FSST	Front sight tipped					**************************************	
RSTT	Rear sight tipped		-			á	
RSBR	Rear sight base raised		***************************************				
FSTR	Front sight raised						
FSTL	Front sight loose		***************************************				
RSTL	Rear sight loose						
MGPT-G	Missing parts at target						
UNCN-G	Uncoded nonconformity at target						
	•						

AI-P	Assembly incompleye at proof						
868	Barrel bracket gracked or broken at proof						
BC-P	Blows cases at proof						
BEB-P	Barrel extension broken at proof						
BLP-P	Blanked primer at proof		átta.				
BLSO-P	Barrel lug shot off at proof						
BP-P	Blown primer at proof						
BS-P	Barrel split at proof	***					
DLOS-P	Doesn't lock over shells at proof				*** *********************************		
ESB-P	Ejector sticks back at proof						
FCB-P	Fore-end cracked at proof	****					
FESO-P	Fore-end shot off at proof					Sec.	
FF-P	Fails to fire at proof						
GCSO-P	Gas cylinder shot off at proof			***///			****
MSI-P	Magnaflux stamp illegible on bbl			1760			
MSM-P	Magnaflux stamp missing on bbl				******		
PP-P	Pierced primer at proof						
SCB-P	Stock cracked or broken at proof						
UNCM-P	Uncoded proof malfunctions		2			2	


	98800 PP PP 98800 A					
	Test Date:		- Miles			totals
24	l. ////		50	42		746
0	0	0	1	0	0	5
0.0			2.0	0.0	_	0.7
10			155		V2.	828
0	0	0	3	8	0	68
0.0			1.9			8.2
10			⊘ ⊗3	104		301
0	0	0	0	8	O	31
0.0			0.0	37		10.3
XR-100	7400	7500	7600	7615	Rimfire	totals


XR-100	7400	7500	7600	7615	Rimfire	totals
						/////
				2		2


			1			1
						2
						4
						1

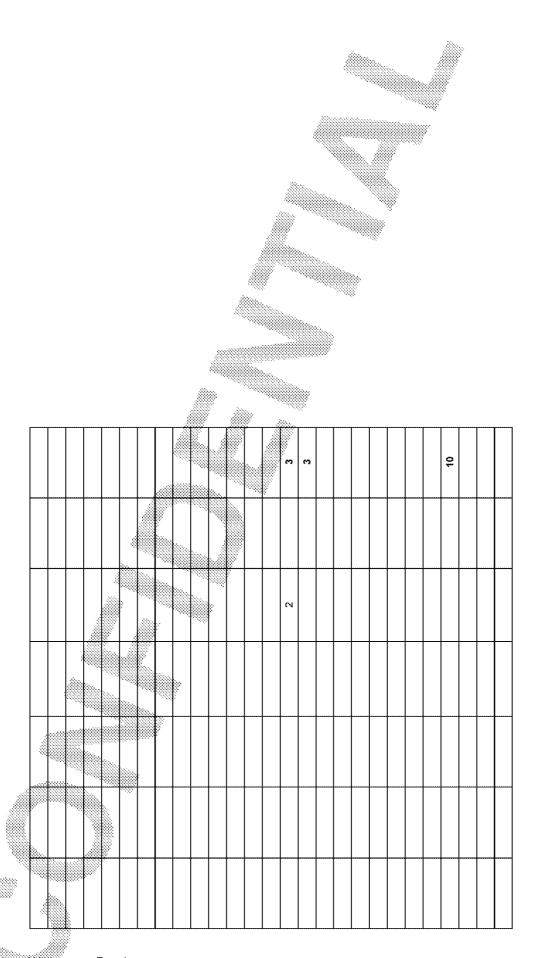



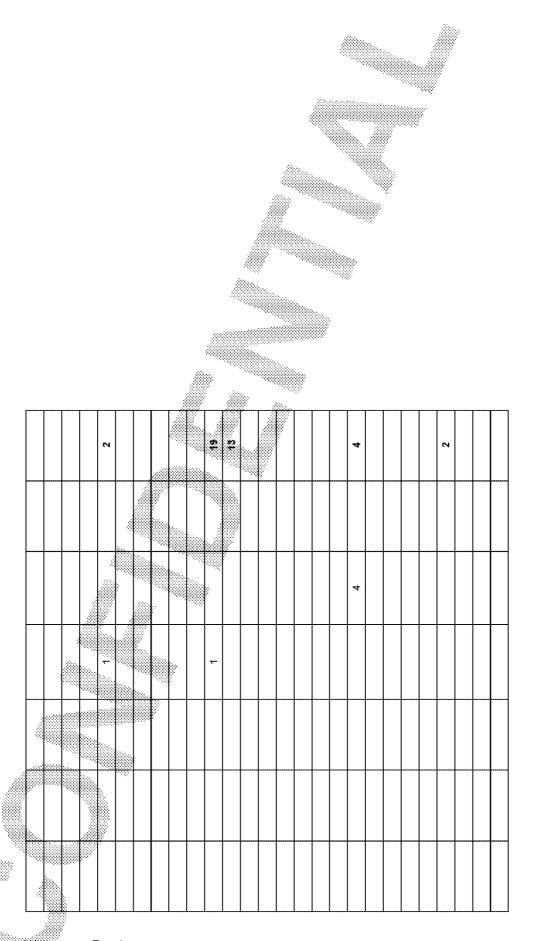

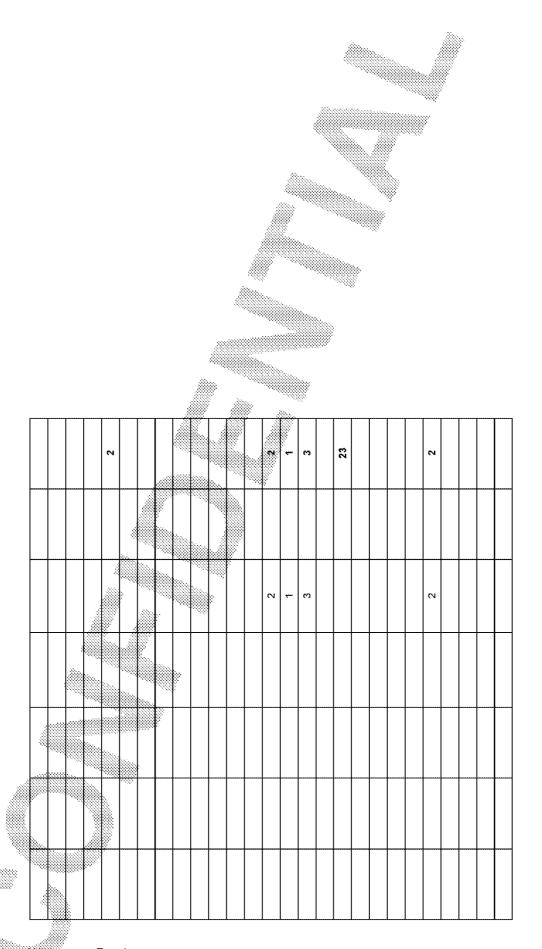

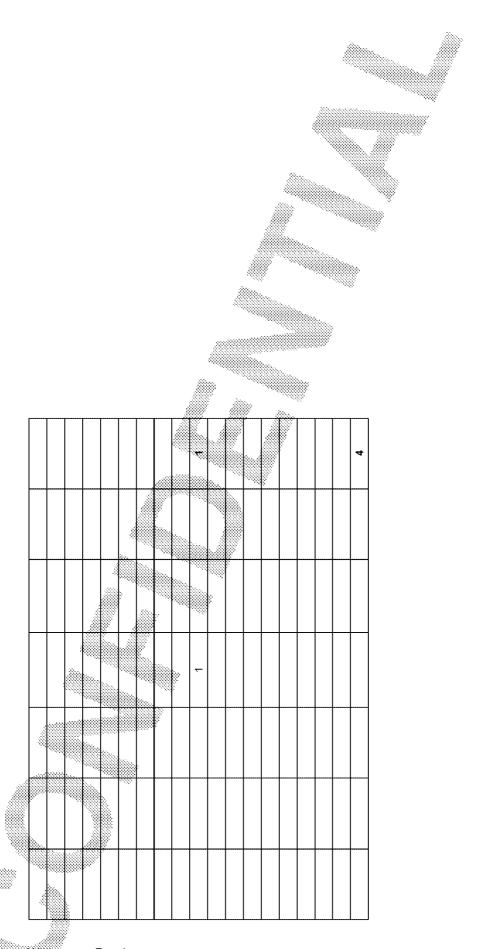

Subject to Protective Order - Williams v. Remington

Summa	ary Tota	Test + Proof Failures							
		Total Rejected:	0						
		Total Rejected: Overall Reject Rate:							
	Proof	Shot Rejected: Percent: Shot Rejected:							
	Proof	Rejected	0	0	0	0	0	0	0
		Percent:		Wa.					
		Shot.	I	300F					
	Test	Reje çted :	O.	0	O	0	0	0	0
		Percent:							
		SHOL			I 1888	<i>b</i> .			
	Target	Rejected:	0	9 /	O C	0	0	0	0
	-	Percent:							
	7631	Percent: Shot:	<i>a</i>	O Q	0	0			0

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			************				X	
AB	Action binds							
BABS	Bulge at body shoulder		***************************************	***************************************				
BAC	Burr at chamber		***************************************					
ВВМА	BBL-to-bolt misalignment				***			
ВВ	Bolt binds/catches		***************************************				***	
BCOBS	Bolt catches on bolt stop							
BCOF	Bolt catches on follower						****	
ВС	Blows cases		-					
BHR	Bolt hits receiver		-					****
BHS	Bolt plug hits safety switch		***************************************					
BLOP	Bar lock or disconnector out of position		311					
BLSO	Barrel lug shot off							
BPO	Bolt pulls out							
BSSM	Bolt stems shell in magazine		- Control of the Cont					
BWCD	Bolt won't cam down							

BWCFM

CD

СН

CLM

CO

CS

Bolt won't close over full magazine

Case dented

Closes hard Can't laod magazine

Cut-off

Cuts rim


Cases swell

FA	Fires automatically							
FB	Follower binds							
FC	Fails to comect							
FCB	Fore-end cracked or broken							
FD	Follows-down		\$to.					
FF	Fails to fire		<i>-</i>					
FFP	Flat firing pin							
FOS	Fires on safe							
FPHB	Firing pin hits bbl				800. 800////2000			
FPHI	Firing pin hits inside rim							
FPO	Floor plate opens	****						
FPOH	Floor plate opens hard					Seo.		
FSR	Fires when safe is released							
FT	Follower tips							
GCSO	Gas cyl shot off			***				
HBL	Heavy bolt lift							
HMSC	Heading mismatch-steps on case							
HPA	High pressure ammo							
HUR	Hard under rail					*****		
JCS	Jumps cartridge					ž.		
JM	Jumps magazin e						***************************************	ľ
JO	Jars off							
LB	Light blow							
MAH	Magazine assembles hard							
MCW	Magazine capacity wrong							
MFA	Misfires (ammo)							
MFOP	Magazine follower out of position							

			1					
ML	Magazine lööse							
MLH	Magazine loads hard		***************************************					
MRH	Magazine removes hard		***************************************					
ОН	Opens hard		VARIABLE					
OR	Overandes		\$20.					
PH	Pulls hard		- A.					
PSI	Proof stamp illegible							
PSM	Proof starnp missing							
RBOC	Rings and bulges on case							
RDW	(Action) release doesn't work							
RIC	Rings in chamber	***			***	11/11		
RIS	Ring in sholder						Sec.	
RS	Rim srem				****			
SBC	Stems bottom chambers			***************************************	.			
SBE	Stems bbl extension		-	2.3				
SCB	Stock cracked or broken				**************************************			
scx	Shell catches							
SHI	Short indent							
SI	Stems incline						2004	
SIC	Stems in chamber						,	
SL	shaves lead							
SLC	Stems left side of chamber		-					
SMOC	Stretch marks on case		***************************************					
SOR	Stem over-ride							
SP	Stems port							
SR	Shoulder rough							
SRC	Stems right side of chamber		-					

- 18	200000000 2000000						
SRIC	Specific rin gs in chamber						
SSOC	Surface scratches on case	***************************************					
STC	Stems top chamber	 ***					
SWE	Safety switch works too easily	***************************************					
SWH	Safety switch works too hard	áva.					
sww	Safety ewitxh work	- X					
TD	Tips down						
TU	Tips up						
TWP	Trigger won't pull			**************************************			
TWR	Trigger won't retract						
UNCN-T	Uncoded	// Was		***			
XH	Extracts hard	****			***	55c.	
HI	High	-					*** *********************************
LO	Low	-	178				
LEFT	Left			*******			
RIGHT	Right				1000		
DG	Doesn't Group						
FSST	Front sight tipped					2004	
RSTT	Rear sight tipped	***************************************					
RSBR	Rear sight base raised	-					***//
FSTR	Front sight raised						
FSTL	Front sight loose	***************************************					
RSTL	Rear sight loose						
MGPT-G	Missing parts at target	-					
UNCN-G	Uncoded nonconformity at target						

AI-P	Assembly incompleye at proof		***************************************				
868	Barrel bracket gracked or broken at proof		**************************************				
BC-P	Blows cases at proof		440044100				
BEB-P	Barrel extension broken at proof.		MANAGEMAN				
BLP-P	Blanked primer at proof						
BLSO-P	Barrel lug shot off at proof						
BP-P	Blown primer at proof						
BS-P	Barrel split at proof						
DLOS-P	Doesn't lock over shells at proof						
ESB-P	Ejector sticks back at proof						
FCB-P	Fore-end cracked at proof	***					
FESO-P	Fore-end shot off at proof					Sec.	
FF-P	Fails to fire at proof		***************************************				
GCSO-P	Gas cylinder shot off at proof		***********				
MSI-P	Magnaflux stamp illegible on bbl		450445044	***			
MSM-P	Magnaflux stamp missing on bbl		***************************************		*******		
PP-P	Pierced primer at proof						
SCB-P	Stock cracked or broken at proof		-				
UNCM-P	Uncoded proof malfunctions		***************************************			****	
				_			

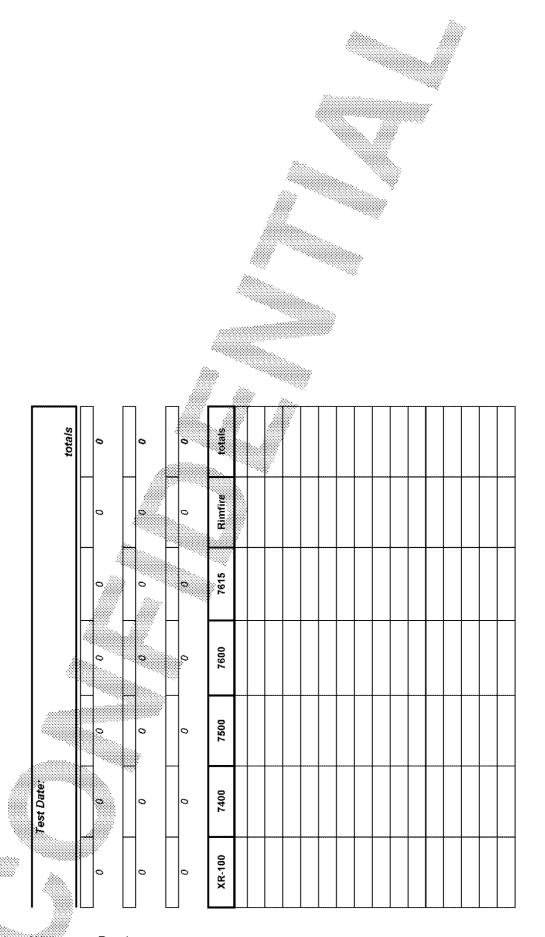


Subject to Protective Order - Williams v. Remington









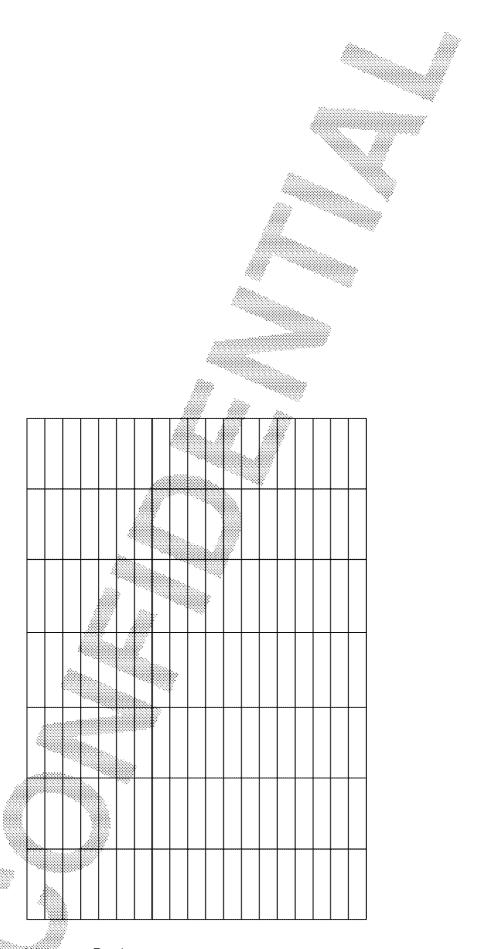

Subject to Protective Order - Williams v. Remington

	10000000	~???????									
Summa	ary	Total	Test + Pro	of Failures	o						
			Tota	l Rejected:	0						
			Overall R	of Failures I Rejected: leject Rate:							
		<i>A</i>		Shot: Rejected: Percent: Shot:		-					
	******	Proof		Rejected:	0	0	0	0	0	0	0
				Percent,	o	dese.					
				Shot:		L000000F					
		Test	Y	Reje cted :	G.	0	O	0	0	0	0
				Percent:		0					
				SHOL		k	100000	4.			
		Target		Reječted:	0	•	O	0	0	0	0
		•		Percent:							

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			***********				X	
AB	Action binds		***************************************	1///				
BABS	Bulge at body shoulder		***************************************					
BAC	Burr at chamber		***************************************					
BBMA	BBL-to-bolt misalignment				****			
ВВ	Bolt binds/catches		***************************************					
BCOBS	Bolt catches on bolt stop							
BCOF	Bolt catches on follower						****	
ВС	Blows cases		-				8	
BHR	Bolt hits receiver		-					*****
BHS	Bolt plug hits safety switch		***************************************					
BLOP	Bar lock or disconnector out of position		***************************************					
BLSO	Barrel lug shot off							
BPO	Bolt pulls out		State of the state					
BSSM	Bolt stems shell in magazine		- Control Control					
BWCD	Bolt won't cam down							

BWCFM

CD

Bolt won't close over full magazine

Case dented


۱	┥
۱	TT.FIOO11
ŀ	_
l	-]
Ć	D
ì	₹
١	_
ŀ	
L	_1
	J
Ĺ	Л
l	Л
I	زر

FA	Fires automatically					
FB	Follower binds					
FC	Fails to comect	 ***************************************				
FCB	Fore-end cracked or broken					
FD	Follows-down	\$46.				
FF	Fails to fire					
FFP	Flat firing pin					
FOS	Fires on safe					
FPHB	Firing pin hits bbl					
FPHI	Firing pin hits inside rim					
FPO	Floor plate opens			***		
FPOH	Floor plate opens hard				Stv.	
FSR	Fires when safe is released	***************************************				
FT	Follower tips	***************************************	***************************************			*****
GCSO	Gas cyl shot off	***************************************				
HBL	Heavy bolt lift			**************************************		
HMSC	Heading mismatch-steps on case	***************************************				
HPA	High pressure ammo					
HUR	Hard under rail				*****	
JCS	Jumps cartridge				ž.	
JM	Jumps magazin e					
JO	Jars off					
LB	Light blow	***************************************				
MAH	Magazine assembles hard					
MCW	Magazine capacity wrong	Name of the last o				
MFA	Misfires (ammo)					
MFOP	Magazine follower out of position					

ML.

SRIC	Specific rings in chamber				
8600	Surface scratches on case				
STC	Stems top chamber				
SWE	Safety switch works too easily				
SWH	Safety switch works too hard	žto.			
sww	Safety ewitxh won't work				
TD	Tips down				
TU	Tips up				
TWP	Trigger won't pull				
TWR	Trigger won't retract				
UNCN-T	Uncoded				
XH	Extracts hard			Seo.	
HI	High				
LO	Low				
LEFT	Left		*******		
RIGHT	Right				
DG	Doesn't Group				
FSST	Front sight tipped			*****	
RSTT	Rear sight tipped			18	
RSBR	Rear sight base raised				
FSTR	Front sight raised				
FSTL	Front sight loose				
RSTL	Rear sight loose				
MGPT-G	Missing parts at target				
UNCN-G	Uncoded nonconformity at target				

AI-P	Assembly incompleye at proof							
868	Barrel bracket cracked or broken at proof							
BC-P	Blows cases at proof		Antonia					
BEB-P	Barrel extension broken at proof		Managara anaka					
BLP-P	Blanked primer at proof		áva.					
BLSO-P	Barrel lug shot off at proof							
BP-P	Blown primer at proof							
BS-P	Barrel split at proof	· · · · //						
DLOS-P	Doesn't lock over shells at proof				**************************************			
ESB-P	Ejector sticks back at proof							
FCB-P	Fore-end cracked at proof	***				1000		
FESO-P	Fore-end shot off at proof						Sec.	
FF-P	Fails to fire at proof	-	-					
GCSO-P	Gas cylinder shot off at proof		************					
MSI-P	Magnaflux stamp illegible on bbl		4.00	***				
MSM-P	Magnaflux stamp missing on bbl		-		******			
PP-P	Pierced primer at proof		***************************************					
SCB-P	Stock cracked or broken at proof		-					
UNCM-P	Uncoded proof malfunctions		***************************************				2000	

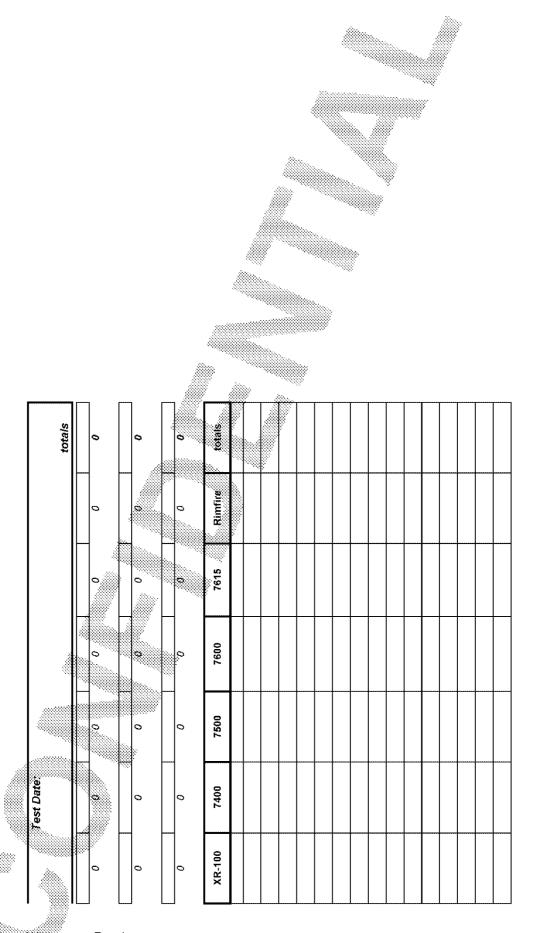


Subject to Protective Order - Williams v. Remington









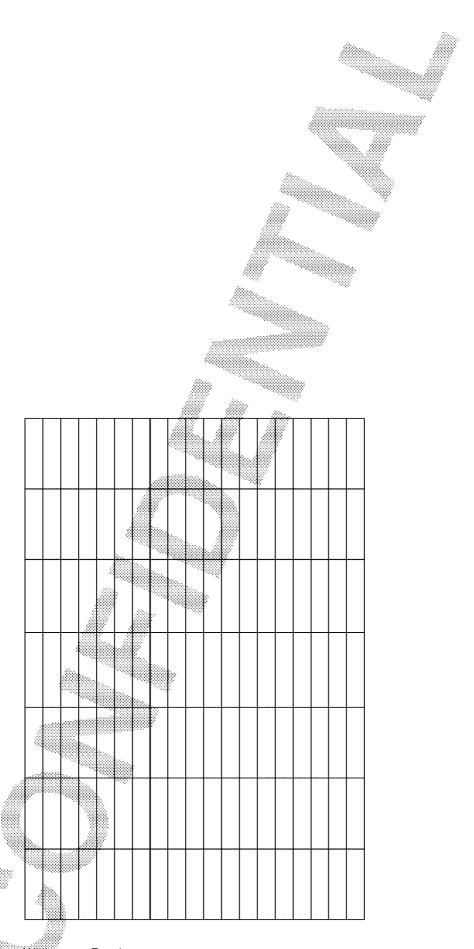

Subject to Protective Order - Williams v. Remington

	///////////////////////////////////////	988									
Summa	ny	Total	Test + Proof	Failures	0						
			Total F	Rejected:	0						
			Test + Proof Total F Overall Rej	ect Rate:							
	ı			20000000	\$\$\$\$\$.						
	ı	Proof		Rejected	0	0	0	0	0	0	0
				Percent:	0						
				Shot.		##					
	7	Test		Rejected:	a.	0	0	0	0	Đ	0
				Percent:	a	0					
			1750	Shot:							
	7	Target		Reje cted Percent: Shot: Rejected:	0 ///	9	,	0	0	0	0
	-	3-1		Percent:	0	9	Ö	0			

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			***********				X	
AB	Action binds		***************************************	1///				
BABS	Bulge at body shoulder		***************************************					
BAC	Burr at chamber		***************************************					
BBMA	BBL-to-bolt misalignment				****			
ВВ	Bolt binds/catches		***************************************					
BCOBS	Bolt catches on bolt stop							
BCOF	Bolt catches on follower						****	
ВС	Blows cases		-				8	
BHR	Bolt hits receiver							*****
BHS	Bolt plug hits safety switch		***************************************					
BLOP	Bar lock or disconnector out of position		***************************************					
BLSO	Barrel lug shot off							
BPO	Bolt pulls out		State of the state					
BSSM	Bolt stems shell in magazine		- Control Control					
BWCD	Bolt won't cam down							

BWCFM

Bolt won't close over full magazine


	ot vocace vocace :							1	1
CD	Case dented								1
CH	Closes hard		***************************************						1
CLM	Can't laod magazine								1
СО	Cut-off		dus.						1
CR	Cuts rim								1
cs	Cases swell								1
стоб	Chamber tom or gouged								1
CTP	Creepy trigger pull				*				1
CWSB	Cams wrong side of action bar								
DBB	Doesn't blow back	***				<i>1</i> ////////////////////////////////////			1
DCS	Double click in safety switch						Sec.]
DCT	Double click in trigger		***************************************		****				
DCU	Doesn't close-up		***************************************						
DE	Doesn't eject		***************************************	· **					
DEL	Doesn't eject live round				**************************************				1
DFB	Doesn't feed back		***************************************] .
DFU	Doesn't feed up]@
DLO	Doesn't lock open (after last shell)						*****		
DLU	Doesn't lock-up						,		
DS	Dead safe							***///]**
DX	Doesn't extract		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1						
DXL	Doesn't extract live round								
EDS	Extractor drops shell		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1						
ESB	Ejector sticks back		No. of Contract of						
ESCR	Empty shell catches receiver								
ESS	Extractor stems shell								1

FA	Fires automatically					
FB	Follower bin ds					
FC	Fails to comect					
FCB	Fore-end cracked or broken					
FD	Folfows-down		šta.			
FF	Fails to fire					
FFP	Flat firing pin					
FOS	Fires on safe					
FPHB	Firing pin hits bbl					
FPHI	Firing pin hits inside rim					
FP0	Floor plate opens	***				
FPOH	Floor plate opens hard				Sec.	
FSR	Fires when safe is released					
FT	Follower tips					
GCSO	Gas cyl shot off					
HBL	Heavy bolt lift			*******		
HMSC	Heading mismatch-steps on case					
HPA	High pressure ammo					
HUR	Hard under rail				**************************************	
JCS	Jumps cartridge				8	
JM	Jumps magazin e					
10	Jars off					
LB	Light blow					
MAH	Magazine assembles hard					
MCW	Magazine capacity wrong					
MFA	Misfires (ammo)					
MFOP	Magazine follower out of position					


ML	Magazine lööse						
MLH	Magazine loads hard		**************************************				
MRH	Magazine removes hard		***************************************				
ОН	Opens hard						
OR	Over-ndes		244.				
PH	Pulls hard						
PSI	Proof stamp illegible						
PSM	Proof stamp missing						
RBOC	Rings and bulges on case						
RDW	(Action) release doesn't work						
RIC	Rings in chamber						
RIS	Ring in sholder					Sec.	
RS	Rim srem		***************************************				
SBC	Stems bottom chambers		*************				
SBE	Stems bbl extension		-	· **			
SCB	Stock cracked or broken		-		*******		
SCX	Shell catches		-				
SHI	Short indent						
SI	Stems incline		***************************************			******	
SIC	Stems in chamber		***************************************			ž.	
SL	shaves lead		***************************************				***************************************
SLC	Stems left side of chamber		***********				
SMOC	Stretch marks on case		***************************************				
SOR	Stem over-ride		***************************************				
SP	Stems port		***				
SR	Shoulder rough		***************************************				
SRC	Stems right side of chamber	-	-				

Specific rings in chamber							
Surface scratches on case		Personal Control of Co					
Stems top chamber		A-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1					
Safety switch works too easily		VARIABLE					
Safety switch works too hard		\$45.					
Safety ewitxh work							
Tips down							
t the rth							
Trigger won't pull							
Trigger won't retract							
Uncoded	****						
Extracts hard						5ec.	
		***************************************		883			
High		***************************************					
Low		***************************************	***				
Left				19.000 m			
Right							
Doesn't Group							
Front sight tipped						**************************************	
Rear sight tipped	-	***************************************				;	
Rear sight base raised							
Front sight raised		A					
Front sight loose		***************************************					
Rear sight loose							
Missing parts at target		***************************************					
Uncoded nonconformity at target							
		-					
	Surface scratches on case Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewitxh work work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight toose Rear sight loose Missing parts at target	Surface scrattches on gase Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewitxh work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scrattches on base Sterns top chamber Safety switch works too easily Safety switch works too hard Safety ewitxh work! work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scratches on gase Stems top chamber Safety switch works too easily Safety switch works too hard Safety ewitxh work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight base raised Front sight loose Missing parts at target	Surface scratches on base Stems top shapeher Safety switch works too easily Safety switch works foo easily Safety switch works foo hard Safety ewitch work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scrattches on asse Stems top chamber Safety switch works too easily Safety switch works foo hard Safety ewitch work foo hard Safety ewitch work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight base raised Front sight loose Rear sight loose Missing parts at target	Surface scratches on dase Stems top chamber Safety switch works too easily Safety switch works too easily Safety switch works too hard Safety ewitxh weat work Tips down Tips up Trigger won't pull Trigger won't retract Uncoded Extracts hard High Low Left Right Doesn't Group Front sight tipped Rear sight toped Rear sight tose Rear sight loose Rear sight loose Missing parts at target

18	30000000000000000000000000000000000000						
AI-P	Assembly incompleye at proof						
868	Barrel bracket gracked or broken at proof		**************************************				
BC-P	Blows cases at proof		440044100				
BEB-P	Barrel extension broken at proof		Managara anaka				
BLP-P	Blanked primer at proof						
BLSO-P	Barrel lug shot off at proof						
BP-P	Blown primer at proof						
BS-P	Barrel split at proof						
DLOS-P	Doesn't lock over shells at proof						
ESB-P	Ejector sticks back at proof						
FCB-P	Fore-end cracked at proof	1					
FESO-P	Fore-end shot off at proof					500.	
FF-P	Fails to fire at proof		***************************************				
GCSO-P	Gas cylinder shot off at proof		***********				
MSI-P	Magnaflux stamp illegible on bbl		450445044	***			
MSM-P	Magnaflux stamp missing on bbl		***************************************		**************************************		
PP-P	Pierced primer at proof						
SCB-P	Stock cracked or broken at proof	-	**********				
UNCM-P	Uncoded proof malfunctions		-			*****	
						8	

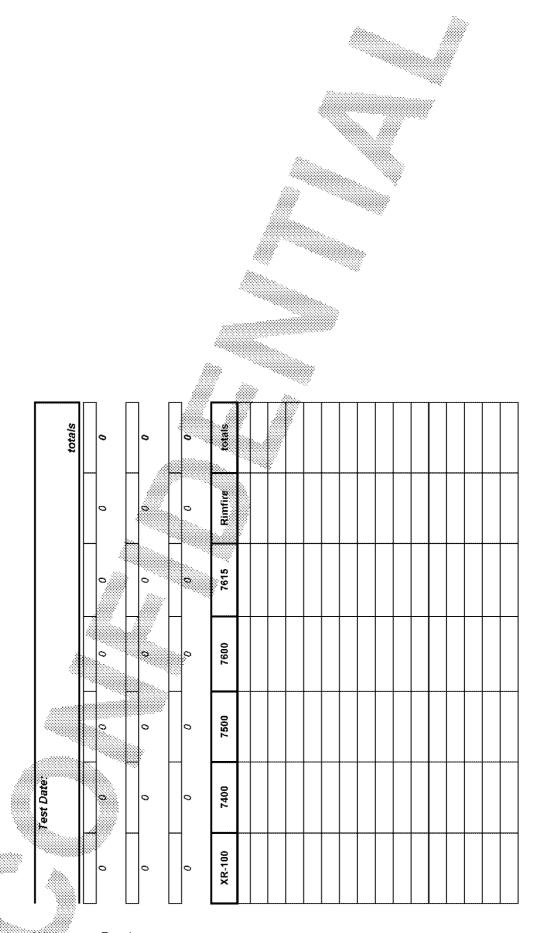


Subject to Protective Order - Williams v. Remington

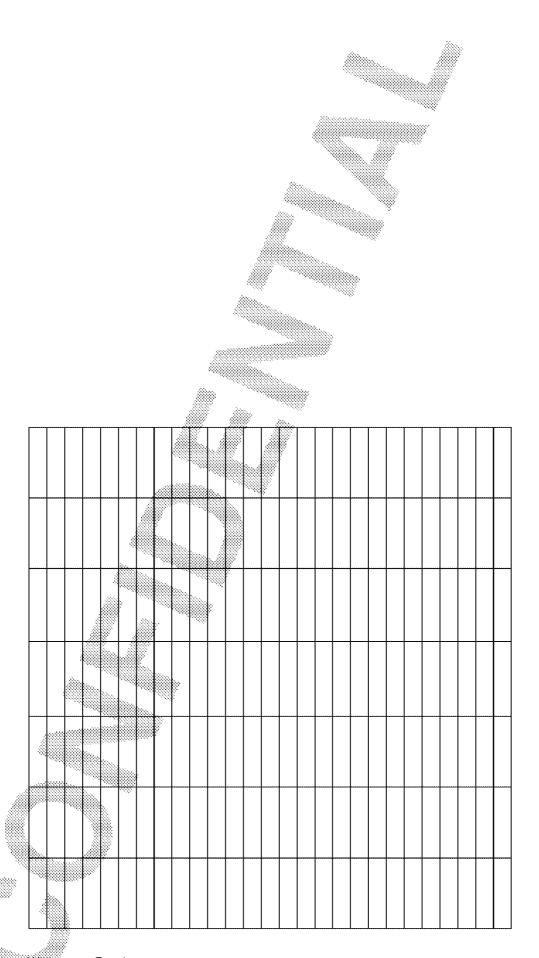







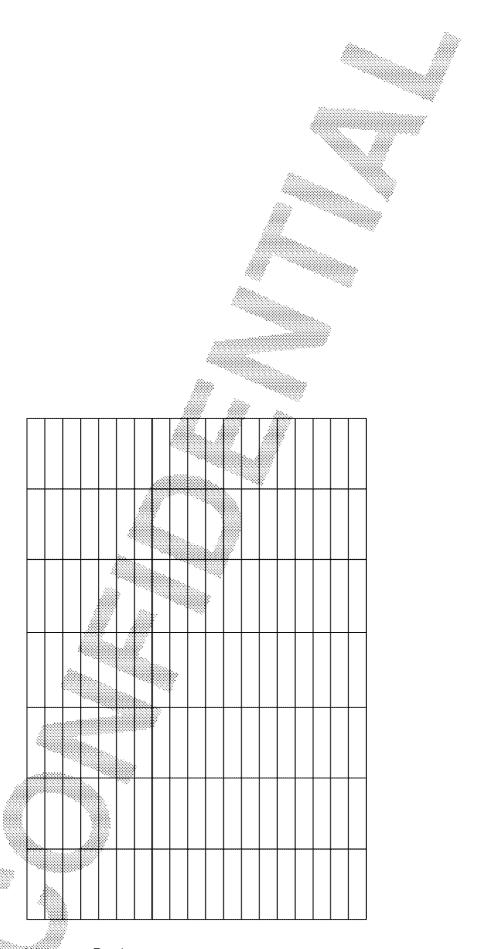

Subject to Protective Order - Williams v. Remington

Summ	ary	Total	Test + Proo			0						
			Total	Rejected:		0						
			Total : Overall Rej	iect Rate:								
				\$hot:								
		Proof		Rejected	0	· · ·	0	0	0	0	0	0
				Rejected. Percent:	0		Sta.					
				Shot.								
		Test		Shot. Reje çted : Perçent:	Q		0	O	0	0	Ð	0
				Percent:				0				
				SHOE.		900 4	2000	178888	<i>A</i> .			
		Target		Rejected:	0		0	0	0	0	0	0
		-		Percent:	á							

CODE	MALFUNCTION INDEX	700 SPS	700 SPS \$8	700 BDL & ADL	700 SS	790 CDL	700 POLICE	MODEL 7
			***********				X	
AB	Action binds							
BABS	Bulge at body shoulder		***************************************	***************************************				
BAC	Burr at chamber		***************************************					
BBMA	BBL-to-bolt misalignment				***			
ВВ	Bolt binds/catches		***************************************					
BCOBS	Bolt catches on bolt stop							
BCOF	Bolt catches on follower						****	
ВС	Blows cases		-					
BHR	Bolt hits receiver		-					****
BHS	Bolt plug hits safety switch		***************************************					
BLOP	Bar lock or disconnector out of position		311					
BLSO	Barrel lug shot off							
BPO	Bolt pulls out							
BSSM	Bolt stems shell in magazine		- Control of the Cont					
BWCD	Bolt won't cam down							

CODE	MALFUNCTION INDEX	700 SPS	700 SPS SS	700 BDL & ADL	700 SS	700 CDL	700 POLICE	MODEL 7
BWCFM	Bolt won't classe over full magazine		* in the state of					
CD	Case dented		***************************************					
СН	Closes hard		handelelaker					
CLM	Can't laod magazine							
co	Cut-off			*				
CR	Cuts rim							
CS	Cases swell				***			
CTOG	Chamber torn or gouged							
CTP	Creepy trigger pull					Willian.		
CWSB	Cams wrong side of action bar							
DBB	Doesn't blow back		*********				*	
DCS	Double click in safety switch		++++++++++++++++++++++++++++++++++++++					
DCT	Double click in trigger		**************************************					
DCU	Doesn't close-up		***************************************					
DE	Doesn't eject		Artenantes					
DEL	Doesn't eject live round		vision to the second			******		
DFB	Doesn't feed back		***************************************					
DFU	Doesn't feed up		Managara				;	
DLO	Doesn't lock open (after last shell)		***************************************					· ***
DLU	Doesn't lock-up		NATH CONTRACTOR					***
DS	Dead safe		********					
DX	Doesn't extract		***************************************					
DXL	Doesn't extract live round							
EDS	Extractor drops shell							
ESB	Ejector sticks back							
ESCR	Empty shell catches receiver							


40								
CODE	MALFUNCTION INDEX	700 SPS	700 SPS SS	700 BDL & ADL	700 SS	700 CDL	700 POLICE	MODEL 7
ESS	Extractor stems shelf		**					
FA	Fires automatically							
FB **	Follower binds							
FC	Fails to connect		<i>illus</i>					
FCB	Fore-end cracked or broken			<u>.</u>				
FD	Follows-down							
FF	Fails to fire				S			
FFP	Flat firing pin							
FOS	Fires on safe					Mar.		
FPHB	Firing pin hits bbl							
FPHI	Firing pin hits inside rim		***********				×	
FPO	Floor plate opens			400000				
FPOH	Floor plate opens hard							
FSR	Fires when safe is released		-		****			
FT	Follower tips							
GCSO	Gas cyl shot off		***************************************			******		
HBL	Heavy bolt lift		***************************************					
HMSC	Heading mismatch-steps on case		-				,	
HPA	High pressure ammo							** ***
HUR	Hard under rail							
JCS	Jumps cartridge							
JM	Jumps magazine							
JO	Jars off							
LB	Light blow							
MAH	Magazine assembles hard							
MCW	Magazine capacity wrong		***************************************					

ŀ	4	
l	_	
ĺ	T P O O	
(0	
ţ	\mathbf{c}	
l	_1	
ŀ	<u> </u>	
•	J	
ĺ	П	
•	J	
ĺ	O	

CODE	MALFUNCTION INDEX	700 SPS	700 SPS SS	700 BDL & ADL	700 SS	700 CDL	700 POLICE	MODEL 7
MFA	Misfires (ammo)		************					
MFOP	Magazine tollower out of position		***************************************					
ML	Magazine Inose							
MLH	Magazine loads hard		11/1/20					
MRH	Magazine removes hard							
он	Opens hard							
OR	Over-rides				&			
PH	Pulls hard							
PSI	Proof stamp illegible					Illian.		
PSM	Proof stamp missing							
RBOC	Rings and bulges on case		***********				200	
RDW	(Action) release doesn't work			4///				
RIC	Rings in chamber		-	****				
RIS	Ring in sholder		-					- W
RS	Rim srem							
SBC	Stems bottom chambers		**************************************			-44///		
SBE	Stems bbl extension		***************************************					
SCB	Stock cracked or broken		***************************************				į.	
SCX	Shell catches							***
SHI	Short indent		-					***
SI	Stems incline							
SIC	Stems in chamber		**************************************					
SL	shaves lead		***************************************					
SLC	Stems left side of chamber		-					
SMOC	Stretch marks on case							
SOR	Stem over-ride		-					

CODE	MALFUNCTION INDEX	700 SPS	700 SPS SS	700 BDL &	700 SS	700 CDL	700 POLICE	MODEL 7
SP	Stems port							
SR	Shoulder rough							
SRC	Stems right side of chamber							
SRIC	Specific rings in chamber		1000					
ssoc	Surface scratches on case			.				
STC	Sterns top chamber							
SWE	Safety switch works too easily			- A	×			
SWH	Safety switch works too hard							
sww	Safety ewitxh won't work					Mila.		
TD	Tips down							
TU	Tips up		*******				2000	
TWP	Trigger won't pull		4	400000				
TWR	Trigger won't retract		***************************************					
UNCN-T	Uncoded		sine en alle alle alle alle alle alle alle					
ХН	Extracts hard		A		100			
			**************************************			*****		
HI	High		***************************************					
LO	Low							
LEFT	Left		***************************************					***
RIGHT	Right		MATERIAL DE LA COMPANIA DE LA COMPAN					***
DG	Doesn't Group		****					
FSST	Front sight tipped		***					
RSTT	Rear sight tipped							
RSBR	Rear sight base raised							
FSTR	Front sight raised							
FSTL	Front sight loose		***************************************					

CODE	MALFUNCTION INDEX	700 SPS	700 SPS SS	700 BDL & ADL	700 SS	700 CDL	700 POLICE	MODEL 7
RSTL	Rear sight loose		***					
MGPT-G	Missing parts at target	William.	**************************************					
UNCN-G	Uncoded nonconformity at target		Name of the last o					
AI-P	Assembly incompleye at proof							
BBB	Barrel bracket cracked or broken at proof							
BC-P	Blows cases at proof				800.			
BEB-P	Barrel extension broken at proof							
BLP-P	Blanked primer at proof	****				Mar.		
BLSO-P	Barrel lug shot off at proof				*** *********************************			
BP-P	Blown primer at proof		**********				*	
BS-P	Barrel split at proof		***************************************					
DLOS-P	Doesn't lock over shells at proof		****					200
ESB-P	Ejector sticks back at proof		***************************************		· · · · · · · · · · · · · · · · · · ·			
FCB-P	Fore-end cracked at proof							
FESO-P	Fore-end shot off at proof					*****		
FF-P	Fails to fire at proof		***************************************					
GCSO-P	Gas cylinder shot off at proof		***************************************					
MSI-P	Magnaflux stamp illegible on bbl							
MSM-P	Magnaflux stamp missing on bbl		-					****
PP-P	Pierced primer at proof		***********					
SCB-P	Stock cracked or broken at proof							
UNCM-P	Uncoded proof malfunctions							

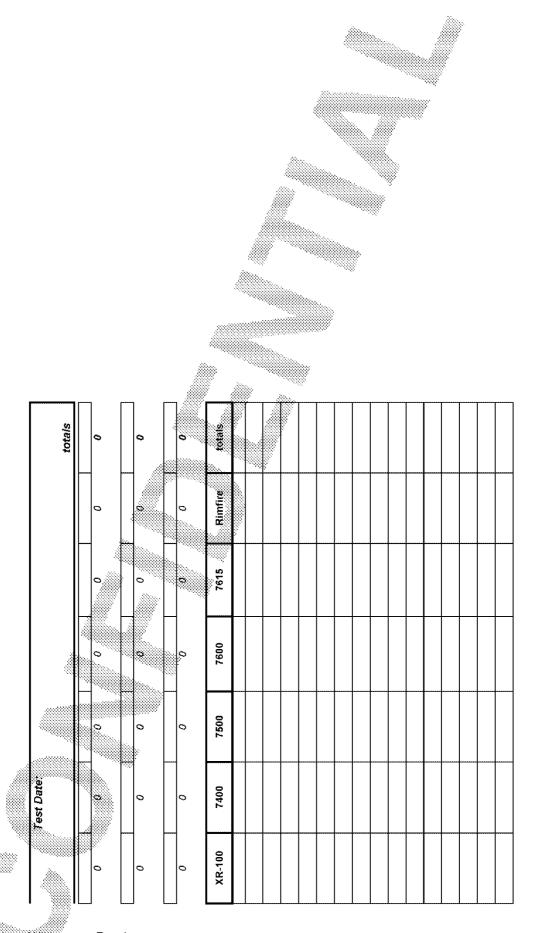

Subject to Protective Order - Williams v. Remington

