2.4

Remington Arms Co., Inc. Product Service Legal Case #:3454

Case Information

RE# Date Opened Date Opened(PS) Date Closed Incident Date Pre Lit Lit Obsolete 167162 4/29/2009 4/30/2009 4/30/2009

**Customer Information** 

First Type **Business Last Name** Street City State Zip Age Contact Name 9263 Crane Mihalak's Mihalak's W 814-756-Reporter Cranesville PA 16410 Rd. Guns Guns 4092

Incident Information

Claims Codes Repair Medical Medical Status

ΡI

PD Could Not Duplicate

Cause: 4038 Concern Unknown

release Concern:1007 Fired on Safe Release

С

Dealer reported - Rifle has fired twice when the safety was pushed forward to fire with no fingers on the trigger.

dmf

Firearm Information

Model/Ga. SKU Serial Bbl. DOM Mfq. Type Remington CF/BA 700/2506 REM 6326827 CT 4/1/1970 Original Date Where Purchased Accessories **Owner** Purchased **ROSKIN BROS MIDDLETOWN** TWO PIECE SCOPE U BASE NY

CONCERN:FSR

Ammunition Information - None Defined
Other Products Information - None Defined
Settlement

Remington/700/CF/BA

Settlement Release of Claims Release Date Reimbursement Cash Date Date
Settlement APV APV

Repair at special price under BLSM program

Repair/Replacement Repair/Replacement

Cost Date

\$47.38


5/4/2009

5/4/09: Per Fred S. - Could not duplicate concern. Trigger set screws altered, Trigger assembly very dirty. Replace trigger assembly, check over, clean under BLSM. dmf

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		4/30/2009
	Product Type		. RF

	Action Type	Ħ	A
	Assigned To	=	F.SUPRY
Cause	4038	Could Not Duplicate Concern	, noorki
	Description	Concern	24" 2506 REM
Barrel	Date Code	_	CT 2300 KEN
	Bore Plugged	False	
	Bulged	False	
	Fired	False	<del></del>
	Fired while Obstructe		
	Muzzle/Crown Condition	Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	DIRTY/STICKY
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
Overall	Exterior Condition	Worn; Functioning	
	Stock Condition	Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	· .
	Bulged	False	
Safety	Description		STANDARD M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	Select	.010
	Notch -	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	DIRTY
	Pull	Select	2.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE SCOPE BASE

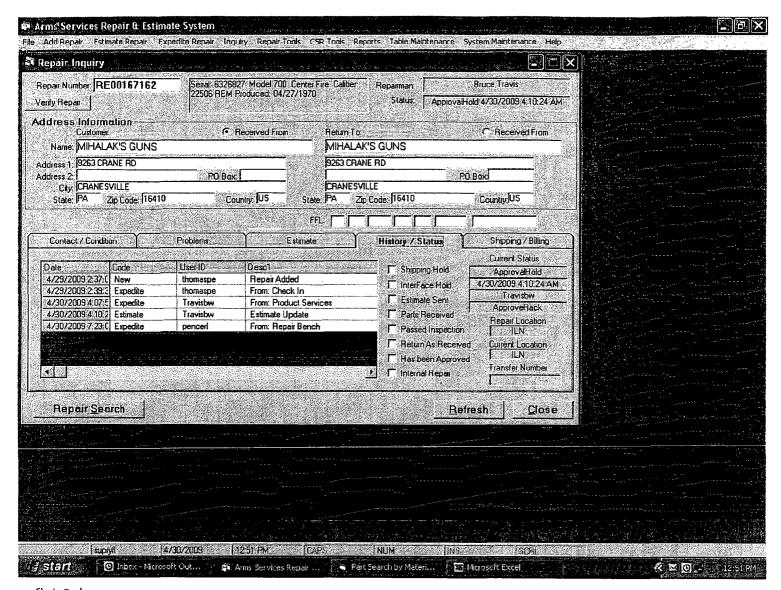

3454



## **MIHALAK'S GUNS** 9263 Crane Road CRANESVILLE, PA 16410 DATE 4-23-09 SUBJECT REMING TOW (814) 756-4092 ARMS SERVICE TOU ADL REMINGTON ARMS CO. SER# 6326827 14 HOEFLER AVE CA-25-06 ILION, N.Y. 1335.7 REPAIR DEPT 8 THIS RIFLE HAS FIRED (TWICE) WHEN THE SAFETY WAS PULLED FORWARD TO WITH NO FINGELS ON THE TRIGGER.



PLEASE REPLY

rould not duplicate concern.
Trigset screws of tered
Trigset screws of tered
Trig ASSM very direty.
Rephalice TPA, check onen,
Elean under bolt lock
Jinogram Con & 20.00

Quote

U.S. Department of Justice Bureau of Alcohol, Tobacco, Firearms and Explosives

## Federal Firearms License (18 U.S.C. Chapter 44)

In accordance with the provisions of Title I, Gun Control Act of 1968, and the regulations issued thereunder (27 CFR Part 478), you are licensed to engage in the business specified in this license, within the limitations of Chapter 44, Title 18, United States Code, and the regulations issued the regulations is sued the regulations. shown. See "WARNINGS" and "NOTICES" on reverse. ATF - Chief, FFLC Direct ATF 8-25-049-01-1L-08103 2600 Century Parkway, NE Suite Correspondence To Atlanta, Georgia 30345-3/104 Chief, Federal Firearms Licensing Center (FFLIC November 1, 2011 Date MIHALAKS GUNS Premises Address (Changes? Notify the FFLC at leas RD 1 9263 CRANE RD CRANESVILLE, PA 16410-0000 Mailing Address (Changes) Notify the FFLC of any changes.) Purchasing Centification Statement The licensee named above shall use a copy of this license to assist a transferor of firearms to verify the identity and the licensed status of the licensee as provided by 27 CFR Part 478. The signature on each convenuate be an original signature. A faxed, scanned or e-mailed copy of the license with a signature intended to be an original signature is acceptable. The signature must be intended to be an original signature in acceptable. The signature must be intended to be an original signature or a responsible person of the FFL.—I continue that this is a true copy of a license issued to the licensee named spove to engage Licensee/Responsible Person Signature J. MIHUC ATF Form 8 (5310.11) Printed Name Revised December 2007 Previous Edition is Obsolete