

Remington Arms Co., Inc.
Product Service
Legal Case #:4072

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
182086	12/3/2009	12/4/2009	12/4/2009				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Fireice Firearms	David	Fireice Firearm	960 Riverview Dr. Ste 2	Cherokee	IA	51012		W 712-225-2213 F 712-225-2230 E fireicefirearms@yahoo.com

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4038	Could Not Duplicate Concern		
S	Concern:1007	Fired on Safe Release		Unknown
C	Fires on safe release			

Dealer reported in a letter - The rifle will sometimes fire when the safety is let off. dmf

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/270 WIN	*	A6496927	WO	8/31/1977
Date Purchased	Where Purchased	Accessories	Original Owner			
	BOB WARD MISSOULA MT	TWO PIECE SCOPE BASE	U			

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Repair under BLSM program						
	Repair/Replacement Cost	Repair/Replacement Date				
	\$63.84	12/8/2009				

12/8/09: Per Fred S. - Could not duplicate concern. Replace trigger assem. check over, clean under BLSM program. dmf

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		12/4/2009
	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY

Cause	4038	Could Not Duplicate Concern	
Barrel	Description		22" 270 WIN
	Date Code		WO
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	SOME DENTS/SCRATCHES
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.011
	Notch	Like new; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Like new; Functioning	
	Pull	---Select---	4.5#
	Altered	False	
	Sub-Assembly	Other Remington	
Non-Remington	Description		TWO PIECE SCOPE BASE


Components		
------------	--	--

CS. 12. 2. 09

4072

FIREICE FIREARMS LLC

960 Riverview Drive, Suite 2
Cherokee, Iowa 51012
Phone 712-225-2213
Fax 712-225-2230
fireicefirearms@yahoo.com

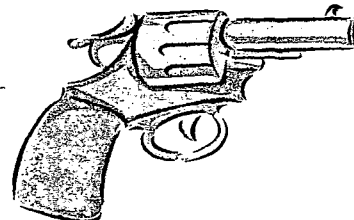


22"
W08/97
4.5#
2011

November 24, 2009

Remington Service Department,

I'm sending this 700BDL in .270 Win serial #A6496927 in for warranty repair. The rifle will sometimes fire when the safety is let off. I have enclosed a check in the amount of \$20.00 per our phone conversation. If you have any questions please give me a call.

Cordially,


David Brown

Serial Number: **A6496927**

Model: **700**



RE00182086

could not duplicate concern.
Replace TPA, check over, clean
under bolt + lock program.
Ron 2000

FIREICE FIREARM
960 RIVER VIEW DR, SUITE 2
CHEROKEE IA 51012


10 LBS
RS

1 OF 1

SHIP TO:

REMINGTON
14 HOFELER AVE.
ILION NY 13357

ARMS

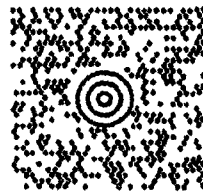


NY 135 0-01



UPS GROUND

TRACKING #: 1Z 4XX 596 90 6512 0411

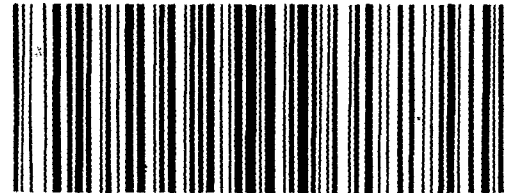

BILLING: 3RD PARTY
DESC: FIREARMS
RETURN SERVICE

REF 1: FIREICE FIREARM/CD/JBI

REF 2: HS 11.0.15 LP2442 96.1



Insurance Shipping Notice: - Carriage Insurance may be subject to the rules related to liability and other terms and conditions established by the Carrier. Certain Rules Relating to International Carriage by Air (the "Warsaw Convention") and/or the Convention on the Contract for the International Carriage of Goods by Road (the "CMR Convention") may apply to shipments. Insurance coverage is provided by the Carrier. For more information, please call 1-800-424-7500.

File Add Repair Estimate Repair Expedite Repair Inquiry Repair Tools CSR Tools Reports Table Maintenance System Maintenance Help

Repair Number	RE00182086	Serial A5496927 Model 700 Center Fire Caliber .270 WIN Produced: 08/31/1977	Repairman	Bruce Travis
Verify Repair			Status	Repairing 12/4/2009 8:44:06 AM

Customer:		Received From:		Return To:		Received From:	
Name: FIREICE FIREARMS LLC				Name: FIREICE FIREARMS LLC			
Address 1: 960 RIVERVIEW DR SUITE 2				Address 1: 960 RIVERVIEW DR SUITE 2			
Address 2:		PO Box:		Address 2:		PO Box:	
City: CHEROKEE				City: CHEROKEE			
State: IA		Zip Code: 51012		State: IA		Zip Code: 51012	
Country: US				Country: US			
FFL:				FFL:			

Contact / Condition	Problems	Estimate	History / Status	Shipping / Billing
Date	Code	User ID	Descr	Current Status
12/3/2009 8:38:	New	schultscm	Repair Added	Repairing
12/3/2009 8:41:	Expedite	schultscm	From: Check In	12/4/2009 8:44:06 AM
12/3/2009 12:05:	EmailSent	AzmE@mail	Repair Received	System
12/3/2009 12:05:	EmailVerified	AzmE@mail	Receipt	Repair Bench
12/4/2009 8:03:	Maint	Travisbw	Repair Maintenance	Repair Location
12/4/2009 8:43:	Update	Travisbw	Address, Billing, or Ship Method	ILN
12/4/2009 8:43:	Estimate	Travisbw	Estimate Update	Current Location
12/4/2009 8:44:	Receiving	System	Immediate SAP Allocation	ILN
				Transfer Number

Repair Search

Refresh

Close

BY: