

Remington Arms Co., Inc.
Product Service
Legal Case #:5164

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
222743	2/10/2011	11/22/2010	2/11/2011	11/20/2010			

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter		Milton	Chambley Jr.	1632 Balsa Cir.	Tuscaloosa	AL	35405		H 205-966-7160

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
FI				
PD	Cause:4014 Defective Parts		Unknown	
S	Concern:1008 Fired on Bolt Closing			
C FBC				

11/22/10: Customer called in. He stated that he had the gun @ his gunsmiths on 11/20/10 & it fired when gunsmith closed the bolt. No damage - No injury. df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPRG	25793	B6784759	CG	4/29/1986
Date Purchased	Where Purchased	Accessories	Original Owner			
	K. MART ENTERPRISES 66044		N			

CONCERN:FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion -						
Quote to repair						

Repair/Replacement Cost	Repair/Replacement Date

11/22/10: Sending ARS, ltr, form. df 2/22/11: Per Ilion - Trigger guard dented & contacts trigger. Trigger does not have any free movement. Check over, clean & test fire @ 1/2 normal cost. Will replace firing pin assemb. - quote. Left msg. for cust to call me. df 2/23/11: Cust. called. He will call back next wk. w/payment. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		2/11/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4014	Defective Parts	TRIG GUARD DENTED

Barrel	Description	22" 3006 SPR	
	Date Code	CG	
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
Bolt	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
Extractor	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
Locking	Ext/Eject Test	False	
	Block Condition	--Select--	
	Lug Condition	Slightly Worn; Functioning	
Overall	Notch Condition	--Select--	
	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
Receiver	Fore End Condition	--Select--	
	Condition	Slightly Worn; Functioning	
Safety	Bulged	False	
	Description	M/700 SAFETY	
	Function	Like new; Functioning	
Sear	Sub-Assembly	Non-ISS	
	Lift	--Select--	.013
	Notch	Slightly Worn; Functioning	
Feeding Test	Test Fired	False	
	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	T.G. DENTED AND CONTACTS TRIG TRIG HAS NO FREE MOVEMENT
	Pull	--Select--	5#
	Altered	False	
	Sub-Assembly	M/700 Non-Bolt Lock	

22"
C648
5-11
1013

COPY

5164

November 22, 2010

Milton Chambley Jr.
1632 Balsa Cir.
Tuscaloosa, AL 35405
Ph: 205-966-7160

Ref: # 5164

Dear Mr. Chambley,

Enclosed is a prepaid UPS shipping label to cover shipment of your firearm to our factory for examination.

Please include a copy of this letter to put inside the shipping container. The letter inside is important as sometimes the outside label gets damaged in transit and we want to be sure the firearm is logged in correctly. Mark the ends of the box with "Product Service". Product Service will be inspecting the firearm and will contact me with the results.

I hope that this action will keep you a loyal Remington customer.

Sincerely,
D. Fulcher
Consumer Affairs Administrator
Remington, H&R, Marlin
Phone: 1-800-243-9700
Fax: 336-548-7872


RECEIVED
FEB 15 2011

enclosure

Part Lot Number

B6784759

Model: 700

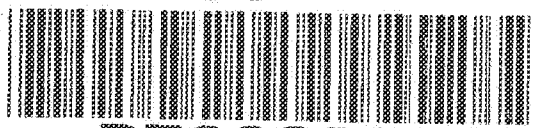

RE00222743

BY:

Trig. Guard dented & contacts firing.
Trig. does not have any free movement.
check over, clean & test fire at 1/2
normal cost. Will replace F.P. Assm.

Quote

Remington Arms Company, Inc. • 870 Remington Drive • P.O. Box 700 • Madison, NC 27025
Phone 800-243-9700 • www.remington.com

The Gun Cabin
243 East Kenwood
Brighton, Tenn. 38011

D. Fulcher
Consumer Affairs Administrator
Remington Arms Company, Inc.
870 Remington Drive
P.O. Box 700
Madison, N.C. 27025

Reference # 5164

Dear Mr. Fulcher,

Mr. Chambley has allowed us to handle the shipping and receiving of his firearm.

As you may be aware this firearm has safety issues.

Please return firearm to us at 243 E. Kenwood Brighton, Tenn. 38011

Sincerely,

Johnny Mcculley

Gunsmith, The Gun Cabin

Direct ATF ATF - Chief, FFLC
Correspondence To 244 Needy Road
 Martinsburg, WV 25405-9433

1-62-167-01-2L-04187

November 1, 2012

THE GUN CABIN

243 E. KENWOOD
BRIGHTON, TN 38011-

01-DEALER IN FIREARMS OTHER THAN DESTRUCTIVE DEVICES

Mailing Address (Changes? Notify the FFLC of any changes.)

ROOK, TERRY LEN
THE GUN CABIN
243 E. KENWOOD
BRIGHTON, TN 38011

Position Title

Date _____

[illegible]ATF Form 3 (530.0)
Revised September 2003



www.remington.com

Remington Arms Company, Inc.
870 Remington Drive
P. O. Box 700
Madison, NC 27025-0700

ARS LABEL REQUEST FORM

DATE:	11/22/2010	REQUESTED BY:	Dell
QUANTITY:	1	WEIGHT PER PKG:	10 lbs
PLEASE CHECK ONE			
MEDIA			
COORDINATOR			
TO MAIL		I WILL MAIL	XXXXXX
DESCRIPTION: Rel # 5164 Rifle			

LABEL INFORMATION

MAIL LABEL TO: Milton Chambley Jr. 1632 Balsa Cir. Tuscaloosa, AL 35405 Ph: 205-966-7160
RETURN ITEM TO Remington Arms Attn: Product Service Ilion, NY

~~PLEASE COMPLETE ALL PARTS OF THIS FORM AND SEND TO THE MEDIA COORDINATOR~~

4XX586 NOV 23, 2010 ALL CURR USD 1 OF 1
SVC GND COM ACT WT 10.0 LBS
TRACKING# 1Z4XX5868066787110
REF 1: MILTON CHAMBLEY JR/CO/0MF
REF 2: 5164/RIFLE
HANDLING CHARGE 0.00
SINGLE-PIECE PUB RATE CHRG: SVC T/P USD
DY 0.00 COO 0.00 RS 0.50
DC 0.00 GGD 0.00 SD 0.00
AH 0.00 PR 0.00 SP 0.00
TOT PUB CHG 8.74 PUB+HANDLING 8.74





