

Remington Arms Co., Inc.
Product Service
Legal Case #:5586

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
218959	1/7/2011	1/10/2011	1/10/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Sport N Stuff	---	Sport N Stuff	87 Victory Hwy	Painted Post	NY	14870		W 607-937-3368 H 607-523-8335 C 607-738-3526 E kgm366@outdr.net
Incident		Kenneth	McKillop	1166 US 15	Lindley	NY	14858		

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4006 Altered Adjustments or Components		Unknown	
S	Concern:1007 Fired on Safe Release			
C	FSR			

Customer sent gun in through a dealer & wrote a note. Customer stated gun fired when he took it off safe. He could not remember if he bought gun new or used. He doesn't know if anything was done to the trigger. He wasn't sure if he should put an aftermarket trigger in it. df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Rbl.	DOM
Remington	CF/BA	700/3006 SPR	n/a	A6272049	AI	3/1/1976
Date Purchased	Where Purchased	Accessories	Original Owner			
	JERRYS SPT CTR MONTDALE PA	TWO PIECE BASE	U			

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per fllon - Quote to repair under BLM program						
	Repair/Replacement Cost	Repair/Replacement Date				
	\$30.40	1/31/2011				

Per fllon - Will follow down. TA set screws altered. Trigger will not return properly. Replace TA, clean & test fire under BLM program - quote. df 2/1/11: I called dlr & he stated that cust. recently mailed payment to us so work could be completed. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B TRAVIS
	Exam Date		1/10/2011
	Product Type		RF
	Action Type		A
	Assigned To		T NAGLE
Cause	4006	Altered Adjustments or Components	
Barrel	Description		22" 3006 SPR
	Date Code		AI
	Bore Plugged	False	
	Bulged	False	

	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	009
	Notch	Slightly Worn; Functioning	
Feeding Test	Tests	Test Fired	False
		False	
Trigger	Condition	Slightly Worn; Not Functioning	TRIG NOT RETURNING
	Pull	---Select---	2.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE BASE



Phone
607-937-3368
Brian Thompson

87 Victory Highway
Painted Post, NY 14870


55

22"
A13/76
2.5
009

Serial Number

A6272049

Model: 700

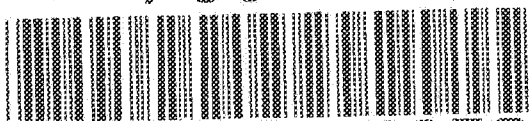

RE00218059

... will follow down


... set screws altered

... will not return properly

... clean test time

... under BLZ for 20. w + ship

Quote



BY

3000

12/31/10

TOM,

I CALLED THE FIRST WEEK OF
DECEMBER ABOUT MY REMINGTON 700 30-06
FIRING TWICE WHEN I FLIPPED THE SAFE
OFF TO CLEAR IT AFTER HUNTING. I ALSO
TRIED AFTER THAT, UNLOADED, AND IT LOCKED
UP ONCE ON 6 TRIES. I DON'T REMEMBER
IF I BOUGHT IT NEW OR USED, I'VE HAD
IT SO LONG. IF ANYTHING HAS BEEN DONE
TO THE TRIGGER, I'M NOT AWARE OF IT.
I'VE ONLY HUNTED WITH IT. LET ME KNOW
WHAT YOU FIND OUT, SHOULD WE HAVE AN
AFTER MARKET TRIGGER PUT IN IT? I'M A
LITTLE SPOOKED BECAUSE OF THIS. I ALSO
HAVE A MODEL 700 IN 6MM, SERIAL #96418,
8 WINGMASTER PUMPS AND 2 MODEL 788's.
MY PRETTY HEAVY INTO REMINGTONS.
WAITING TO HEAR FROM YOU. THANKS,

KENNETH MCKILLIP

PS: TOM, I COULDN'T FIND 1166 U515

ANYONE TO SHIP IT WITH SO TOOK LINDLEY NY 14858
IT TO FFL DEALER, SHIP IT

BACK TO HIM, CARD H- 607 523 8335

ENCLOSED, TRS, KEN * C - 607 738 3526 *

E-MAIL KGM366@OUTDOORS.NET

