

Remington Arms Co., Inc.
Product Service
Legal Case #:6041

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
226590	3/22/2011	3/24/2011	3/24/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Robert (Donnie)	Reed	686 Buckhorn Trail	Pipe Creek	TX	78063		H 830-535-4080 C 210-678-9996

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI PD S C	Cause:4038 Fired when bolt closed and when uncocking bolt Concern:1008 Fired on Bolt Closing	Could Not Duplicate Concern	Unknown	

4/1/11 Per note with rifle, gun goes off when you close the bolt, goes off uncocking bolt.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/2506 REM	n/a	6956011	CZ	4/1/1975
Date Purchased	Where Purchased	Accessories	Original Owner			
	W H RICHARDSON AUSTIN TX	TWO PIECE BASE	U			

CONCERN:FBO

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean, test fire under BLSM price	Repair/Replacement Cost 60.40	Repair/Replacement Date 4/1/2011				

4/1/11 Per Ilion, could not duplicate concern. Trigger assm set screws altered. Replace TPA, clean, test fire under BLSM price of \$20 + S&H.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		3/24/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		24" 2506 REM
	Date Code		CZ
	Bore Plugged	False	
	Bulged	False	
	Fired	False	

	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.008
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	MIN TRIG RETURN
	Pull	---Select---	3#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE BASE

24"
CZ4/T
3#
.008

1091

ATT Repaire

Gun goes off when
you close the Bolt
Goes off uncocking Bolt

HAS A Trigger


If you could Fix it
Fix it

Robert (Donnie) Reed
686 Buckhorn Trail
Pipe Creek TX
~~75083~~ 78063
Ph 830 535 4080
Cell 210 678 9996

20.40
27. -
75. -
15. -
97.40
8. -
60.40

6856011

Model: 700

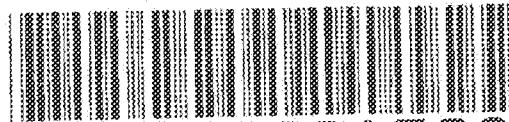

RE00226590

could not duplicate concern.
F.A. set screws altered. Alpha
TPA, check & test fire under BLP
for \$20.00 + ship Quote

RECEIVED
MAR 20 2011

BY:



