

Remington Arms Co., Inc.
Product Service
Legal Case #:2115

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
140799	2/9/2008	2/11/2008	2/11/2008				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Sharp Shooters Knife & Gun	Sharp Shooters		5062 50th St	Lubbock	TX	79414		W 806-791-1231 F 806-791-2904

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015 Improper Maintenance		Unknown	
S	fires when raising the bolt	Concern:1020 Fired on Bolt Opening		
C				

2/13/08-correspondence from repair-firearm goes off while raising bolt.lw

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl	DOM
Remington	CF/BA	700/270 WIN		6808770	RY	11/1/1974
Date Purchased	Where Purchased	Accessories	Original Owner			
		SCOPE BASE,RINGS	U			

CONCERN:FIRED AS BOLT WAS RAISED

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Replace TA under SMP						
	Repair/Replacement Cost	Repair/Replacement Date				

2/13/08-quote sent to replace ta under smp.lw


Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		2/11/2008
	Product Type		RF
	Action Type		A
	Assigned To		F.SUPRY
Cause	4015	Improper Maintenance	TRIG ASSM VERY DIRTY AND STICKY PARTS WORK SLUGGISH
Barrel	Description		22" 270 WIN
	Date Code		RY
	Bore Plugged	False	
	Bulged	False	
	Fired	False	

	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.006
	Notch	Like new; Functioning	
Feeding Test	Tests	Test Fired	False
		False	
Trigger	Condition	Slightly Worn; Functioning	VERY DIRTY AND STICKY
	Pull	---Select---	7#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		SCOPE BASE,RINGS

6808770

Model: 700

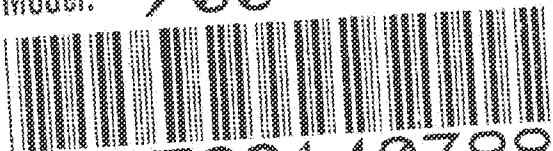

RE00140799

T219. ASSM. very dirty & sticky.
causing parts to work sluggish. 7th
replace TPA, check down, clean
UNDER BOLT LOCK PROGRAM RY 11/74
Ron B 20.00 + SKH.

Quote

224
.006

2115

RECEIVED
FEB 13 2008

SHARP SHOOTERS KNIFE & GUN EXCHANGE

5062 50th Street
LUBBOCK, TEXAS 79414
(806) 791-1231 Fax (806) 791-2904

Gun Return

Customer's Order No.		Date		1-16-08	
Name <u>SID CONNER</u>					
Address <u>506 946-7186</u>					
Phone: <u>806 495-3207</u>					
SOLD BY	CASH	C.O.D.	CHARGE	ON ACCT.	MOSE. RETD. PAID OUT
QUAN	DESCRIPTION	PRICE	AMOUNT		
	Ship to: Remington				
	Model 700 Cal 25-06				
	White RAISING Bolt the				
	Rice arm discharged!				
	Serial A6284581				
	Model 70 Cal 270				
	this Rice arm goes				
	off white RAISING Bolt				
	Serial 6808770				
All claims and returned goods MUST be accompanied by this bill.					
0032564		Received By		TAX	
				TOTAL	