

Remington Arms Co., Inc.
Product Service
Legal Case #:6108

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
228486	4/11/2011	4/12/2011	4/12/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Ammo Depot		Ammo Depot	4725 FM 36 South	Caddo Mills	TX	75135		W 903-527-6120
Incident		Wayne	Cody						H 972-784-7188 C 214-537-0751

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4006 Altered Adjustments or Components		Unknown	
S	Fires on safety release Concern:1007 Fired on Safe Release			
C				

5/2/11 Per note with rifle, when customer takes gun off safety the gun goes off.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/22-250 REM	20000	A6709152	BV	1/9/1979
Date Purchased	Where Purchased	Accessories	Original Owner			
	WHITE STRS LUFKIN TX	SCOPE BASE	U			

CONCERN: FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean, test fire under BLSM program price						
	Repair/Replacement Cost	Repair/Replacement Date				
	30.40	5/2/2011				

5/2/11 Per Ilion, trigger assm dirty, sticky, rusty, set screws altered. Replace TPA, clean, test fire under BLSM program price of \$20 + shipping.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		4/12/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4006	Altered Adjustments or Components	POOR MAINTANENCE
	Description		24" 22-250 REM
	Date Code		BV
	Bore Plugged	False	
	Bulged	False	

Barrel	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.008
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY,STICKY RUSTY TRIG NOT RETURNING WILL FOLLOW DOWN
	Pull	---Select---	8#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		SCOPE BASE

6108

24"
BVI/OT
84
1008

Serial Number

A6709152

Model: 700




RE00228486

T.A. dirty, sticky, rusty, Set
screws altered. Rep MCA TPA,
clean + Test Fire under BCP
Cost \$20.00 + ship

20.40
27.-
20
67.40
37-
30.40

Quote

Wholesale

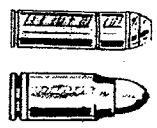

AMMO DEPOT

4725 FM. 36 South
Caddo Mills, TX 75135
Phone 903-527-6120
Fax 903-527-6124

FR



SHIPPING (Pd) INVOICE

SHIP

TO
RECEIVED
APR 15 2011

SOLD TO

Wayne Cody
972-784-7188 (H)
214-537-0751 (C)

SHIP TO

BY:

CUSTOMER'S ORDER #	SALESMAN	TERMS	SHIPPED VIA	F.O.B.	DATE
	Sony				3/5/11
	REM 700 22-250				
	S/N A6709152				
	COMPLAINT				
	TAKE GUN OFF SAFETY				
	GUN GOES OFF				
	Rem call cost. on repair				

6108 527-6124







