

Remington Arms Co., Inc.
Product Service
Legal Case #:6229

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
232211	5/24/2011	5/25/2011	5/25/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	West Jefferson Hardware	---	West Jefferson	4 W. Main St. PO Box 270	West Jefferson	NC	28694		W 336-246-3421 E derekgreen@truevalue.net

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015 Improper Maintenance		Unknown	
S	Concern:1008 Fired on Bolt Closing			
C FBC				

Dealer sent gun in with a note stating that gun fires when closing the bolt. df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/22-250 REM	n/a	B6265204	DA	9/17/1980
Date Purchased	Where Purchased	Accessories	Original Owner			
	CULLUM/BOREN DALLAS TX	TWO PIECE BASE	U			

CONCERN:FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion - Quote to repair under BLM						

Repair/Replacement Cost	Repair/Replacement Date
\$30.40	6/1/2011

6/1/11: Per Ilion - TA dirty, sticky, parts are working sluggish. Replace TA, clean & test fire under BLM - quote. I called dealer & went over exam. He will get with consumer about quote & call us back. df 6/2/11: Derek Green @ store called back & apprvd repair & asked me to send back COD. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		5/25/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4015	Improper Maintenance	
Barrel	Description		24" 22-250 REM
	Date Code		DA
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	BINDS,SLUGGISH
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.010
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY,STICKY,PARTS WORK SLUGGISH WILL FOLLOW DOWN
	Pull	---Select---	3#
	Altered	True	PULL SCREW ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE BASE

6229

24"
DA 9/80
3#
010

True Value
W. J. HARDWARE

4 West Main St. • P.O. Box 270
West Jefferson, NC 28694
PH: (336) 246-3421


SINCE 1947

5/17/11

Remington Arms Co.

I am sending you a Remington 700 BDL 22-250 Serial # B6265204. This gun Fires when you close the bolt without pulling the trigger. Please repair this and return to me.

Thanks,

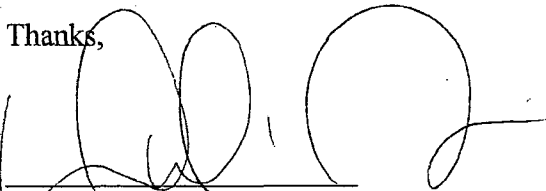

Derek C. Green
West Jefferson Hardware Co.
4 W. Main St.
P.O. Box 270
West Jefferson, NC 28694

336-246-3421

derekgreen@truevalue.net

FFL# 1-56-009-01-4B-00818

Serial Number:

B6265204

Model: **700**



RE00232211

T.A. dirty + sticky, parts are
working sluggish. Replace TPA,
clean + test fire under BLP
Con \$ 22.00 + ship.

Quote

RECEIVED
MAY 31 2011

BY:.....





