

Remington Arms Co., Inc.
Product Service
Legal Case #:7005

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
248218	12/6/2011	12/7/2011	12/7/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Bullseye Shooting Range		Bullseye Shooti	1281 Andersen Dr, Ste K	San Rafael	CA	94901		

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4038 Could Not Duplicate Concern		Unknown	
S	Fired on bolt closing Concern:1008 Fired on Bolt Closing			
C				

1/3/12 Per note on SR, gun fires when bolt is closed.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/7MM REM MA	27169	S6566174	RA	11/7/2006 9:23:58 AM
Date Purchased	Where Purchased	Accessories	Original Owner			
	MT SPORTS, LLC	AFT MKT MUZZLE BRAKE	U			

CONCERN:FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean, test fire at no charge						
	Repair/Replacement Cost	Repair/Replacement Date				
	65.39	1/3/2012				

1/3/12 Per Ilion, could not duplicate concern. Trigger assm functions as designed. To restore confidence in rifle, replace TPA, clean, test fire at no charge.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		12/7/2011
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		24" 7MM REM MAG XCR
	Date Code		RA
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	DID NOT CLOSE ON SAAMI OVERMAX ON BELT GAUGE
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		XMP SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.005
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Functioning	
	Pull	---Select---	3#
	Altered	False	
	Sub-Assembly	X-Mark Pro	
Non-Remington Components	Description		AFT MKT MUZZLE BRAKE

frmRepairMain - Repair Inquiry

Repair Number: RE00248218

Serial: S6566174 Model 700 7MM REM MAG
Produced: 11/07/2006 Repair CNT: 3 SKU: 27169

Repairman: Chuck Dekanek

Verify Repair

Status: Estimating 12/6/2011 10:13:55 AM

ADDRESS INFORMATION

Customer		☒ Received from	Return To		☐ Received from
Name:	BULLSEYE SHOOTING RANGE		BULLSEYE SHOOTING RANGE		
Address 1:	1281 ANDERSEN DRIVE		1281 ANDERSEN DRIVE		
Address 2:	STE K	PO Box:	STE K	PO Box:	
City:	SAN RAFAEL		SAN RAFAEL		
State:	CA	Zip Code:	94901	Country:	US

FFL:

01011900

Contact / Condition Problems Estimate History / Status Shipping / Billing

Problems Reported

Code	Desc
M238	CLEAN & INSPECT (SAFETY ...

Problems Found

Code	Desc
------	------

Repair Notes

could not duplicate concern
T.A. functions as designed
To restore confidence in RPK
will replace TPA,
clean & test RPK
AT N/C
#260974

Repairman's Comments

CSR Comments

gun fires when bolt is closed


Refresh

Close

Serial Number:

S6566174

Model: 700

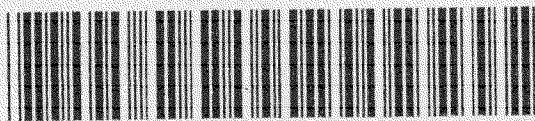

RE00248218





