

Remington Arms Co., Inc.
Product Service
Legal Case #:7203

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
252495	1/4/2012	1/5/2012	1/5/2012				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Bullet Stop Gunshop		Bullet Stop Gun	2100 Harlem Rd	Loves Park	IL	61111		W 660-355-4867

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4038	Could Not Duplicate Concern		
S	Fired on bolt closing	Concern:1008 Fired on Bolt Closing	Unknown	
C				

1/24/12 Per note with rifle, firing on closing and hard to open.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/223 REM	84206	G6920578	XD	12/4/2009 4:56:23 PM
Date Purchased	Where Purchased	Accessories	Original Owner			
	BULLET STOP GUN SHOP		U			

CONCERN:FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA


Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, check, test no charge to restore confidence						
	Repair/Replacement Cost	Repair/Replacement Date				
	50.63	1/24/2012				

1/24/12 Per Ilion, could not duplicate concern. Will replace TPA, check, test no charge to restore confidence.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/5/2012
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		20" 223 REM HB
	Date Code		XD
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	

Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		XMP SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.010
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	
	Pull	---Select---	4#
	Altered	False	
	Sub-Assembly	X-Mark Pro	

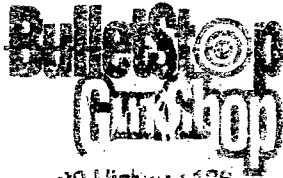

3680 Highway 136
CONVILLE, VA 23565
(660) 355-GUN (4867)
www.bulletstopguns.com

7203

70"
XD12/06
9. #
010

CUSTOMER'S C		PHONE		DATE	
				12-14-11	
NAME Remington					
ADDRESS					
CASH	C.O.D.	CHARGE	ON ACCT.	MOSE. RET'D	PAID OUT
DESCRIPTION PRICE AMOUNT					
Remington					
700 223					
G 6920578					
Firing on closing &					
hard to open tkx					
SOLD BY	RECEIVED BY			TOTAL	

All claims and returned goods
MUST be accompanied by this bill.

Thank

ul

6609

PRODUCT 2530

G6920578

Model: 700



RE00252495

could not duplicate concern
To restore confidence in ~~the~~
Rifle will replace TPA, check over +
Test fire AT N/E

warranty



