

Remington Arms Co., Inc.  
Product Service  
Legal Case #:8602

## Case Information

| RE#    | Date Opened | Date Opened(PS) | Date Closed | Incident Date | Pre Lit | Lit | Obsolete |
|--------|-------------|-----------------|-------------|---------------|---------|-----|----------|
| 299947 | 2/8/2013    | 2/11/2013       | 2/11/2013   |               |         |     |          |

## Customer Information

| Type     | Business                | First Name      | Last Name         | Street | City | State | Zip | Age | Contact                                      |
|----------|-------------------------|-----------------|-------------------|--------|------|-------|-----|-----|----------------------------------------------|
| Reporter | Tooele City Police Dept | Tooele City Pol | 323 North Main St | Tooele | UT   | 84074 |     |     | W 435-241-0141<br>E lcollings@tooelecity.org |

## Incident Information

| Claims                                                                            | Codes                               | Repair Est.                        | Medical Treatment | Medical Status |
|-----------------------------------------------------------------------------------|-------------------------------------|------------------------------------|-------------------|----------------|
| PI                                                                                |                                     |                                    |                   |                |
| PD                                                                                | Cause:4038                          | Could Not Duplicate Concern        |                   | Unknown        |
| S                                                                                 | Fired when moving from Safe to Fire | Concern:1007 Fired on Safe Release |                   |                |
| C                                                                                 |                                     |                                    |                   |                |
| 2/22/13 Per note with rifle, gun fired when safety was moved from safe to fire.cm |                                     |                                    |                   |                |

## Firearm Information

| Mfg.           | Type                      | Model/Ga.   | SKU            | Serial   | Bbl. | DOM                  |
|----------------|---------------------------|-------------|----------------|----------|------|----------------------|
| Remington      | CF/BA                     | 700/308 WIN | 84207          | G6871905 | PD   | 6/10/2009 8:54:41 AM |
| Date Purchased | Where Purchased           | Accessories | Original Owner |          |      |                      |
|                | ACUSPORT (OH) CORPORATION |             | U              |          |      |                      |

CONCERN: FSR

Ammunition Information - None Defined

Other Products Information - None Defined

## Settlement

| Settlement                                                      | Release of Claims       | Release Date | Reimbursement | Cash Settlement | Reim. Date APV | Cash Date APV |
|-----------------------------------------------------------------|-------------------------|--------------|---------------|-----------------|----------------|---------------|
| Per Ilion, will replace TPA, clean and test as goodwill gesture |                         |              |               |                 |                |               |
| Repair/Replacement Cost                                         | Repair/Replacement Date |              |               |                 |                |               |
| 50.20                                                           | 2/22/2013               |              |               |                 |                |               |

2/22/13 Per Ilion, could not duplicate concern. To restore confidence in rifle, will replace TPA, clean and test as goodwill gesture.cm

## Examination[Remington/CF/BA]

| Part        | Sub-Part               | Code                        | Comment     |
|-------------|------------------------|-----------------------------|-------------|
| Examination | Examiner               |                             | B.TRAVIS    |
|             | Exam Date              |                             | 2/11/2013   |
|             | Product Type           |                             | RF          |
|             | Action Type            |                             | A           |
|             | Assigned To            |                             | S.NICHOLS   |
| Cause       | 4038                   | Could Not Duplicate Concern |             |
| Barrel      | Description            |                             | 20" 308 WIN |
|             | Date Code              |                             | PD          |
|             | Bore Plugged           | False                       |             |
|             | Bulged                 | False                       |             |
|             | Fired                  | False                       |             |
|             | Fired while Obstructed |                             |             |

|              |                        |                            |                                                                          |
|--------------|------------------------|----------------------------|--------------------------------------------------------------------------|
|              | Muzzle/Crown Condition | Slightly Worn; Functioning |                                                                          |
| Bolt         | Firing Pin             | Slightly Worn; Functioning |                                                                          |
|              | Shroud                 | Slightly Worn; Functioning |                                                                          |
|              | Face                   | Slightly Worn; Functioning |                                                                          |
|              | Handle                 | Slightly Worn; Functioning |                                                                          |
|              | Stop                   | Slightly Worn; Functioning |                                                                          |
| Extractor    | Condition              | Slightly Worn; Functioning |                                                                          |
|              | Cut Condition          | Slightly Worn; Functioning |                                                                          |
|              | Ext/Eject Test         | False                      |                                                                          |
| Locking      | Block Condition        | ---Select---               |                                                                          |
|              | Lug Condition          | Slightly Worn; Functioning |                                                                          |
|              | Notch Condition        | ---Select---               |                                                                          |
| Overall      | Exterior Condition     | Slightly Worn; Functioning |                                                                          |
|              | Stock Condition        | Slightly Worn; Functioning |                                                                          |
|              | Fore End Condition     | ---Select---               |                                                                          |
| Receiver     | Condition              | Slightly Worn; Functioning |                                                                          |
|              | Bulged                 | False                      |                                                                          |
| Safety       | Description            |                            | XMP SAFETY                                                               |
|              | Function               | Like new; Functioning      |                                                                          |
| Sear         | Lift                   | ---Select---               | .011                                                                     |
|              | Notch                  | Slightly Worn; Functioning |                                                                          |
|              |                        | Test Fired                 | False                                                                    |
| Feeding Test | Tests                  | False                      |                                                                          |
| Trigger      | Condition              | Slightly Worn; Functioning | TRIG PULL WILL NOT FALL UNDER 3.5# EVEN WITH TRIG ADJUSTING SCREW AT MAX |
|              | Pull                   | ---Select---               | 3.5#                                                                     |
|              | Altered                | True                       | SEALANT MISSING PULL SCREW TURNED OUT PAST MIN ADJUSTMENT                |
|              | Sub-Assembly           | X-Mark Pro                 |                                                                          |

20"  
PDG/09  
3.54  
011

8602

The Oquirrh Traders  
14 West Vine Street  
Tooele, UT 84074  
435-882-7472

September 24, 2009 10:34:45

Layaway 404831

Transaction # 1170169  
Employee PW  
Account# 840186

Tooele City Police Dept  
323 N Main  
Tooele, UT 84074

Serial Number:

G6871905

Model: 700



RE00299947

549.99 X 1 549.99 T  
REM 700SPS TACT. 308

93.99 X 1 93.99 T  
HARRIS BIPOD 6-9" NOTCHED

39.59 X 1 39.59 T  
LEUPOLD RINGS PRW

SUBTOTAL 683.57

LAYAWAY TOTAL 683.57

CHANGE DUE 0.00

-650.00  
33.57

LAYAWAY REQUIREMENTS: Maximum Time Limit For Layaways Is 3 Months

Payments Expected Every 30

Days

No Refunds And Exchanges Ar

e Provided


X

Thank You!!!

RECEIVED  
FEB 12 2013

Gun fired when safety was  
moved from safe to fire.

could not dup. concern.  
To restore confidence in  
RKH will mp. TPA, clean  
& rest as good - will gesture

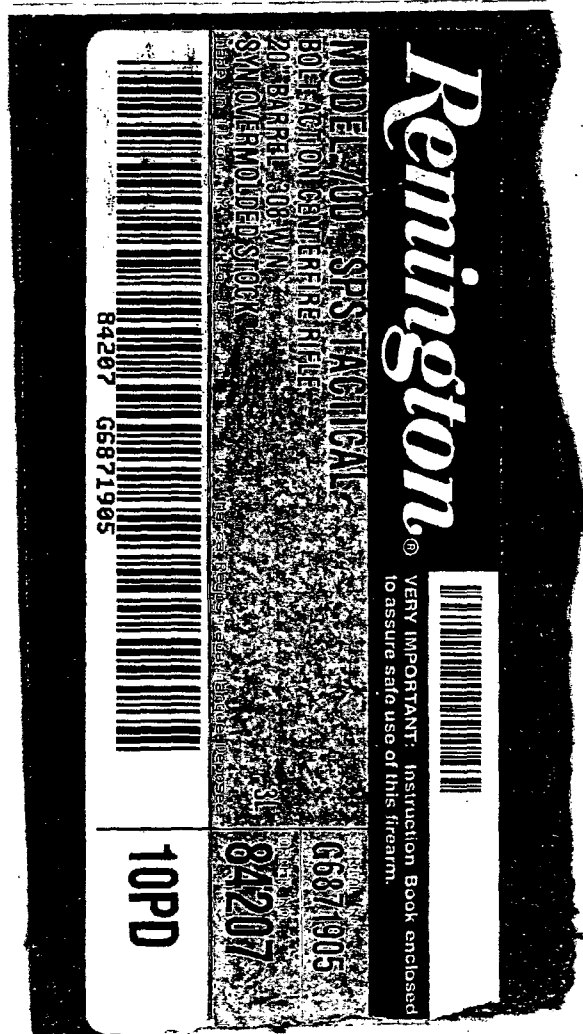

Repair Number: **RE00280643**

Serial: G6871905 Model 700 RIFLE Caliber: 308  
Produced: 06/10/2009 Repair CNT: 2 SKU: 84207

Repairman: Chuck Dekanek

Status: Shipped 9/10/2012 8:30:04 PM

Verify Repair

1st Repair

ADDRESS INFORMATION

Customer

☒ Received from

Name: TOOEE CITY POLICE DEPARTMENT

Address 1: 323 NORTH MAIN ST

Address 2: PO Box:

City: TOOEE

State: UT Zip Code: 84074 Country: US

Return To

☐ Received from

Name: TOOEE CITY POLICE DEPARTMENT

Address 1: 323 NORTH MAIN ST

Address 2: PO Box:

City: TOOEE

State: UT Zip Code: 84074 Country: US

FFL: 01011960

Contact / Condition

Problems

Estimate

History / Status

Shipping / Billing

Contact Information

Phone: 435 241 0141

Fax:

Email: lcollings@tooelecitey.org

Comments: c/o Sgt. Lonnie Collings

Received Condition

Good

Condition Notes

CSR Notes: Accidental discharge after chambering round. Grippped rifle after chambering when rifle

Accessories Received

| Code | Desc       | Qty |
|------|------------|-----|
| A007 | With Stud  | 2   |
| A016 | Scope Base | 1   |

Repair Search

Refresh

Close



