



File Edit View Records Window Help



Customer Service Data Entry

File Number: 9524 Arms Service number: 9708396

Last Name: GUN CONNECTION THE First Name:

Street: 5450 N W ST F O BOX 8475 City: PENSACOLA

State: FL Zip: 32505 Home Ph:

Work Ph: 904 433 8822 Product Type: F F A T O

Type Concern: S PI PD P S C Concern Code: 1007

Concern: FIRED ON SAFE RELEASE

Cause Code: 4015 Cause: IMPROPER MAINTENANCE

Assigned To: KAST Classification: UNJ UNJ UNC UND J

Settlement Detail: REPAIR SPCL PRICE Settlement Amount: \$0.00

Date Opened Rem: 4/21/97 Date Opened by P/S: 4/21/97 Caliber: 30-06

Date of Incident: Date Closed: Bullet Weight:

Date to Analysis: Date from Analysis: Manufacturer: REM

Model: 700 Serial: A6876815 Date Code: 40 Date Mfgd: 3/1/83

RAMAC: 730 Litigation: PreLitigation: Obsolete:

Custody: Comments:

Time Modification: 3:33:15 PM Date of Modification: 4/21/97

PatSer
2.0kuntitled
Custody initials

FLTR

CAPS INUM

RECEIVING AND ESTIMATING REPORT

COMMENTS

ORDER
R 97-08396

INITIAL CUSTOMER ORDER NO.

PRODUCT SERVICE

JJM

DATE RECEIVED	DATE OPENED	DATE CODE	SERIAL NUMBER	NEW SERIAL NUMBER	MODEL AND GRADE
04/18/97	04/21/97	AD 3-83	A6876815		700 30-06 CLASSIC
ACCESSORIES W/STUDS SCOPE BASE					

FROM:

SHIP TO:

GUN CONNECTION, THE
5450 N "W" ST
PO BOX 8475
PENSACOLA

FL 32505

GUN CONNECTION, THE
5450 N "W" ST
PO BOX 8475
PENSACOLAFL
32505

CUST NO:138440 C.O.D.L

ACCOUNT NUMBER

ACCOUNT NUMBER N/C

WRITE ☐

PROM. DATE

ESTIMATED

VIA

UPS

GUN CONDITION

- ☐ NEW
☒ LIGHTLY WORN
☐ WORN
☐ VERY WORN
☐ UNREPAIRABLE
☐ MARRED

REPAIR CHARGE

EXCISE

TAX

INSURANCE

UPS

PARCEL POST

TOTAL

38.00

CUSTOMER CONCERN	AMMO	FUNCTION	FINISH	ACCURACY	FIT	INSPECT
CYCLE	A1	B1				
TRIGGER GROUP		B2			E1	F1
BOLT ASSY.		B3				F2
BARREL ASSY.		B4	D1	E3		F3
REC. ASSY.						F4
WOOD			C1	D3	E5	F5
METAL			C2			

MAIN FAULT

No perceptible trigger travel as req'd. Fires when safe is released after pulling trigger with safe on. TRIGGER IS NOT RETURNING because the inside of the housing and trigger are gummed up with old solidified oil. Exchange trigger at a special price to restore customers confidence in the rifle.

PARTS

COMMENTS

trigger pull 2 1/2 to 3 1/4 as req'd.

See owners manual for proper care and maintenance.

REPAIRMAN

PROOF

CLEAN

TEST

TARGET

PATTERN

GALLERY TESTER

DATE

DATE

DATE


DATE

DATE

OFFICE COPY

RD6925 REV. 11/96

PS 34598

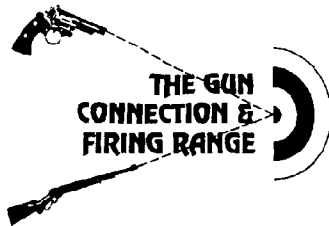

5450 N. "W" STREET
P.O. BOX 8475
PENSACOLA, FLORIDA 32505-0475

(904) 433-4888
Fax: (904) 435-8822

RETURN AUTHORIZATION #	
DATE 4-8-97	BRAND REMINGTON
MODEL # 700	
SERIAL NO A6876815	
F.O.B.	

SHIP TO	CUSTOMER NAME
REM. ARMS CO. INC.	THE GUN CONNECTION
ARMS SERVICE DIVISION	5450 N. "W" ST.
ILION, NY	PENSACOLA FL.
13357	32505

DESCRIPTION
CUSTOMER'S PROBLEM: (WHEN GUN IS LOADED AND ON FIRE, THE SAFE LEVER WILL NOT GO TO SAFE, HE SAID - THE GUN WILL SOMETIMES FIRE WHEN MOVING THE SAFE LEVER - THE ABOVE PROBLEMS ARE NOT CONSISTENT AND I COULDN'T GET IT TO MALFUNCTION, / REMIT

Authorized Signature

Sammy R. Hill