0000

RI 02893

Warwick

BARBER - Kinzer PPS GAL RE 0010994 Remington Arms Co., Inc.

Product Service Legal Case #:5340

Case Information

Date Opened Date Opened(PS) **Date Closed Incident Date** Obsolete RE# Pre Lit Lit 12/8/2010 12/8/2010 12/3/2010 212409

Customer Information

First Last Name Type **Business** Street City State Zip Age Contact Name 289 Cowesett Ave. West W 401-826-Heritage Gun & Coin Heritage Gun

Reporter Company, Inc

Incident Information Claims Codes Repair Est. Medical Treatment Medical Status

Unit 7

PΙ

Cause:4038 Could Not Duplicate Concern PD Unknown Concern:1008 Fired on Bolt Closing

S Fires on bolt closing occasionally

12/19/10 Per letter with rifle, when you open bolt then close it, firing pin will fall as you close bolt (no finger on trigger). Doesn't happen every time, but will happen if you work the bolt several times.cm

Firearm Information

Mfg. Type Model/Ga. SKU Serial Bbi. DOM Remington CF/BA 700/30-06 SPR 25634 B6755656 RE 11/1/1985 **Date Purchased** Where Purchased Accessories **Original Owner**

JERRY'S SPORT CENTER IN06111

TWO PIECE SCOPE BASE U

CONCERN:FBC

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Cash Reim. Date Cash Date Release of Claims Settlement Release Date Reimbursement Settlement APV APV

Per Ilion, replace TPA, clean, test at 1/2 normal charges

> Repair/Replacement Repair/Replacement Cost Date

12/19/10 Per Ilion, could not duplicate concern. Trig assm is dirty and sticky causing parts to work sluggish. Replace TPA, clean and test fire at 1/2 normal charges.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		12/8/2010
	Product Type		RF
	Action Type		Α
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	IMPROPER MAINTENENCE
	Description		22" 30-06 SPR
Barrel	Date Code		RE
	Bore Plugged	False	
	Bulged	False	
	Fired	False	_

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=5340&Type=Case

12/19/2010

BARBER - Kinzer F	PS GAL RE 0010995		Page 2 of 2
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	STICKS, SLUGGISH
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	1
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	
	Description		STANDARD M/700 SAFETY
Safety	Function	Like new, Functioning	
	Sub-Assembly	Non-ISS	
	Lift	Select	.015
Sear	Notch	Slightly Worn; Functioning	SLUGGISH
	Tests	Test Fired	False
Feeding Test	Tests	False	
	Condition	Slightly Worn; Functioning	DIRTY, STICKY
Trigger	Pull	Select	9#
Inggo	Altered	False	
	Sub-Assembly	M/700 Non-Bolt Lock	
Non-Remington Components	Description		TWO PIECE SCOPE BASE

MU

HERITAGE GUN & COIN COMPANY, INC

289 COWESETT AVENUE, UNIT 7 WEST WARWICK, RI 02893 (401) 826-0000 GUNS (401) 826-9999 GOLD

5340

CONTACTS FRANK OF THAIND

AIRO	CIS LICHNE OR DHUID	
QUAN.	DESCRIPTION	AMOUNT
1	WHEN YOU OPEN BOUT THE	\mathcal{U}
	CLOSE ITIN FIRING PIN	WILL
	FALL AS YOU CLOSE BOLT	(AS
	TF YOU HAD YOUR FINGER	ON THO
	TRIGGER BUT IT'S NO	(_ \
	AND NOT EVERY TIME.	INFACT
	Clarity in the second	WILL HAPPEN
	IF YOU WORK BOUT SEVERA	LTIMOS
-	#B6755656	
·		
	SUB TOTAL:	
}	SALES TAX:	V
	AMOUNT DUE:	
	DEPOSIT:	N ₂ s ₂
		·
	BALANCE:	

All Lay-a-way rules apply. Ammunition cannot be returned as required by law.

Defective products must be returned to the manufacturer if under warranty.

B6755656


Model: 700



RE00212409

Could not duplicate concerns
T.A. 15 directly & sticky chasing
PARTS to work scuggesh. The hace
TPA, & LEAD + TEST fine At
1/2 Normal changes.

Quote

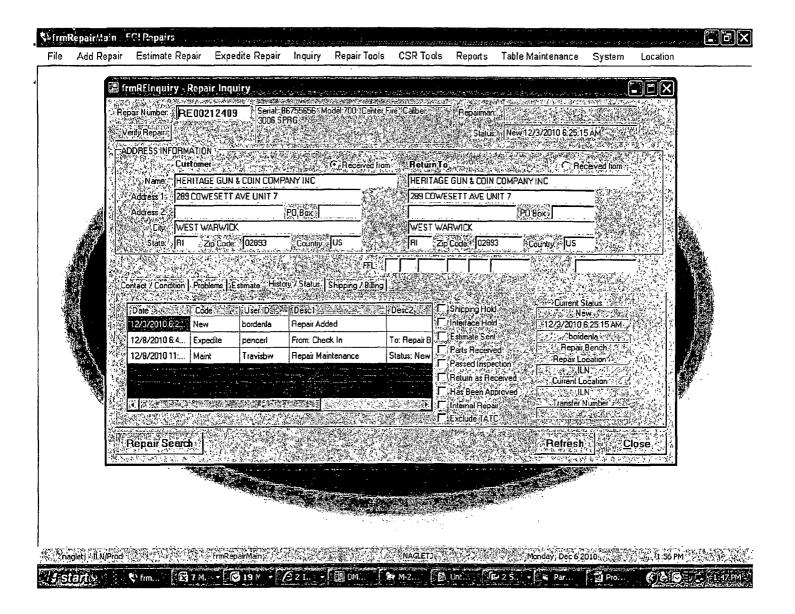

 [ij] •	<u></u> ,,	سا ہے	 كان ت	ਹ 2010	
	CEC	1	0	2010	
R	γ.				

QUOTATION

ikiningion mino company, mic.

BARBER - Kinzer PPS GAL RE 001099870 Remington Dr. P.O. Box 700

Madison, NC 27025-0700

Parts/Repairs Fax

800-243-9700 336-548-7801

www.remington.com info@remington.com

ESTIMATING REPORT

ALL PRICES QUOTED ARE IN EXCHANGE FOR REPLACED PARTS

THIS IS NOT AN INVOICE. THIS IS AN ESTIMATE TO REPAIR, RECONDITION, OR REPLACE THE ITEM(S) DESCRIBED BELOW. IF THIS IS SATISFACTORY, PLEASE APPROVE BY SIGNING BELOW AND RETURNING TO THE ABOVE ADDRESS. REPAIR TO TAKE APPROXIMATELY (4) WEEKS AFTER RECEIPT OF APPROVAL. IF WE DO NOT RECEIVE YOUR APPROVAL IN 15 DAYS, WE SHALL RETURN THE ITEM(S) AS RECEIVED POSTAGE DUE.

					77. 0.44.4		
Repair Order	Number	Description/Serial Nun	nber		Date R	eceived -	12/3/2010
RE00212409 Account # - R		B6755656				te Date - it Date -	12/8/2010 12/20/2010
	GUN & COIN COMPA SETT AVE UNIT 7	NY INC					COMPANY I IT 7
WEST WAI	RWICK. RI 02893 US			WEST '	WARWIC	K. RI 028	93 US
Phone (H) Phone (W)	(401)-826-0000		Fax Email	(401)-82	6-9999	401-88	06 -9999
	One MEX DISCOVER Card I	No.		Ехр	. Date		
Daytime Phone	e()	Time To Call		O _l	pen Acct. <u>R</u>	:	
	stomer Signature					Date	
If You	Desire Any Change Please Use	the Reverse Side For You Notice: We process checks elect					
Line and Assert		Problem	is	Ţĸĸĸĸ		Arte Cont	The second second
Reported			Found 3.5.	e vrom			
M100 M123	SEE CUSTOMERS LE FORWARD TO PROD FOR INSPECTIO		M106	COU	ILD NOT E	OUPLICAT	TE CUSTOME
ProblemNote	es Trigger assembly is di test fire at 1/2 the norm	rty and sticky causing pa					
	**************************************			Nove tests			
	Estimate **C.O.D. Material Description	Snipping and Handling C		Warranty	Price/	Discount	Extended
				Y/N	Unit	Percent	Amt
	X-MARK PRO 700 TRIG	ASSB RH BLACK (O	1	N	\$94.00	50%	\$47.00
Service 4000114	GR-SHIPPING & HAND	LING (GUN REPAIR)	1	N	\$17.00	0%	\$17.00
4000119	GR-TEST		1	N.	\$23.00	50%	
		•			Sub Total	:	\$75.50
					Est. Sales 7	Гах:	\$3.29
		•			Grand To	tal:	\$78.79
		•					

TRANSMISSION VERIFICATION REPORT

TIME : 12/23/2010 11:59 NAME :

FAX : 3365487823

TEL : SER.# : BROCØJ148005

DATE,TIME FAX NO./NAME DURATION PAGE(S) RESULT MODE 12/23 11:58 14018269999 00:00:39 02 OK STANDARD ECM

Remington.

FACSIMILE TRANSMITTAL SHEET				
	Date:	12/23/10		
Heritage Guns Coin	From:	Christy Mitchell		
401-826-9999	Fax No.:			
	Phone No.:	800-243-9700		
ages including Cover Sheet:				
ENTS:				
	Herstage Guns Coin 401-826-9999 ages including Cover Sheet:	Date: Herstage Guns Coin From: 401-826-9999 Fax No.: Phone No.: ages including Cover Sheet:		

Remington

	FACSIMILE TRA	ANSMITT	AL SHEET
То:		Date:	12/23/10
Company:	Heritage Gund Coin	From:	Christy Mitchell
Fax No.:	401-826-9999	Fax No.:	
Phone No.:		Phone No.:	800-243-9700
Number of p	ages including Cover Sheet:		
COMM	ENTS:		
		 	

PRIVILEGED AND CONFIDENTIAL

This facsimile is intended only for the use of the individual or entity to which it is addressed and may contain information that is privileged, confidential and exempt from disclosure. If you are not the intended recipient please do not disseminate, distribute, or copy this communication. Instead, please notify the sender immediately by return fax or by telephoning the number above and discard all copies of this fax.

Remington Arms Company, Inc. • 870 Remington Drive • P.O. Box 700 • Madison, NC 27025-0700 Phone 336-548-8700 • www.remington.com

