

Remington Arms Co., Inc.
Product Service
Legal Case #:5812

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
219436	1/18/2011	2/3/2011	2/3/2011				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Sportsmans Haven	---	Sportsmans Have	14695 East Pike Rd.	Cambridge	OH	43725		W 740-432-7243

Incident Information

Claims	Codes	Repair Est.	Medical Treatment—	Medical Status
PI				
PD	Cause:4038 Could Not Duplicate Concern		Unknown	
S	Concern:1008 Fired on Bolt Closing			
C	FBC			

Dealer sent gun in for consumer. Dealer stated that gun fired 2 times when bolt was closed on its own & bolt is stiff on closing. df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPR	85374	G6918726	RD	11/12/2009 9:33:29 AM

Date Purchased	Where Purchased	Accessories	Original Owner
	WAL-MART SUPERCENTER 2823	SCOPE,RINGS,TWO PIECE BASE	U

CONCERN:FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion - Check over, replace TA @ n/c - warranty						

Repair/Replacement Cost	Repair/Replacement Date
\$62.40	2/17/2011

2/17/11: Per Ilion - Could not duplicate concern. TA functions as designed. Check over completely, clean & test fire @ n/c - warranty. Gunsmith replaced TA @ n/c also. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B. TRAVIS

Examination	Exam Date	2/3/2011
	Product Type	RF
	Action Type	A
	Assigned To	T.NAGLE
Cause	4038	Could Not Duplicate Concern
Barrel	Description	24" 3006 SPR
	Date Code	RD
	Bore Plugged	False
	Bulged	False
	Fired	False
	Fired while Obstructed	
	Muzzle/Crown Condition	Like new; Functioning
Bolt	Firing Pin	Like new; Functioning
	Shroud	Like new; Functioning
	Face	Like new; Functioning
	Handle	Like new; Functioning
	Stop	Like new; Functioning
Extractor	Condition	Like new; Functioning
	Cut Condition	Like new; Functioning
	Ext/Eject Test	False
Locking	Block Condition	---Select---
	Lug Condition	Slightly Worn; Functioning
	Notch Condition	---Select---
Overall	Exterior Condition	Like new; Functioning
	Stock Condition	Like new; Functioning
	Fore End Condition	---Select---
Receiver	Condition	Like new; Functioning
	Bulged	False
Safety	Description	XMP SAFETY
	Function	Like new; Functioning
	Sub-Assembly	Non-ISS
Sear	Lift	---Select---
	Notch	Like new; Functioning
Feeding Test	Tests	Test Fired
		False
Trigger	Condition	Like new; Functioning
	Pull	---Select---
	Altered	False
	Sub-Assembly	X-Mark Pro

PURCHASE ORDER

P.O.# **4500**

Date **01-11-11**

To **Rem**

Address

City **Illion**

State **NY**

Zip

FOR

DATE REQUIRED

HOW SHIP

TERMS

QUANTITY

PLEASE SUPPLY ITEMS LISTED BELOW

PRICE

Rem

700 Camo

Calbar 30-06

SN# 66918726

Fired 2-Times when Bolt closed on its own and also Bolt is stiff on closing

Thanks

Ship To

**SPORTSMAN'S HAVEN INC.
14895 EAST PIKE RD.
CAMBRIDGE, OHIO 43725**

Please Send

Copies of Your Invoice


Purchasing Agent

**RECEIVED
FEB 04 2011**

BY:

G6918726

Model: **700**

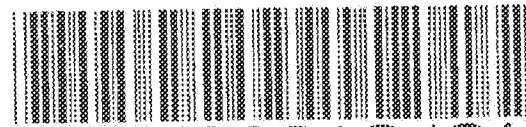

RE00219436

**could not duplicate concern
T.A. Functions as designed
check over completely, clean &
Test fire at NK**

WARRANTY

